

APP CRS	Rwy Ldg	16000
353°	TDZE	5327
	Apt Elev	5434




RNAV (RNP) Z RWY 34L
DENVER INTL (DEN)

▼ For uncompensated Baro-VNAV systems, procedure NA below -25°C (-13°F) or above 48°C (118°F). GPS required. For inoperative ALSF, increase RNP 0.10 all Cats visibility to RVR 4500 and RNP 0.20 all Cats visibility to RVR 6000 and RNP 0.30 all Cats visibility to 1½ mile. Simultaneous approach authorized. Use of FD or AP providing RNAV track guidance required during simultaneous operations.

ALSF-2

MISSED APPROACH: Climb to 5900 then climbing left turn to 10000 direct HYGEM and hold.

D-ATIS 125.6 379.9	DENVER APP CON 119.3 307.3 (N) 120.35 379.3 (S)	DENVER TOWER 135.3 351.95	GND CON 121.35 379.175 (W) 121.85 377.1 (E)
-----------------------	---	------------------------------	---

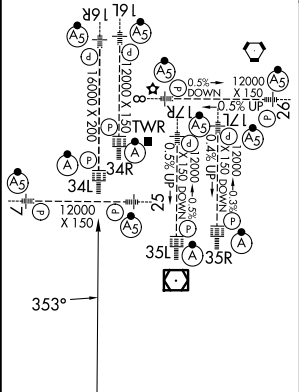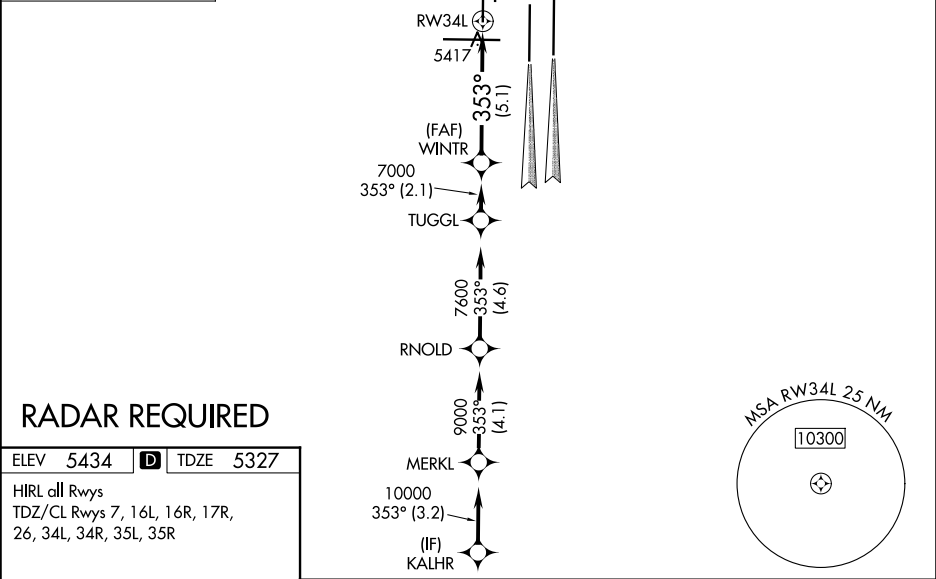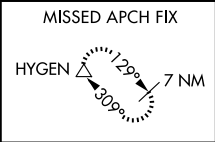

WINTR VGSi and RNAV glidepath not coincident (VGSi Angle 3.00/TCH 70).				5900 ↑	10000 ↖	HYGEN △
GP 3.00° TCH 50						
CATEGORY	A	B	C	D		
RNP 0.10 DA	5587/24 260 (200-½)					
RNP 0.20 DA	5720/45 393 (300-¾)					
RNP 0.30 DA	5782/60 455 (400-1¼)					
AUTHORIZATION REQUIRED						

SW-1, 30 OCT 2025 to 27 NOV 2025

SW-1, 30 OCT 2025 to 27 NOV 2025