

TACAN Z RWY 32R

TACAN PAM Chan 64	APCH CRS 326°	Rwy Idg 10,008 TDZE 14 Arprt Elev 17
-----------------------------	-------------------------	---

[USAF]


TYNDALL AFB (KPAM)

T * When ALS inop, increase CAT AB RVR to 55, vis to 1 mile; CAT CDE vis to 1 3/8 miles.



MISSED APPROACH: Track outbound PAM TACAN R-320 to 3 DME (PIMLE), then turn right to join PAM R-104 to 20 DME (SUSIE) and hold. Maintain 3000.


ATIS ★ 254.4	APP CON 125.2 392.1 (N abv 5000') 120.825 379.3 (N blw 5000') 124.15 338.35 (S abv 5000') 119.775 317.45 (S blw 5000')	TOWER ★ 133.95 263.15	GND CON 121.9 259.3	ASR/PAR
-----------------	--	--------------------------	------------------------	---------

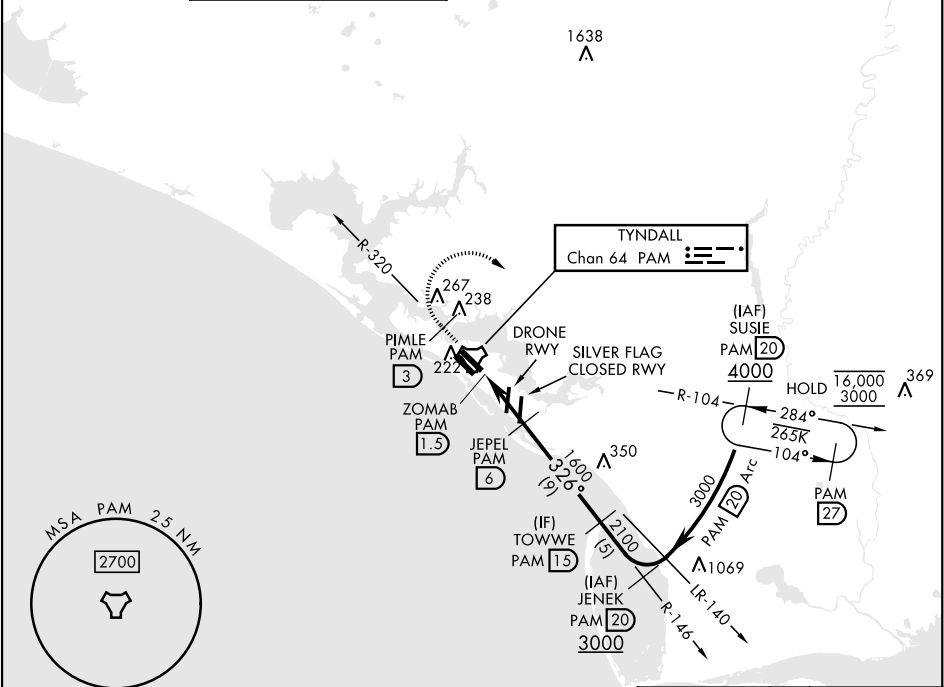


EMERG SAFE ALT 100 NM 3300

3000  PAM R-320	PIMLE PAM 	 PAM R-104	SUSIE PAM 
--	---	--	---

VGSI and descent angles not coincident (VGSI Angle 2.50/TCH 50).

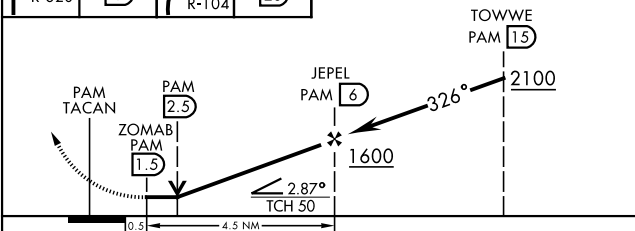

CATEGORY	A	B	C	D	E
S-32R*	480/24 466 (500-½)		480/50 466 (500-1)		
CIRCLING	540-1 523 (600-1)		540-1½ 523 (600-1½)	580-2 563 (600-2)	

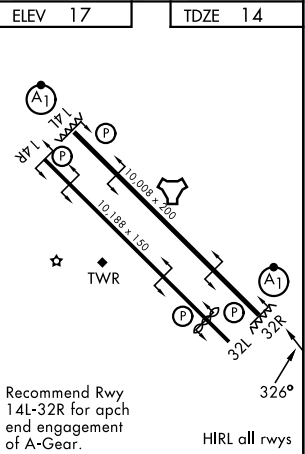

TACAN Z RWY 32R