

WAAS
CH **77710**
W34B

APP CRS
344°

Rwy Idg
TDZE **387**
Apt Elev **432**

RNAV (GPS) Y RWY 34C


SEATTLE-TACOMA INTL (SEA)

RNP APCH.
Simultaneous approach authorized with Rwy 34L. LNAV procedure NA during simultaneous operations. Use of FD or AP providing RNAV track guidance required during simultaneous operations. For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -6°C (22°F) or above 54°C (130°F).

MALSR

MISSED APPROACH:
Climb to 5000 direct MGNUM and hold, continue climb-in-hold to 5000.

D-ATIS 118.0	SEATTLE APP CON 133.65 273.45	SEATTLE TOWER 119.9 239.3 (Rwys 16L, 16C, 34C, 34R) 120.95 239.3 (Rwys 16R, 34L)	GND CON 121.7	CINC DEL 128.0	CPDLC
------------------------	---	--	-------------------------	--------------------------	-------

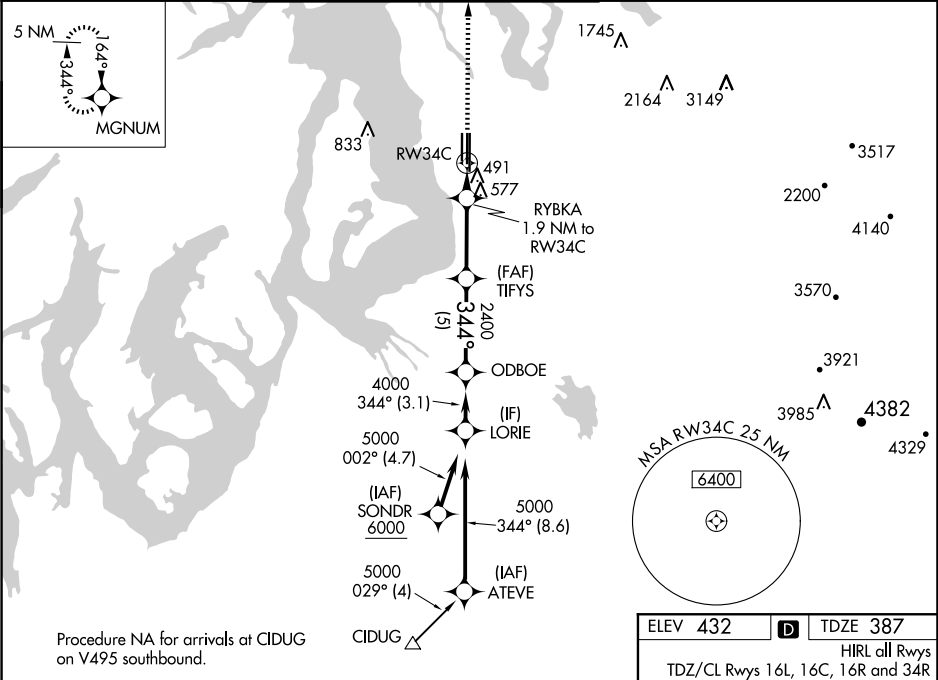

VGSI and RNAV glidepath not coincident (VGSI Angle 3.00/TCH 73).

5000

4000

2400

1020

GP 3.00°

TCH 56

3.1 NM

5 NM

4.3 NM

0.7 NM

1.2 NM

CATEGORY

A

B

C

D

LPV DA	610/24	223 (200-½)		
LNAV/VNAV DA	839/50	452 (500-1)		
LNAV MDA	880/24	493 (500-½)	880/55	493 (500-1)
CIRCLING	1000-1	568 (600-1)	1000-1½ 568 (600-1½)	1000-2 568 (600-2)

ELEV 432

TDZE 387

HIRL all Rwys

TDZ/CL Rwys 16L, 16C, 16R and 34R