

LOC I-GBI

108.5

APP CRS

055°

Rwy Ldg

7569

TDZE

708

Apt Elev

727

ILS or LOC RWY 5

BUFFALO NIAGARA INTL (BUF)

RADAR required for procedure entry. RNP APCH - GPS. ADF required for LOC only.

MALSR

MISSED APPROACH: Climb to 3000 direct TRAVA and hold.

D-ATIS

135.35

BUFFALO APP CON


126.15 263.125

BUFFALO TOWER

120.5 257.8

GND CON

133.2 257.8

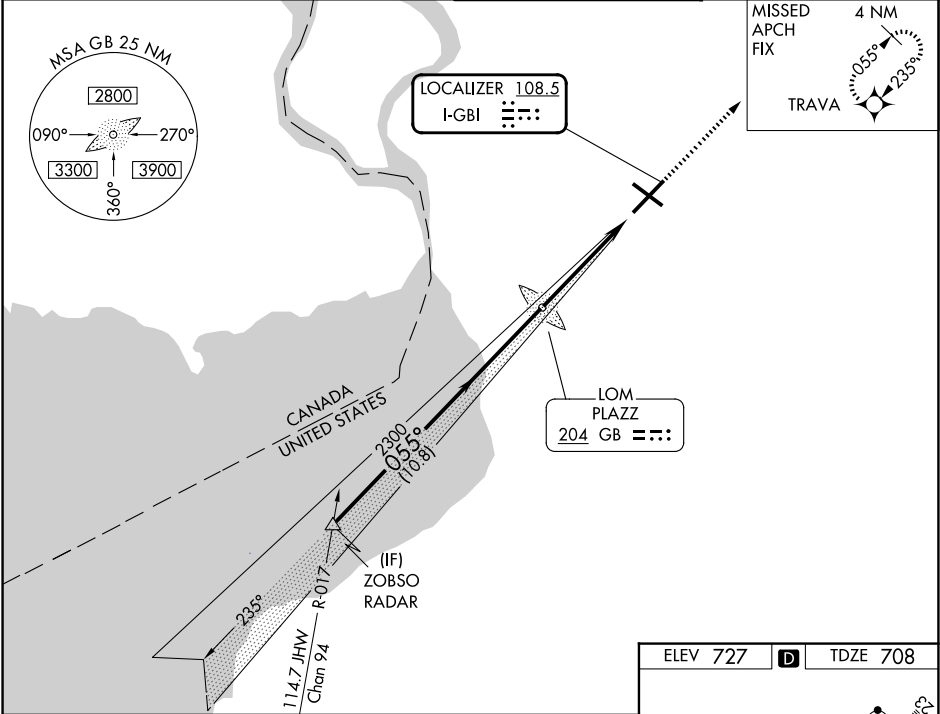

ELEV 727

TDZE 708

3000

TRAVA

GS 3.00°

TCH 46

10.8 NM

4.9 NM

| CATEGORY | A                   | B | C                    | D                  |
|----------|---------------------|---|----------------------|--------------------|
| S-ILS 5  | 908/18 200 (200-½)  |   |                      |                    |
| S-LOC 5  | 1060/24 352 (400-½) |   | 1060/30 352 (400-¾)  |                    |
| CIRCLING | 1200-1 473 (500-1)  |   | 1220-1½ 493 (500-1½) | 1340-2 613 (700-2) |

REIL Rwy 14

TDZL/RCLS Rwy 5 and 23

HIRL Rwy 5-23 and 14-32

FAF to MAP 4.9 NM

|         |      |      |      |      |      |
|---------|------|------|------|------|------|
| Knots   | 60   | 90   | 120  | 150  | 180  |
| Min:Sec | 4:54 | 3:16 | 2:27 | 1:58 | 1:38 |