


APP CRS 116°	Rwy Ldg 10000 TDZE 9 Apt Elev 9
------------------------	--


RNAV (RNP) Z RWY 12
OAKLAND SAN FRANCISCO BAY (OAK)

RNP AR APCH.	MALSR		MISSED APPROACH: Climb direct HISIS to cross HISIS at or below 1600 then climb to 5400 on track 116° to YICPU and on track 103° to DECOT and hold, continue climb-in-hold to 5400.
T For uncompensated Baro-VNAV systems, procedure NA below 0°C or above 54°C. For inop ALS increase RNP 0.15 visibility all Cats to RVR 4500, RNP 0.30 visibility all Cats to RVR 5500.			

D-ATIS 133.775	NORCAL APP CON 125.35 263.15	OAKLAND TOWER 118.3 291.65 (10L/R-28L/R, 15-33) 127.2 256.9 (1-2-30)	GND CON 121.9 (10L/R-28L/R, 15-33) 121.75 (1-2-30)
--------------------------	--	--	--

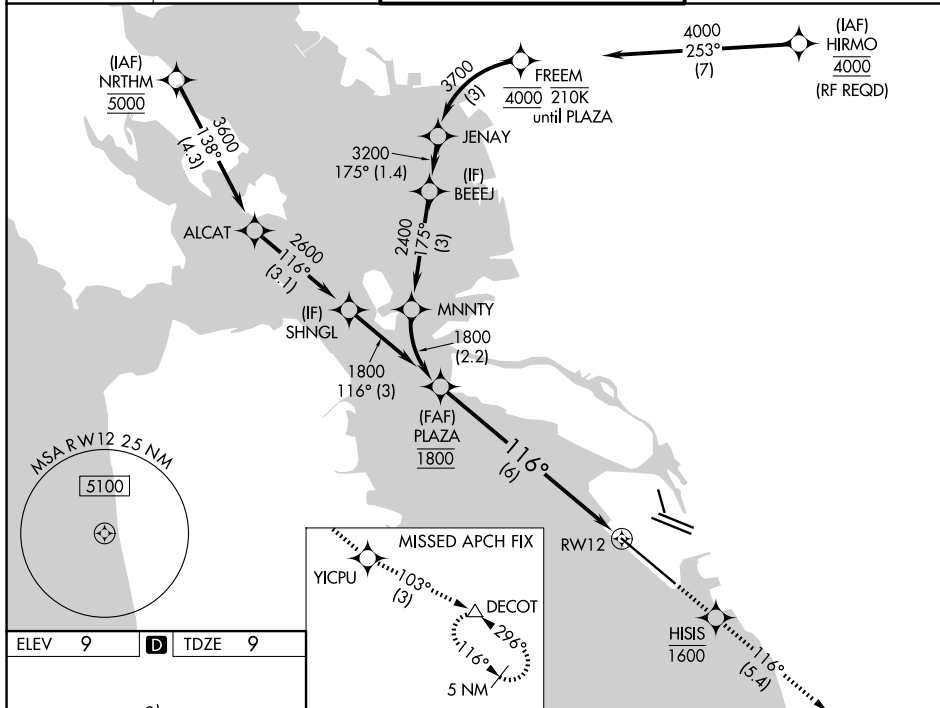

ELEV	9	D	TDZE	9
------	---	----------	------	---

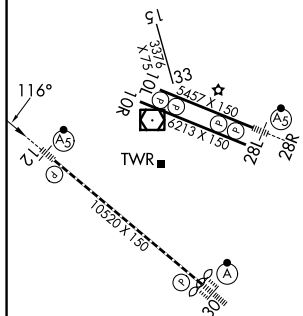

See planview for multiple IF locations.

VGS1 and RNAV glidepath not coincident
(VGS1 Angle 2.75°/TCH 70).

HISIS	5400	YICPU	DECOT
1600	tr 116°	tr 103°	△

CATEGORY	A	B	C	D
RNP 0.15 DA	289/24 280 (300-½)			
RNP 0.30 DA	386/35 377 (400-⅓)			

AUTHORIZATION REQUIRED