

CLOVIS, NEW MEXICO

TACAN RWY 31

TACAN CVS Chan 53	APCH CRS 316°	Rwy ldg TDZE Arprt Elev	8194 4270 4295
----------------------	------------------	-------------------------------	----------------------

(USAF)

CANNON AFB (KCVS)


Missed approach requires use of RNAV or ATC radar monitoring.

▼ * When ALS inop, increase CAT AB vis to 1 mile, CAT CDE increase vis to 1 3/8 miles.



SSALR
(A3)

MISSED APPROACH: Climb to 6000 out CVS TACAN R-306 to 5.5 DME (LERAY) then turn left climbing to 7000 intercept CVS TACAN R-193 to 12 DME (CLINK) and hold.

ATIS 119.1 269.9	CANNON APP CON 118.425 352.1	TOWER 120.4 270.25	GND CON 121.9 275.8	CLNC DEL 120.2 293.225
---------------------	---------------------------------	-----------------------	------------------------	---------------------------

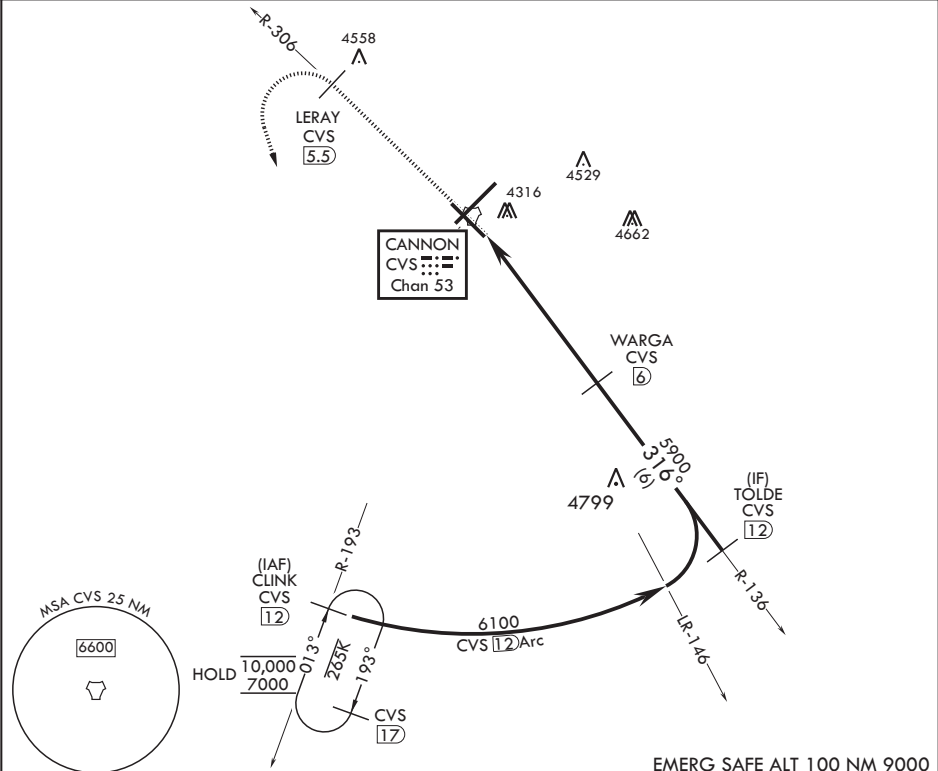

EMERG SAFE ALT 100 NM 9000

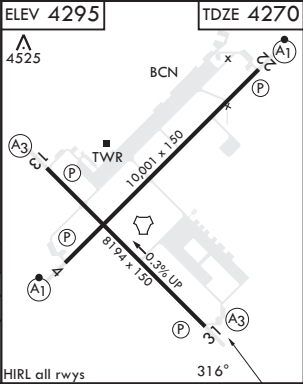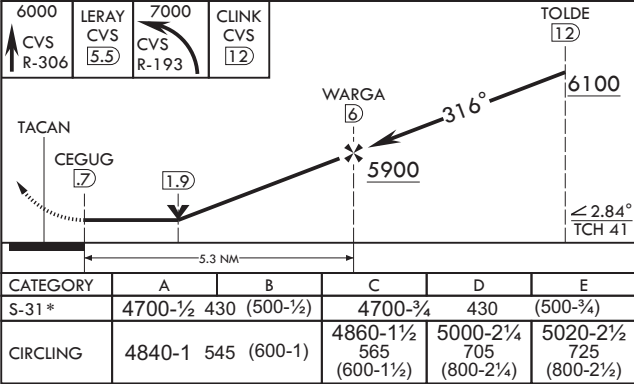

CLOVIS, NEW MEXICO

34°23'N - 103°19'W

CANNON AFB (KCVS)

Amdt 3 10OCT19

TACAN RWY 31