


LOC I-RGO 109.5	APP CRS 189°	Rwy Idg TDZE Apt Elev	7000 1218 1226
---------------------------	------------------------	-----------------------------	---

ILS or LOC RWY 19
AKRON-CANTON RGNL (CAK)

V ** RVR 1800 authorized with the use of FD or AP or HUD to DA. For inoperative ALS, increase CAT C/D visibility to RVR 6000. ZEVLO fix minimums: For inoperative ALS, increase CAT C/D visibility to RVR 5500.			MISSED APPROACH: Climb to 1700 then climbing left turn to 3000 direct BSV VOR/DME and hold.	
ATIS 121.05	CLEVELAND APP CON ★ 125.5 269.25	AKRON-CANTON TOWER 134.75 279.575		GND CON 121.7 348.6
				CLNC DEL 132.05

CAUTION: OM for Akron Fulton Intl
may be received approximately 5 miles
north of DERBY OM.

Holding not required for arrivals on ACO
VOR/DME airway radials 347 CW 185.

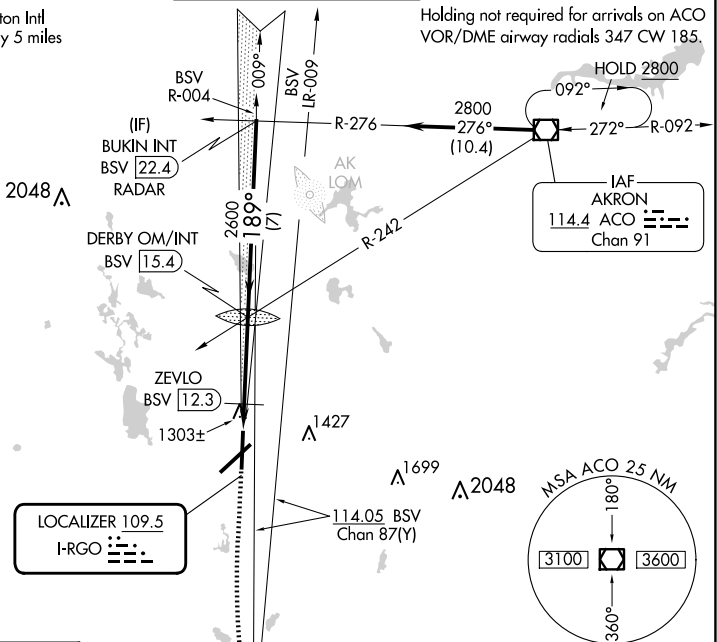


MISSED APCH FIX

BRIGGS
BSV
114.05
Chan 87(Y)

LOCALIZER 109.5
I-RGO

ELEV	1226		TDZE	1218
------	------	---	------	------

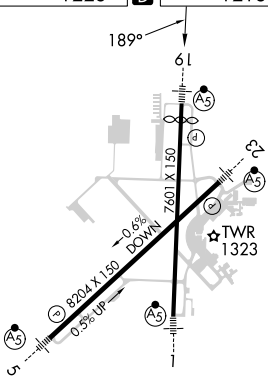

HIRL Rwy 1-19 and 5-23


FAF to MAP 4.2 NM

Knots	60	90	120	150	180
Min:Sec	4:12	2:48	2:06	1:41	1:24

AKRON, OHIO

Amdt 8B 12AUG21

40°55'N-81°27'W

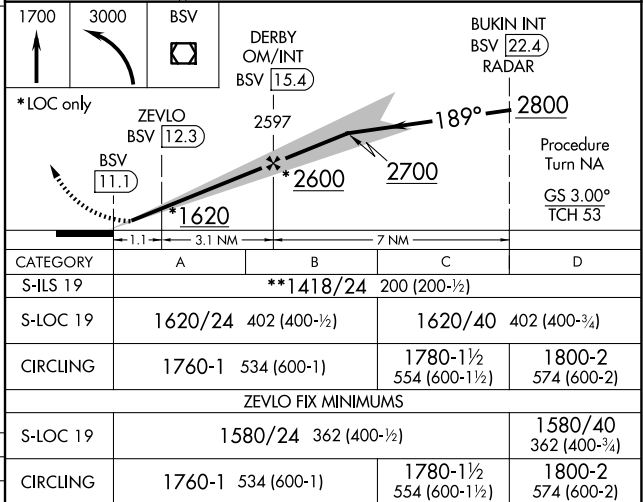

AKRON-CANTON RGNL (CAK)

ILS or LOC RWY 19