

SAN JOSE, CALIFORNIA

AL-693 (FAA)

25275

APP CRS	Rwy Ldg	7614
306°	TDZE	57
	Apt Elev	62

RNAV (RNP) Z RWY 30L
NORMAN Y MINETA SAN JOSE INTL (SJC)

RNP AR APCH.

T For uncompensated Baro-VNAV systems, procedure NA below 1°C or above 54°C. For inop ALS, increase RNP 0.10 all Cats visibility to RVR 5500 and increase RNP 0.30 all Cats visibility to 1 $\frac{3}{8}$ SM.

MALSR




MISSED APPROACH: Climb to 2000 on track 306° to ARTAQ and hold.

D-ATIS
126.95


NORCAL APP CON

SAN JOSE TOWER ★
124.0 (CTAF) **L** 257.6

GND CON
121.7

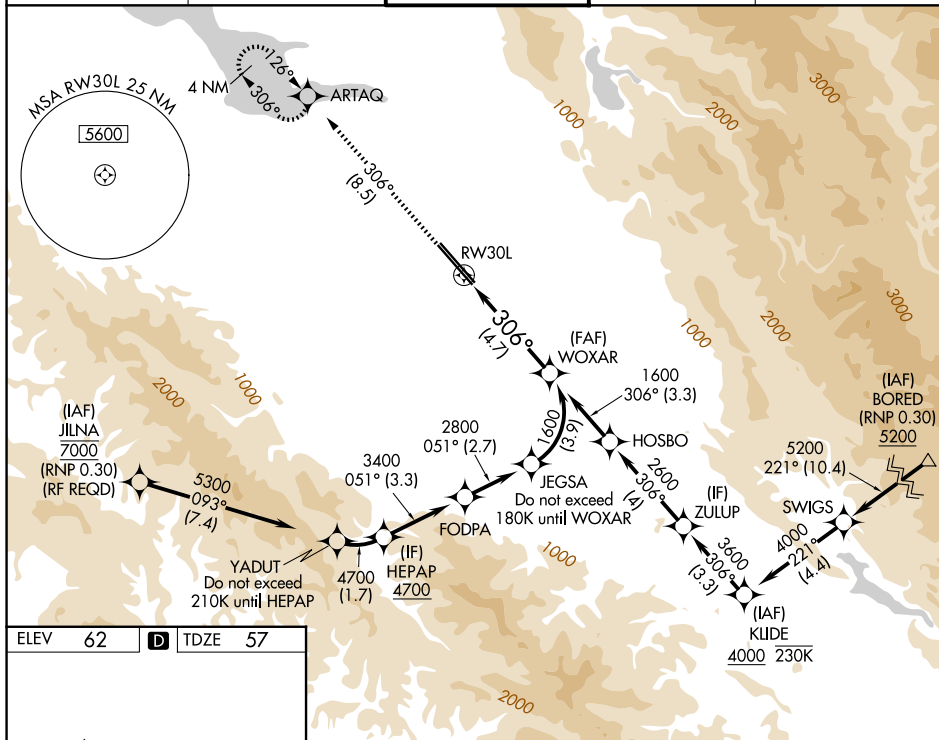UNICOM
122.95

ELEV	62	D	TDZE	57
------	----	----------	------	----

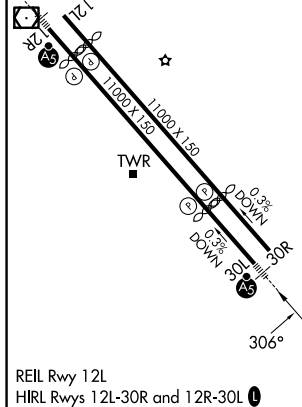

2000
↑
tr 306°

ARTAQ

VGS1 and RNAV glidepath not coincident
(VGS1 Angle 3.00/TCH 70).

W0XAR

1600

1600

306°

4.7 NM

GP 3.00°
TCH 54

See planview for multiple IF locations.

CATEGORY	A	B	C	D
RNP 0.10 DA	430/35	373 (400- ⁵ / ₆)		
RNP 0.20 DA	464/40	407 (500- ³ / ₄)		
RNP 0.30 DA	541/50	484 (500-1)		

AUTHORIZATION REQUIRED

SAN JOSE, CALIFORNIA

Amdt 4 02DEC21

NORMAN Y MINETA SAN JOSE INTL (SJC)

37°22'N-121°56'W

RNAV (RNP) Z RWY 30L

SW-2, 25 DEC 2025 to 22 JAN 2026