

LOC/DME I-AKN <u>110.3</u> Chan 40	APP CRS 301°	Rwy Ldg 8501 TDZE 73 Apt Elev 73
--	------------------------	---


LOC BC RWY 30
KING SALMON (AKN)(PAKN)

DME required.

- T** When local altimeter setting not received, use WSN/PFWS
A altimeter setting and increase all MDAs 40 feet.

MISSED APPROACH: Climb to 600 then climbing left turn to 3000 on heading 240° and AKN VORTAC R-210 to OLLER/ AKN 15 DME and hold.

ATIS 128.8	ANCHORAGE CENTER 124.8 354.0	KING SALMON TOWER* 118.3 279.5	GND CON 121.9	UNICOM 122.95	CTAF 121.9 0 352.05
---------------	---------------------------------	-----------------------------------	------------------	------------------	------------------------

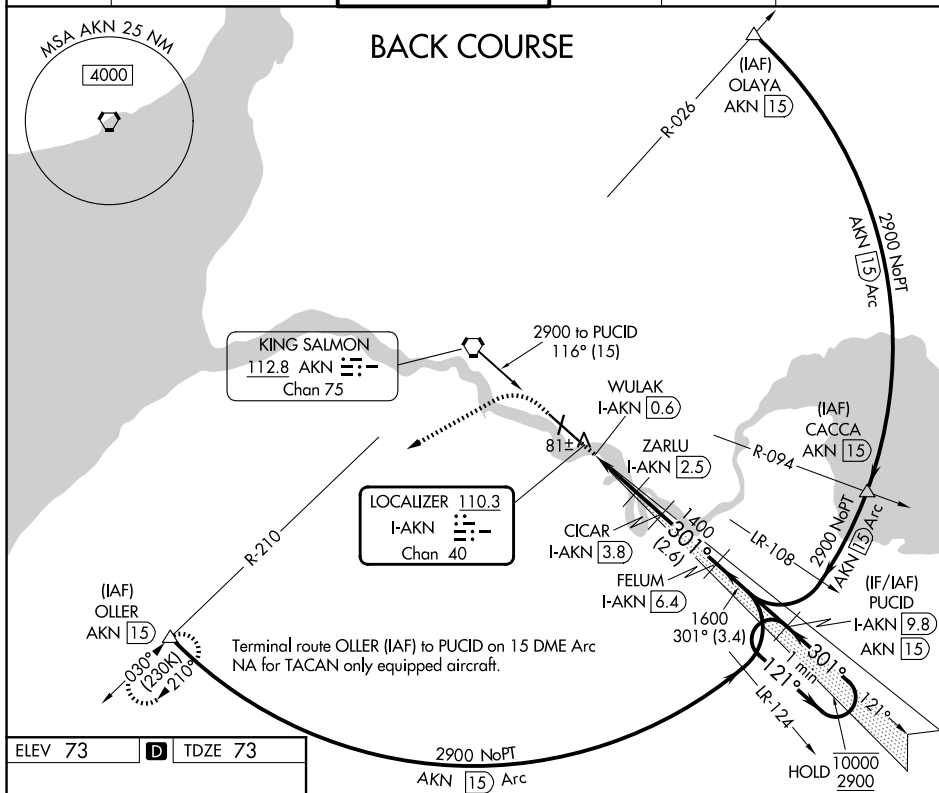

600 ↑	3000 hdg 240°	AKN R-210	OLLER △	Disregard GS indications.		PUCID I-AKN (9.8)	One Minute Holding Pattern
		AKN R-210	OLLER △	Disregard GS indications.		PUCID I-AKN (9.8)	One Minute Holding Pattern
		AKN R-210	OLLER △	Disregard GS indications.		PUCID I-AKN (9.8)	One Minute Holding Pattern
CATEGORY	A	B	C	D	E		
S-30	340-1 267 (300-1)						
CIRCLING	580-1 507 (600-1)	580-1½ 507 (600-1½)	900-2¾ 827 (900-2¾)	960-3 887 (900-3)			