

WAAS CH 58206 W18B	APP CRS 185°	Rwy Ldg 12600 TDZE 629 Apt Elev 629
--	------------------------	--

RNAV (GPS) RWY 18R
HUNTSVILLE INTL-CARL T JONES FLD (HSV)

RNP APCH-GPS.


T Circling NA for Cats C/D/E east of Rwy 18L-36R. Simultaneous approach authorized.
A LNAV procedure NA during simultaneous operations. Use of FD or AP required during
 ASR simultaneous operations. For uncompensated Baro-VNAV systems, LNAV/VNAV NA below
 -8 °C or above 54°C. For inop ALS, increase LPV Cat E visibility to RVR 4000,
 LNAV/VNAV Cat E visibility to RVR 5000, and LNAV Cat E visibility to 1¼ SM.

ALSF-2



MISSED APPROACH: Climb to 3100 direct BOSAC and hold.

ATIS 121.25	HUNTSVILLE APP CON ★ 125.6 354.1	HUNTSVILLE TOWER ★ 127.6 (CTAF) 0 350.35	GND CON 121.9 269.525	CLNC DEL 120.35	UNICOM 122.95
----------------	-------------------------------------	---	--------------------------	--------------------	------------------

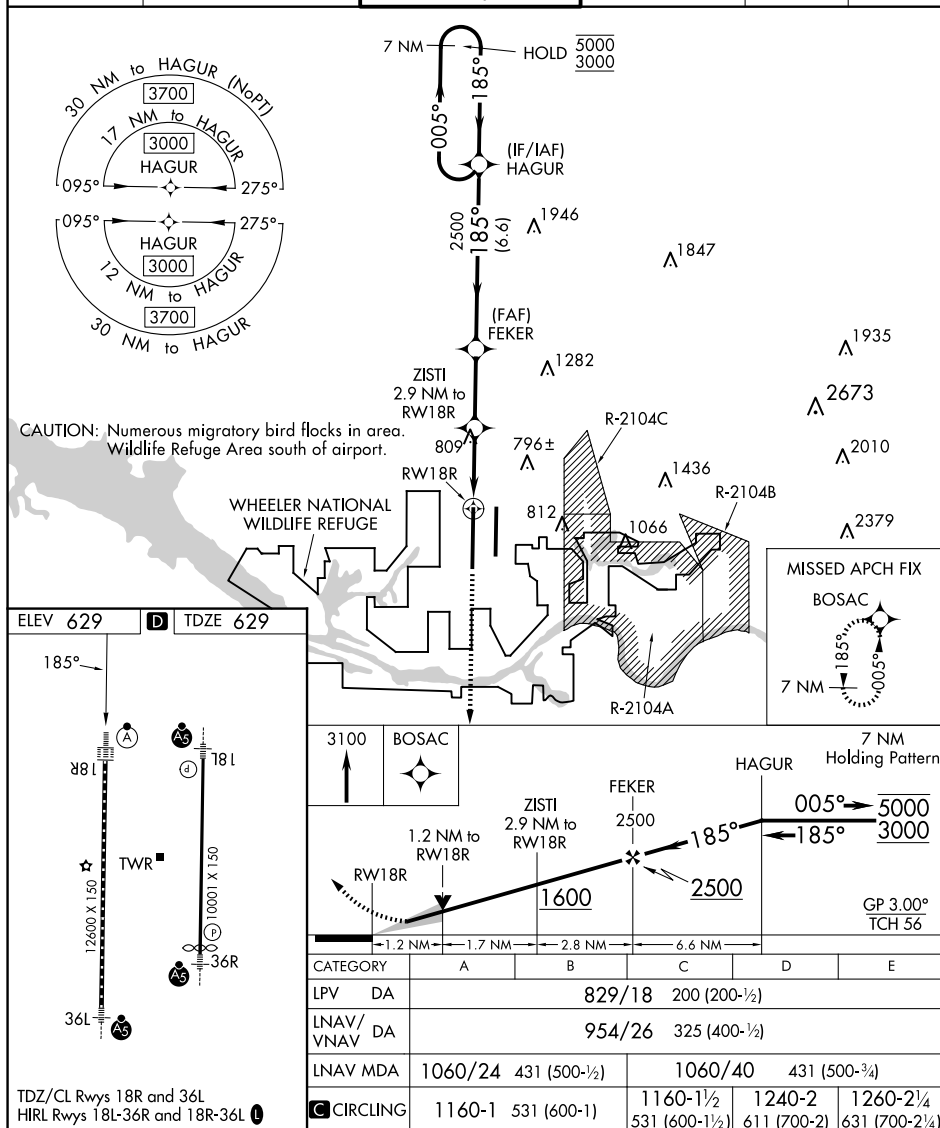

HUNTSVILLE, ALABAMA

Amdt 3 27JAN22

HUNTSVILLE INTL-CARL T JONES FLD (HSV)

34°38'N-86°47'W

RNAV (GPS) RWY 18R

SE-4, 25 DEC 2025 to 22 JAN 2026