

WAAS CH 90137 W16B	APP CRS 153°	Rwy Ldg TDZE 3432 Apt Elev 3459
--	------------------------	---

RNAV (GPS) Y RWY 16

BEND MUNI (BDN)

RNP APCH - GPS.



▼

⚠

Rwy 16 helicopter visibility reduction below ¾ SM NA. VDP NA when using Redmond altimeter setting. When local altimeter setting not received, use Redmond altimeter setting and increase all MDAs 100 feet and LP visibility Cats C and D ¾ SM, LNAV visibility Cats C and D ½ SM, and Circling visibility Cat C ½ SM.

MISSED APPROACH: Climb to 7400 direct HITUP and on track 064° to REMTE and hold, continue climb-in-hold to 7400.

AWOS-3 134.425	SEATTLE CENTER 126.15 269.475	UNICOM 123.0 (CTAF) 0
--------------------------	---	---------------------------------

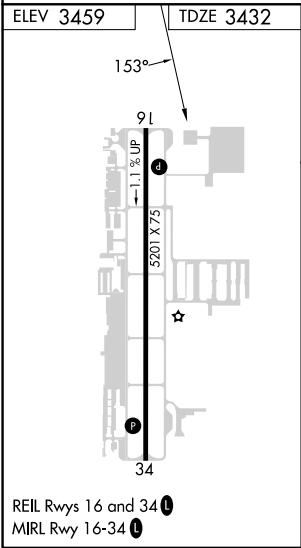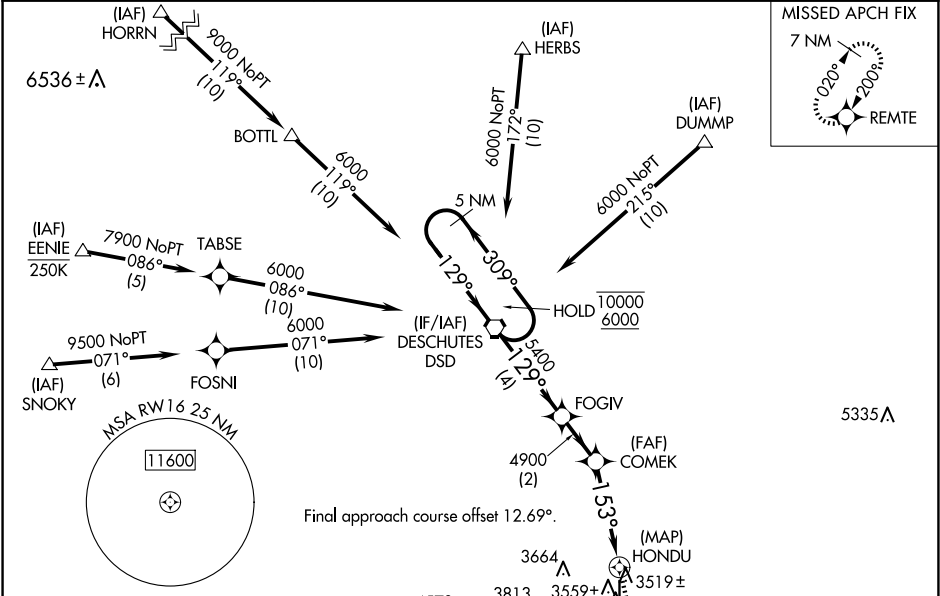

5 NM Holding Pattern		7400	HITUP	tr 064°	REMTE
10000 ← 309°		FOGIV			
6000 → 129°		COMEK			
VGSi and descent angles not coincident (VGSi Angle 3.00/TCH 38).		3.12°			
		5400			
		4900			
		153°			
		0.6 NM to HONDU			
		HONDU			
		0.5			
CATEGORY	A	B	C	D	
LP MDA	3780-1 348 (400-1)				
LNAV MDA	3820-1 388 (400-1)				
CIRCLING	3960-1 501 (600-1)	3980-1 521 (600-1)	4120-1¾ 661 (700-1¾)	4640-3 1181 (1200-3)	