


Rwy Ldg	6669
TDZE	73
Apt Elev	76

RNAV (GPS) RWY 5
WILLISTON RGNL (X60)

WILLISTON RGNL (X60)

T When local altimeter setting not received, use Ocala altimeter setting and increase all MDAs
A NA 60 feet and all Cat C visibilities $\frac{1}{4}$ SM. Circling Rwy 14, 32 NA at night. Rwy 5 helicopter
visibility reduction below $\frac{3}{4}$ SM NA. Circling NA to Rwy 18 and 36.

MISSED APPROACH:
Climb to 3000 direct
UTOZE and hold.

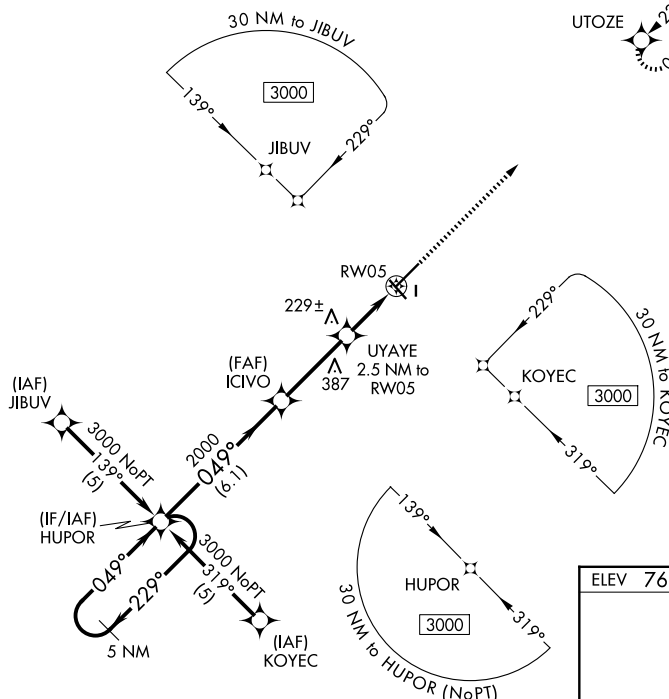UNICOM
122.975 (CTAF) **L**

5 NM Holding Pattern

HUPOR

VGSI and descent angles not coincident (VGSI Angle 3.00/TCH 38).

3000

229°

049°

049°

ICIVO

2000

3.05° TCH 45

900

UYAYE

2.5 NM to RW05

1.2 NM to RW05

1.3

1.2


6.1 NM

3.3 NM

3000

UTOZE

CATEGORY	A	B	C	D
LNAV MDA	480-1	407 (500-1)	480-1¼ 407 (500-1¼)	NA
CIRCLING	520-1 444 (500-1)	640-1 564 (600-1)	840-2¼ 764 (800-2¼)	NA

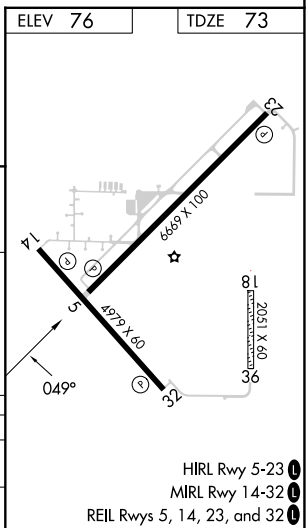

WILLISTON RG NL (X60)

RNAV (GPS) RWY 5

SE-3, 25 DEC 2025 to 22 JAN 2026

SE-3, 25 DEC 2025 to 22 JAN 2026