


LOC/DME I-MRY 110.7 Chan 44	APP CRS 098°	Rwy Ldg 7000 TDZE 198 Apt Elev 257
---	------------------------	---

ILS or LOC RWY 10R
MONTEREY RGNL (MRY)

DME required.	MALSR	MISSED APPROACH: Climb to 600 then climbing left turn to 5000 on heading 030° and on SNS VORTAC R-243 to SNS VORTAC and hold, continue climb-in-hold to 5000. # Missed approach requires minimum climb of 265 feet per NM to 1360.
⚠ Circling NA south of Rwy 10R-28L. For inop ALS, increase S-ILS 10R all Cats visibility to RVR 6000, and increase S-LOC 10R Cat C and D visibility to 2 SM.		

ATIS 119.25	NORCAL APP CON 133.0 251.15 (001°-135°) 127.15 307.125 (136°-360°)	MONTEREY TOWER ★ 118.4 (CTAF) 257.8	GND CON 120.875 348.6	UNICOM 122.95
-----------------------	--	--	---------------------------------	-------------------------

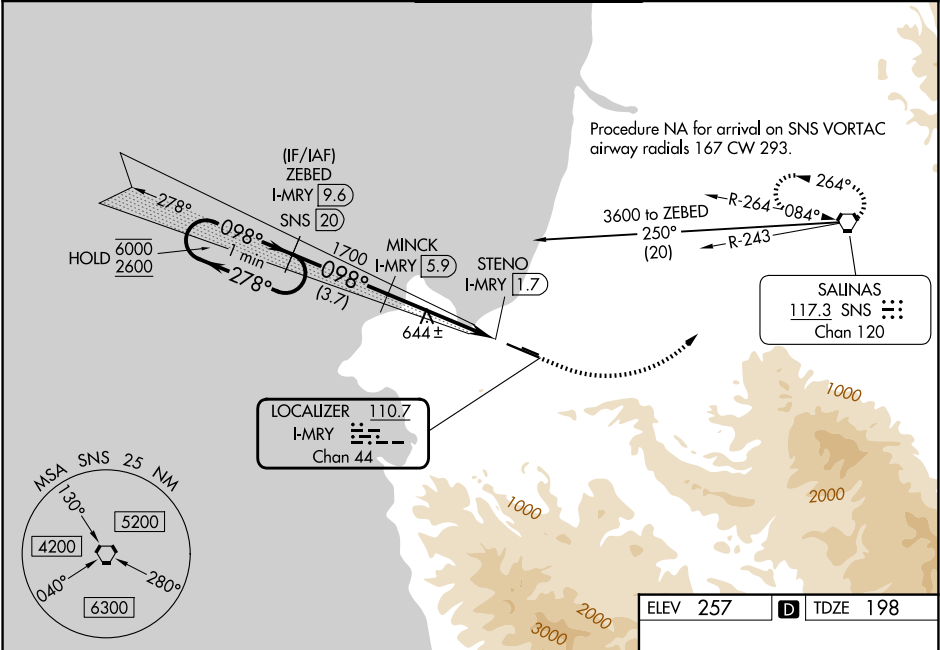

ILS unusable from 1.7 DME inbound.	ELEV 257	TDZE 198
One Minute Holding Pattern	600	5000
ZEBED I-MRY 9.6	hdg 030°	SNS R-243
MINCK I-MRY 5.9		
6000 ← 278°		
2600 ← 098°		
GS 3.00°		
TCH 45		
1700		
3.7 NM		
2.5 NM		
1.7 NM		
0.5 NM		
CATEGORY	A	B
S-ILS 10R#	398/24	200 (200-½)
S-ILS 10R	583/35	385 (400-¾)
S-LOC 10R	920/24 722 (700-½)	920-1½ 722 (700-1¾)
CIRCLING	920-1 663 (700-1)	1280-3 1023 (1100-3)
		NA
		MIRL Rwy 10L-28R
		HIRL Rwy 10R-28L
		REIL Rwy 28L
		REIL Rwy 10L and 28R