


WICHITA FALLS, TEXAS

HI-TACAN RWY 33L

TACAN SHP Chan 45	APCH CRS 334°	Rwy Idg 13,100 TDZE 1000 Arprt Elev 1019	[USAF]	SHEPPARD AFB/WICHITA FALLS MUNI (KSPS)
V * When ALS inop, increase CAT CDE vis to 1½ miles. ** Circling not authorized W of Rwy 15R-33L.			MALSR 	MISSED APPROACH: Climb and maintain 3300, intercept SHP TACAN R-335 to SHP R-335/9 DME (MEDSE) and hold.

ATIS★	APP CON	TOWER ★	GND CON	CLNC DEL	ASR
132.05 269.9	118.2 269.025	119.75 0 279.525 (CTAF)	125.5 289.4	121.2 282.225	

CAUTION: Do not confuse parallel taxiway with Rwy 15R-33L.

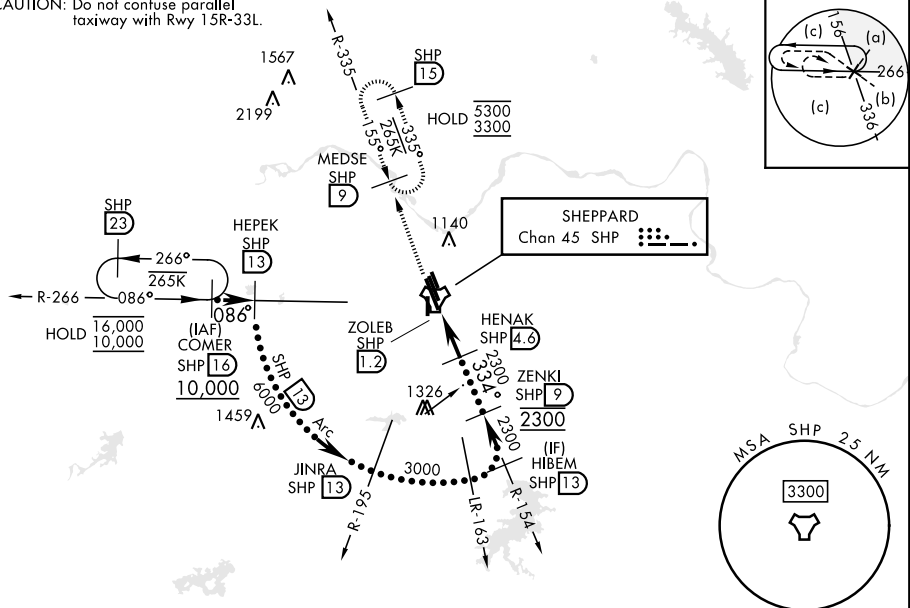

EMERG SAFE ALT 100 NM 4600

3300
↑ SHP R-335

MEDSE SHP 9

VGSI and descent angles not coincident.

SHP TACAN

ZOLEB SHP 1.2

SHP 1.9

HENAK SHP 4.6

ZENKI SHP 9

HIBEM SHP 13

3000

3300

3.06° TCH 56


0.4

3.4 NM

2300

2300

CATEGORY	C	D	E
S-33L *	1420- $\frac{3}{4}$	420	(500- $\frac{3}{4}$)
CIRCLING **	1480-1 $\frac{1}{2}$ 461 (500-1 $\frac{1}{2}$)	2100-3	1081 (1100-3)

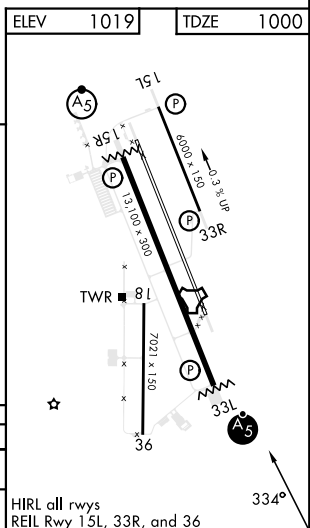

WICHITA FALLS, TEXAS

33°59'N-98°30'W

SHEPPARD AFB/WICHITA FALLS MUNI (KSPS)

HI-TACAN RWY 33L