
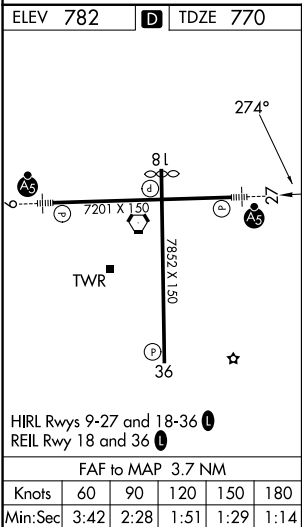


LOC I-TUN 109.9	APP CRS 274°	Rwy Ldg TDZE Apt Elev 7201 770 782
---------------------------	------------------------	--

ILS or LOC RWY 27
BISHOP INTL (F'NT)

DME or RADAR required for procedure entry. DME or RADAR required.		MALSR 	MISSED APPROACH: Climb to 2600 on FNT VORTAC R-275 direct SELFY/FNT VORTAC 10.6 DME/RADAR and hold.
 DME from FNT VORTAC. Simultaneous reception of I-TUN and FNT DME required. For inop ALS, increase S-LOC 27 Cat A/B visibility to 1 SM, and Cat C/D visibility to 1½ SM.			

ATIS 133.15	GREAT LAKES APP CON * 118.8 257.9	FLINT TOWER * 126.3 (CTAF) 257.9	GND CON 121.9	UNICOM 122.95
-----------------------	---	--	-------------------------	-------------------------

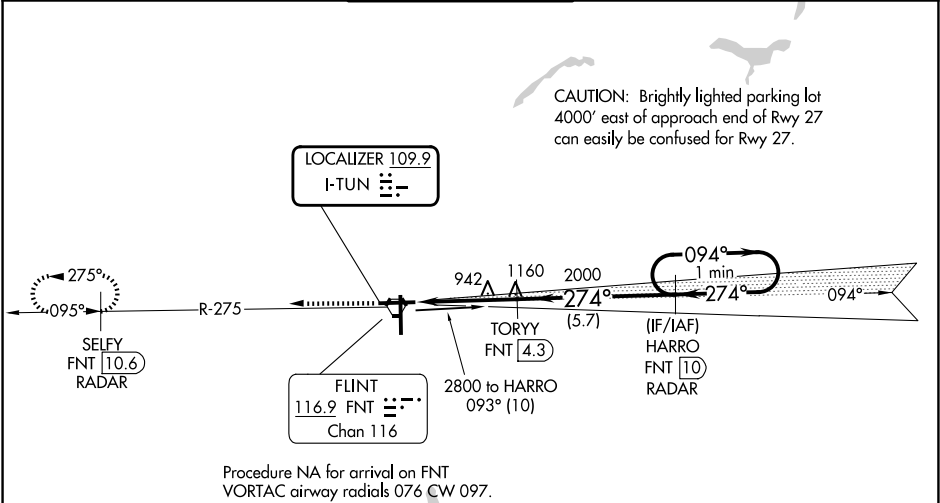

2600	FNT R-275	SELFY FNT 10.6 RADAR	TORYY FNT 4.3	HARRO FNT 10 RADAR	One Minute Holding Pattern
*LOC only.					
CATEGORY	A	B	C	D	
S-ILS 27	970-½		200 (200-½)		
S-LOC 27	1260-½		490 (500-½)		
CIRCLING	1260-1 478 (500-1)		1300-1 518 (600-1)		
	1260-1		1300-1½ 518 (600-1½)		
			1520-2¼ 738 (800-2¼)		