


APP CRS	Rwy Ldg	10200
078°	TDZE	936
	Apt Elev	944

RNAV (RNP) Z RWY 8R
ONTARIO INTL (ONT)

▽ ▲ NA	For uncompensated Baro-VNAV systems, procedure NA below 2°C (36°F) or above 54°C (130°F).	MISSED APPROACH: Climb to 5300 on track 078° to HOYQU and on track 165° to DLIUS and hold, continue climb-in-hold to 5300.
-----------	---	--

D-ATIS 124.25	SOCAL APP CON 127.0 318.2	ONTARIO TOWER 120.6 360.775	GND CON 121.9 257.8	CLNC DEL 132.9	CPDLC
------------------	------------------------------	--------------------------------	------------------------	-------------------	-------

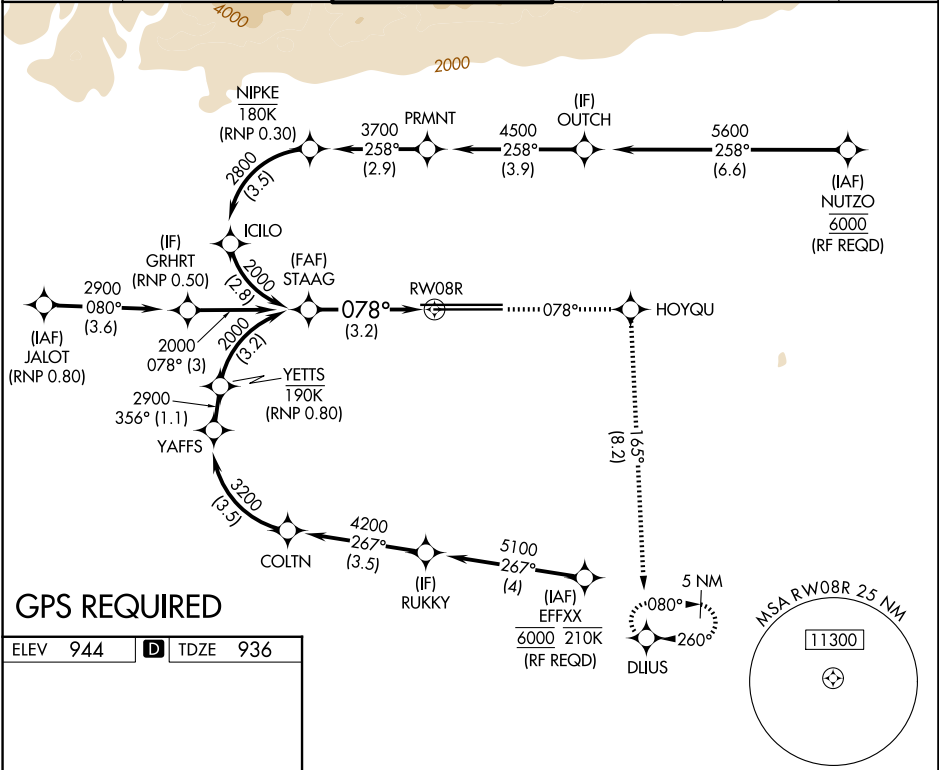

ELEV 944 **D** TDZE 936

TDZ/CL Rwy 8L, 26R and 26L
HIRL Rwy 8L-26R and 8R-26L

VGSI and RNAV glidepath not coincident
(VGSI Angle 3.00/TCH 65).

5300
↑
tr 078°

HOYQU

DLIUS
tr 165°

See planview for multiple IF locations.

2000

078°

RW08R

GP 3.00°
TCH 60

3.2 NM

CATEGORY	A	B	C	D
RNP 0.30 DA	1342-1½ 406 (400-1½)			

AUTHORIZATION REQUIRED

SW-3, 22 JAN 2026 to 19 FEB 2026

SW-3, 22 JAN 2026 to 19 FEB 2026