


LOC/DME I-ONB 109.1 Chan 28	APP CRS 281°	Rwy Ldg TDZE 813 Apt Elev 815
--	------------------------	---

ILS or LOC RWY 28R


JOHN GLENN COLUMBUS INTL (CMH)

DME or RADAR required.	MALSR 	MISSED APPROACH: Climb to 1400 then climbing right turn to 3000 direct APE VORTAC and hold.
Simultaneous approach authorized. Autopilot coupled approach NA.		
For inop ALS, increase S-LOC 28R Cat C/D visibility to 1 3/8 SM.		

D-ATIS 124.6	COLUMBUS APP CON 125.95 371.975	COLUMBUS TOWER 132.7 257.8	GND CON 121.9 348.6
------------------------	---	--------------------------------------	-------------------------------

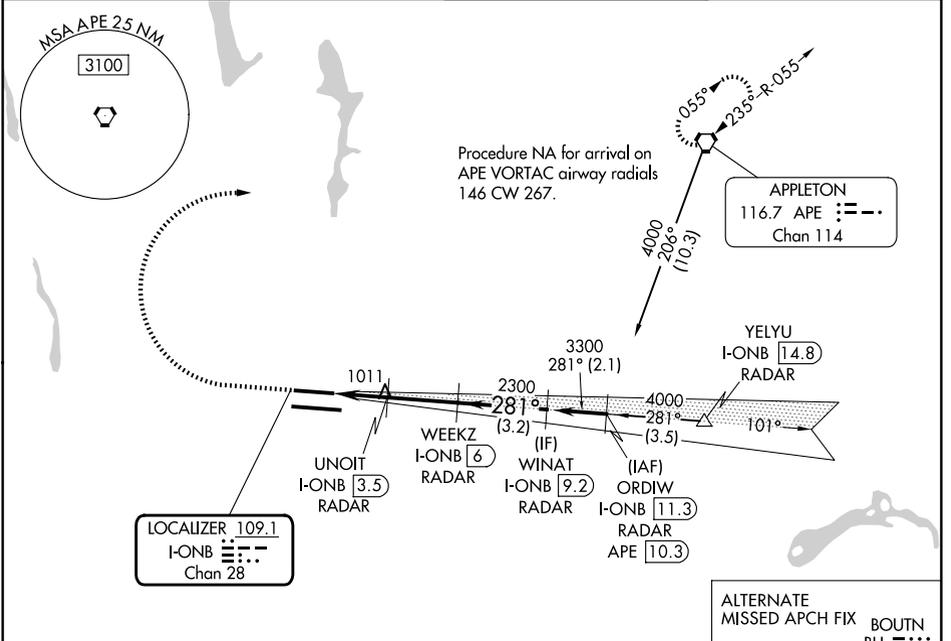

ELEV 815	D	TDZE 813
----------	----------	----------

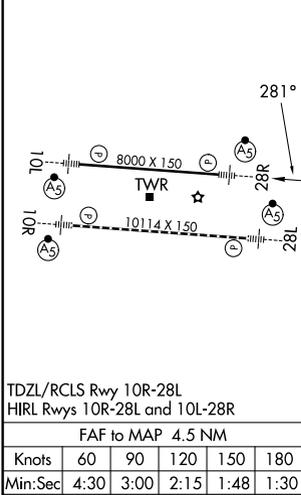

CATEGORY	A	B	C	D
S-ILS 28R	1013/24 200 (200-1/2)			
S-LOC 28R	1280/24	467 (500-1/2)	1280/50	467 (500-1)
CIRCLING	1340-1	525 (600-1)	1520-2 705 (800-2)	1520-2 1/4 705 (800-2 1/4)

EC-2, 19 MAR 2026 to 16 APR 2026

EC-2, 19 MAR 2026 to 16 APR 2026