

VORTAC RIC 114.1 Chan 88	APP CRS 323°	Rwy Ldg TDZE 161 Apt Elev 167	9003
--	------------------------	---	-------------

VOR RWY 34

RICHMOND INTL (RIC)


DME or RADAR required. RADAR required for procedure entry.

ALSF-2


MISSED APPROACH: Climbing right turn to 2000 via RIC R-018 to EPICS INT and hold.

▼ For inop ALS, increase S-34 Cat C/D visibility to RVR 5500.

ATIS 119.15 263.025	POTOMAC APP CON 126.4 282.375 (001°-185°) 126.75 307.2 (186°-360°)	RICHMOND TOWER 121.1 257.8	GND CON 121.9 348.6
-------------------------------	--	--------------------------------------	-------------------------------

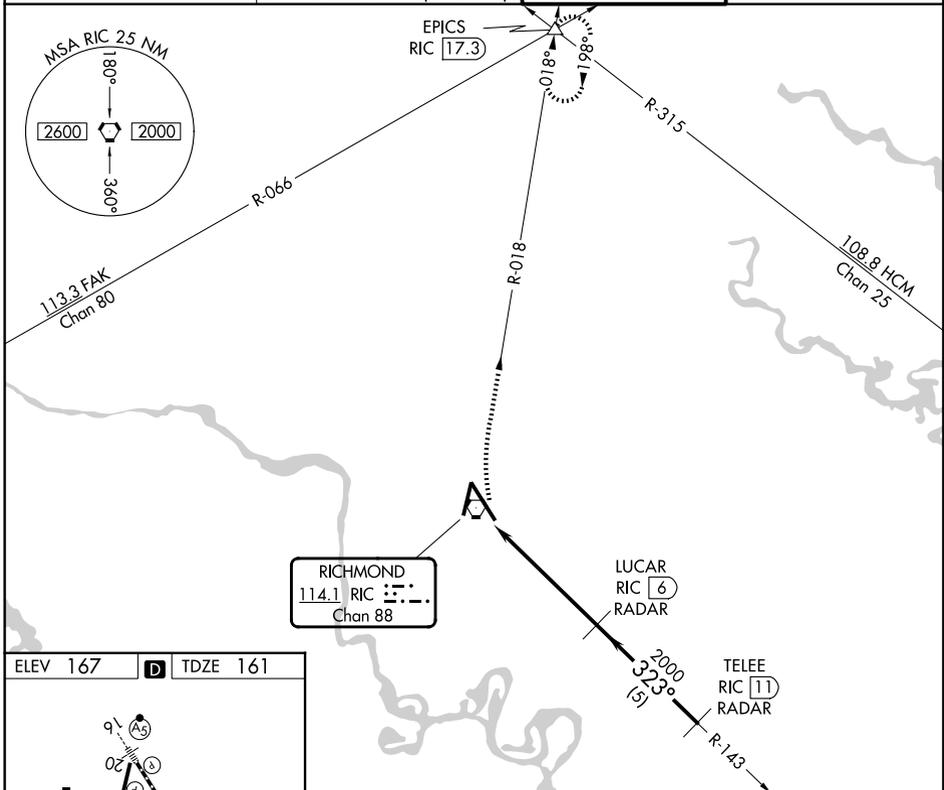

ELEV 167	D	TDZE 161
----------	----------	----------

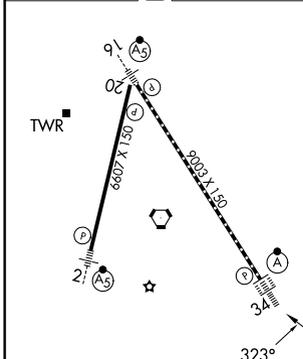

TDZ/CL Rwy 34
HIRL Rwy 2-20 and 16-34
REIL Rwy 20

FAF to MAP 5.3 NM

Knots	60	90	120	150	180
Min:Sec	5:18	3:32	2:39	2:07	1:46

2000 RIC R-018	EPICS △	VGSi and descent angles not coincident (VGSi Angle 3/00/TCH 79).		LUCAR RIC 6 RADAR	TELEE RIC 11 RADAR
RIC VORTAC RIC 0.8	RIC 1.7	RIC 1.7	RIC 1.7	RIC 1.7	RIC 1.7
323°		323°		323°	
1 NM		4.3 NM		5 NM	
CATEGORY	A	B	C	D	
S-34	540/24	379 (400-½)	540/40 379 (400-¾)	540/50 379 (400-1)	
CIRCLING	660-1	493 (500-1)	700-1½ 533 (600-1½)	720-2 553 (600-2)	

NE-3, 19 MAR 2026 to 16 APR 2026

NE-3, 19 MAR 2026 to 16 APR 2026