

APP CRS	Rwy Ldg	7614
306°	TDZE	57
	Apt Elev	62

RNAV (RNP) Z RWY 30L


NORMAN Y MINETA SAN JOSE INTL (SJC)

RNP AR APCH.	MALSR	MISSED APPROACH: Climb to 2000 on track 306° to ARTAQ and hold.
▼ For uncompensated Baro-VNAV systems, procedure NA below 1°C or above 54°C. For inop ALS, increase RNP 0.10 all Cats visibility to RVR 5500 and increase RNP 0.30 all Cats visibility to 1½ SM.		

D-ATIS 126.95	NORCAL APP CON 120.1 290.25	SAN JOSE TOWER * 124.0 (CTAF) 0 257.6	GND CON 121.7	UNICOM 122.95
-------------------------	---------------------------------------	---	-------------------------	-------------------------



ELEV	62	D	TDZE	57
------	-----------	----------	------	-----------

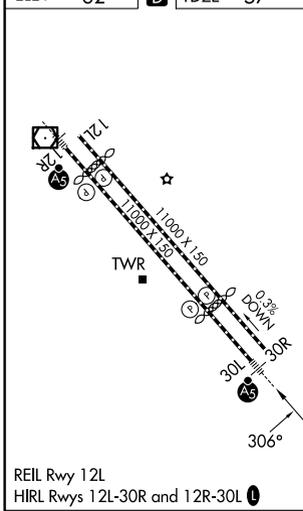

2000 tr 306°	ARTAQ	VGSI and RNAV glidepath not coincident (VGSI Angle 3.00/TCH 70).	WOXAR 1600
See planview for multiple IF locations.			
RW30L			1600
4.7 NM			GP 3.00° TCH 54

CATEGORY	A	B	C	D
RNP 0.10 DA		430/35	373 (400-5%)	
RNP 0.20 DA		464/40	407 (500-3%)	
RNP 0.30 DA		541/50	484 (500-1)	

AUTHORIZATION REQUIRED

SW-2, 19 MAR 2026 to 16 APR 2026

SW-2, 19 MAR 2026 to 16 APR 2026