
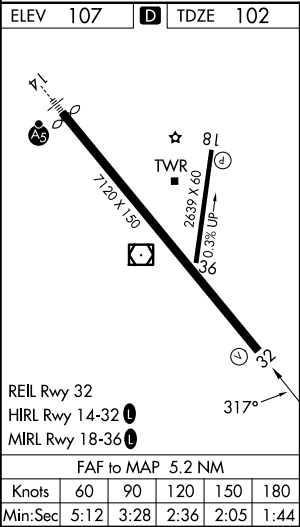


LOC/DME I-LLM 111.7 Chan 54	APP CRS 317°	Rwy Ldg 7120 TDZE 102 Apt Elev 107
---	------------------------	---

ILS or LOC RWY 32
MC ALLEN INTL (MF'E)

⚠ Circling NA northeast of Rwy 14-32. ADF and DME or Radar required. When local altimeter setting not received, use Weslaco altimeter setting: increase all DA 39 feet and MDA 40 feet.		MISSED APPROACH: Climb to 2100 direct MF LOM and hold		
ATIS 128.5	VALLEY APP CON 126.55 377.2	MC ALLEN TOWER ★ 118.5 (CTAF) 0 256.9	GND CON 121.8	UNICOM 122.95

DME or RADAR REQUIRED

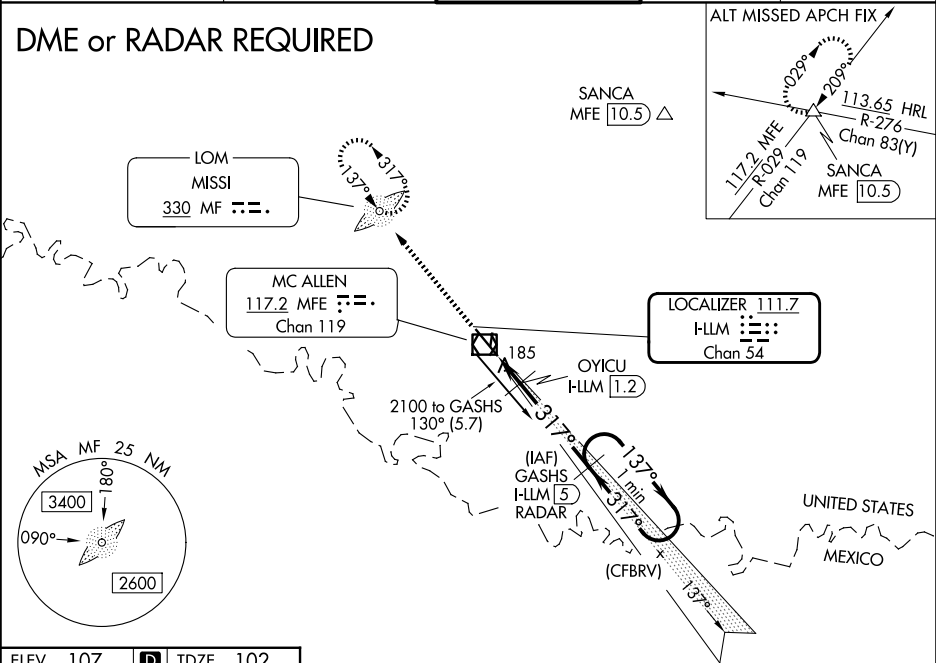

2100	MF	VGSI and ILS glidepath not coincident (VGSI Angle 3.00/TCH 53).	GASHS I-LLM (5) RADAR	One Minute Holding Pattern
*LOC only	OYICU I-LLM (1.2)	1800	137°	2100
		1800	317°	GS 3.00° TCH 50
		*600 when using Weslaco altimeter setting.		
		1.4 NM	3.8 NM	
CATEGORY	A	B	C	D
S-ILS 32		302-3/4	200 (200-3/4)	
S-LOC 32	560-1	458 (500-1)	560-1 3/8	458 (500-1 3/8)
CIRCLING	580-1	473 (500-1)	580-1 1/2	800-2 1/4
			473 (500-1 1/2)	693 (700-2 1/4)
OYICU FIX MINIMUMS				
S-LOC 32		440-1	338 (400-1)	
CIRCLING	580-1	473 (500-1)	580-1 1/2	800-2 1/4
			473 (500-1 1/2)	693 (700-2 1/4)