
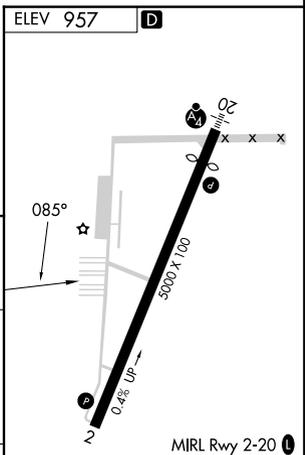
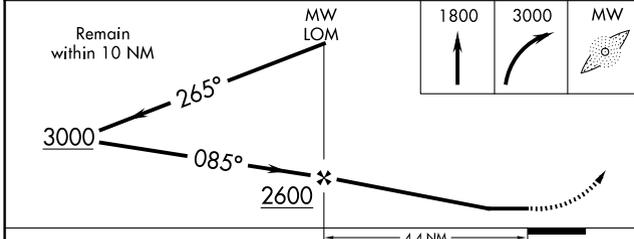
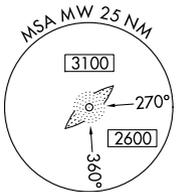


LOM MW <b>223</b>	APP CRS <b>085°</b>	Rwy Idg TDZE Apt Elev	<b>N/A</b> <b>N/A</b> <b>957</b>
----------------------	------------------------	-----------------------------	--

**NDB-A**  
DAYTON/WRIGHT BROTHERS (MGY)

RADAR required for procedure entry.		MISSED APPROACH: Climb to 1800 then climbing right turn to 3000 direct MW LOM and hold.	
<p>▼ When local altimeter setting not received, use James M Cox Dayton Intl altimeter setting and increase all MDAs 60 feet, and Cat C/D visibilities ¼ SM.</p> <p>▲ NA</p>		ASOS <b>118.375</b>	COLUMBUS APP CON <b>118.85 269.275</b>
		CLNC DEL <b>119.4</b>	UNICOM <b>122.8</b> (CTAF) <b>0</b>

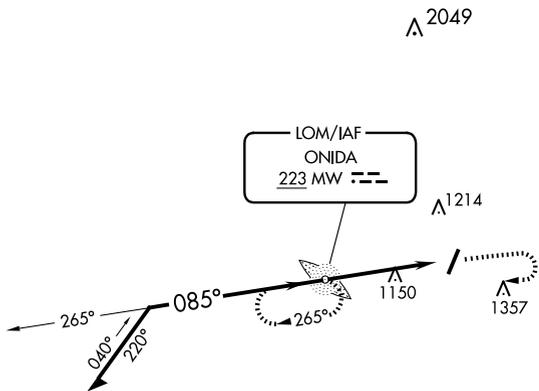

	FAF to MAP 4.4 NM									
CATEGORY	A	B	C	D	Knots	60	90	120	150	180
☐ CIRCLING	1480-1 523 (600-1)	1520-1 563 (600-1)	1660-2 703 (800-2)	1660-2¼ 703 (800-2¼)	Min:Sec	4:24	2:56	2:12	1:46	1:28

EC-2, 19 MAR 2026 to 16 APR 2026

EC-2, 19 MAR 2026 to 16 APR 2026