



LOC I-HSV 109.3	APP CRS 185°	Rwy Ldg 12600 TDZE 629 Apt Elev 629
---------------------------	------------------------	--

ILS or LOC RWY 18R


HUNTSVILLE INTL-CARL T JONES FLD (HSV)

DME required. RADAR required for procedure entry.		ALSF-2 	MISSED APPROACH: Climb to 1300 then climbing right turn to 3000 on heading 270° and RQZ R-230 to JUVLO/RQZ 28.7 DME and hold.
 Circling NA for Cats C/D/E east of Rwy 18L-36R. Simultaneous approach authorized. For inop ALS, increase S-ILS 18R Cat E visibility to RVR 4000 and S-LOC 18R Cat E visibility to 1/4 SM. DME from RQZ VORTAC. DME use requires simultaneous reception of I-HSV and RQZ DME.			

ATIS 121.25	HUNTSVILLE APP CON* 125.6 354.1	HUNTSVILLE TOWER* 127.6 (CTAF) 350.35	GND CON 121.9 269.525	UNICOM 122.95
-----------------------	---	---	---------------------------------	-------------------------

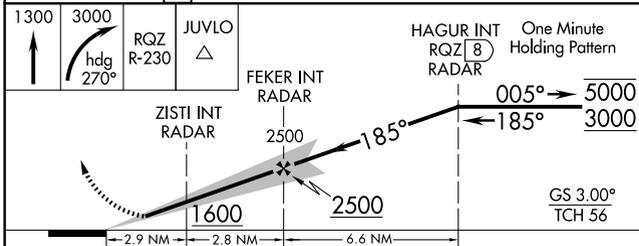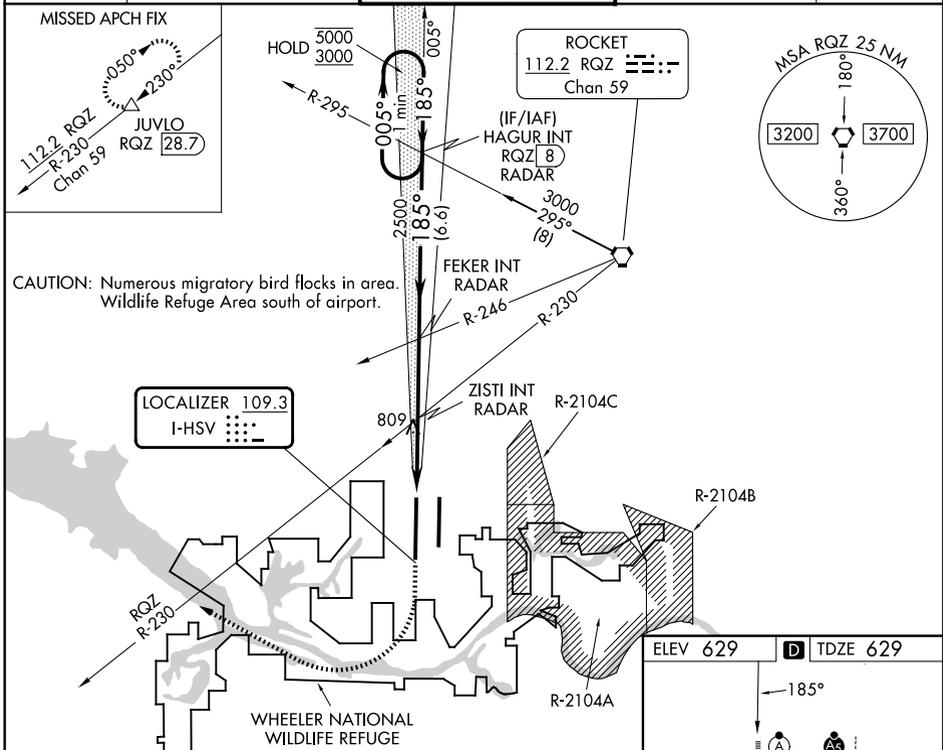

CATEGORY	A	B	C	D	E
S-ILS 18R	829/18 200 (200-1/2)				
S-LOC 18R	1060/24 431 (500-1/2)	1060/40 431 (500-3/4)			
CIRCLING	1160-1 531 (600-1)	1160-1 1/2 531 (600-1 1/2)	1240-2 611 (700-2)	1260-2 1/4 631 (700-2 1/4)	

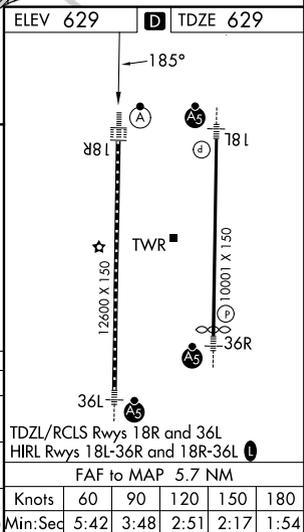

SE-4, 19 MAR 2026 to 16 APR 2026

SE-4, 19 MAR 2026 to 16 APR 2026