

| | | | |
|--|------------------------|---|-------------|
| LOC/DME I-JVW 108.55 Chan 22(Y) | APP CRS 124° | Rwy Ldg TDZE 241 Apt Elev 247 | 5499 |
|--|------------------------|---|-------------|




ILS or LOC RWY 12

JOHN BELL WILLIAMS (JVW)

⚠ VDP NA with Hawkins Fld altimeter setting. Circling NA for Cat D southwest of Rwy 12-30. When local altimeter setting not received, use Hawkins Fld altimeter setting: increase all DA 36 feet, all MDA 40 feet, S-LOC 12 Cat C and D visibilities ¼ mile, and Circling Cat C and D visibilities ¼ mile, increase FIVSO fix minimums S-LOC 12 Cat C and D visibilities ¼ mile and Circling Cat C and D visibilities ¼ mile.

MISSED APPROACH: Climb to 800 then climbing left turn to 2900 on heading 316° and on MHz VORTAC R-271 to CIGDA INT/I-JVW 14.6 DME and hold.

| | | |
|----------------------------|--|-------------------------------|
| AWOS-3PT 118.675 | JACKSON APP CON ★ 125.25 319.2 | UNICOM 123.0 (CTAF) |
|----------------------------|--|-------------------------------|

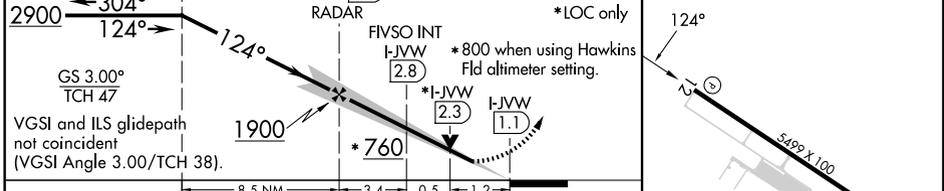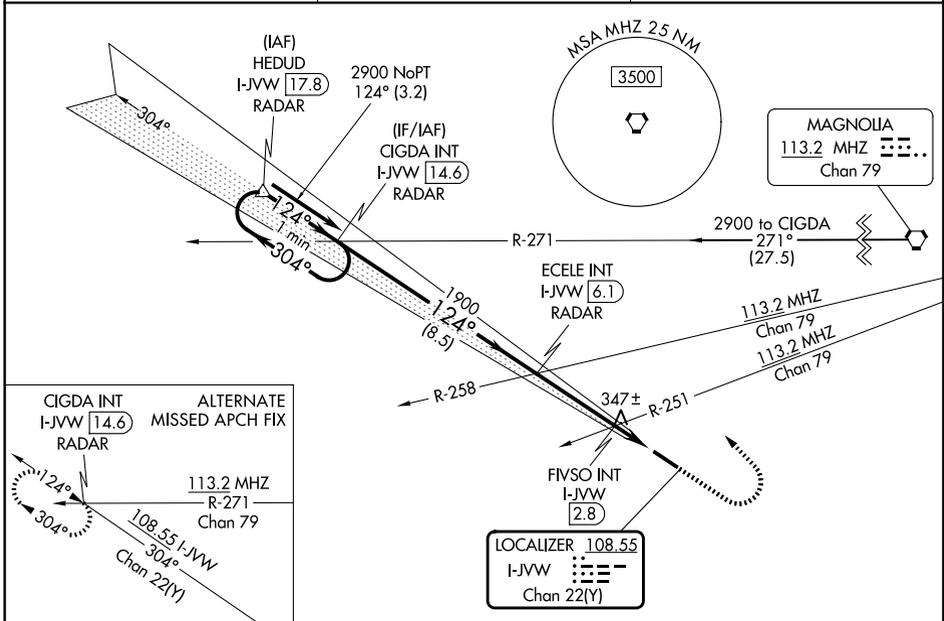

| CATEGORY | A | B | C | D |
|---|--|-------------|----------------------------------|---|
| S-ILS 12 | 441- ³ / ₄ 200 (200- ³ / ₄) | | | |
| S-LOC 12 | 760-1 | 519 (600-1) | 760- ¹ / ₈ | 519 (600- ¹ / ₈) |
| CIRCLING | 800-1 | 553 (600-1) | 733 (800-2) | 733 (800-2 ¼) |
| FIVSO FIX MINIMUMS (DUAL VOR RECEIVERS OR DME REQUIRED) | | | | |
| S-LOC 12 | 660-1 | 419 (500-1) | 660- ¹ / ₈ | 419 (500- ¹ / ₈) |
| CIRCLING | 800-1 | 553 (600-1) | 980-2 | 733 (800-2 ¼) |

| | |
|--|--------------------------|
| ELEV 247 | TDZE 241 |
| MIRL Rwy 12-30 Ⓛ REIL Rwy 12 and 30 Ⓛ | |
| FAF to MAP 5.1 NM | |
| Knots | 60 90 120 150 180 |
| Min:Sec | 5:06 3:24 2:33 2:02 1:42 |

SC-4, 19 MAR 2026 to 16 APR 2026

SC-4, 19 MAR 2026 to 16 APR 2026