

WAAS CH 99535 W36A	APP CRS 002°	Rwy Ldg TDZE Apt Elev	3197 337 337
--	------------------------	-----------------------------	---

RNAV (GPS) RWY 36

OKOLONA MUNI/RICHARD STOVALL FLD (5A4)




Baro-VNAV NA. DME/DME RNP-0.3 NA. Use Tupelo altimeter setting; when not received, use Columbus Air Force Base altimeter setting and increase all DA 41 feet and all MDA 60 feet; increase LNAV/VNAV all Cats visibility ¼ mile and LNAV Cat C visibility ¼ mile.
Rwy 36 helicopter visibility reduction below ¾ SM NA.

MISSED APPROACH:
Climb to 2600 direct AYUDI and hold.

COLUMBUS APP CON ★
126.075 229.15



CTAF
122.9 0

MISSED APCH FIX

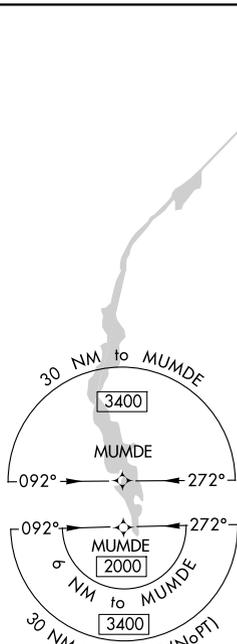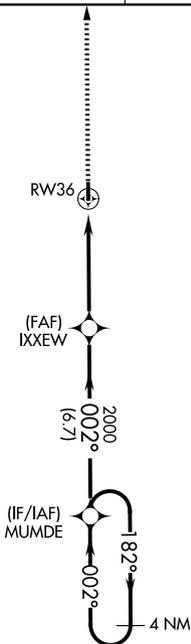

ELEV 337	TDZE 337
----------	----------

MIRL Rwy 18-36 0

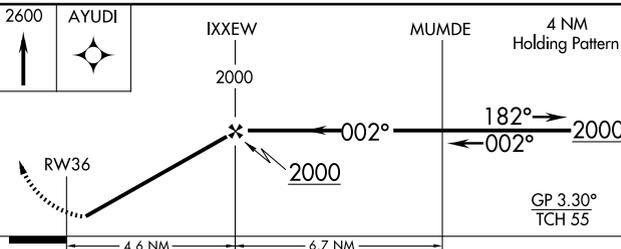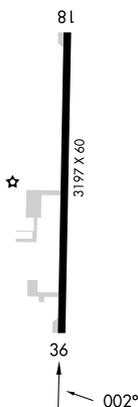

CATEGORY	A	B	C	D
LPV DA	624-1 287 (300-1)			NA
LNAV/VNAV DA	732-1½ 395 (400-1½)			NA
LNAV MDA	860-1	523 (600-1)	860-1½ 523 (600-1½)	NA
CIRCLING	920-1	583 (600-1)	1080-2¼ 743 (800-2¼)	NA