

WAAS CH 50229 W36A	APP CRS 002°	Rwy Idg TDZE 1304 Apt Elev 1305
--	------------------------	---

RNAV (GPS) RWY 36

HAMILTON MUNI (MNZ)

RNP APCH-GPS.

▼ Rwy 36 helicopter visibility reduction below $\frac{3}{4}$ SM NA.
For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -17°C or above 54°C .


MISSED APPROACH: Climb to 3600 direct ULIGY and hold.

AWOS-3PT
118.525



GRAY APP CON
120.075 323.15

UNICOM
122.7 (CTAF) 0

MISSED APCH FIX





Procedure NA for arrivals at BUILT on V161-568 northbound.

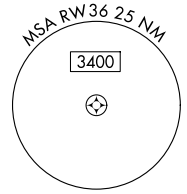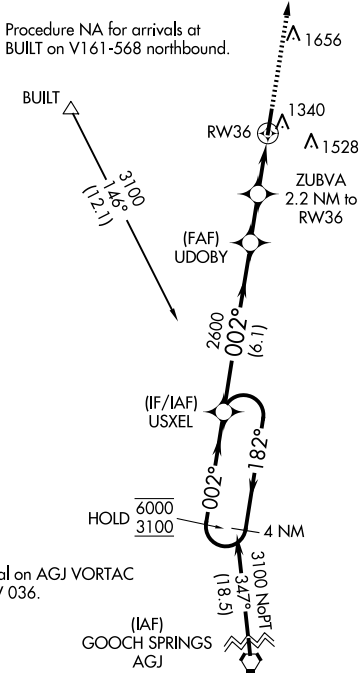

2332

Procedure NA for arrival on AGJ VORTAC airway radials 008 CW 036.

ELEV 1305	TDZE 1304
MIRL Rwy 18-36 0	

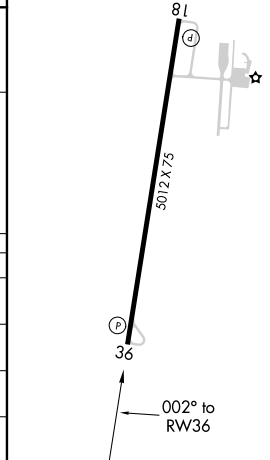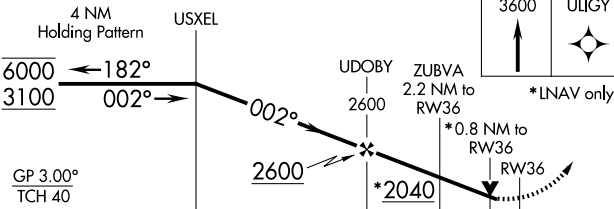

CATEGORY	A	B	C	D
LPV DA	1554-1 250 (300-1)			NA
LNAV/VNAV DA	1554-1 250 (300-1)			NA
LNAV MDA	1600-1 296 (300-1)			NA
CIRCLING	1680-1 375 (400-1)	1840-1 535 (600-1)	1960-1 $\frac{3}{4}$ 655 (700- $\frac{1}{4}$)	NA