

GOLDSBORO, NORTH CAROLINA

TACAN Y RWY 8

| | | |
|------------------------------|-------------------------|---|
| TACAN GSB Chan 112 | APCH CRS 081° | Rwy Idg 11,760 TDZE 73 Arpt Elev 109 |
|------------------------------|-------------------------|---|

[USAF]


SEYMOUR JOHNSON AFB (KGSB)

▼ * When ALS inop, increase CAT AB RVR to 55, vis to 1 mile, CAT CDE vis to 1 3/8 miles.
 ** Circling N of Rwy 8-26 not authorized.



MISSED APPROACH: Climb to 2300 via GSB R-081 to ZILOB and hold.



| | | | |
|--------------------------|---|----------------------------------|--------------------------------|
| ATIS ★ 317.625 | APP CON 123.7 290.9 (258°-110°) 119.7 273.6 (111°-257°) | TOWER ★ 126.25 370.875 | GND CON 132.45 275.8 |
|--------------------------|---|----------------------------------|--------------------------------|

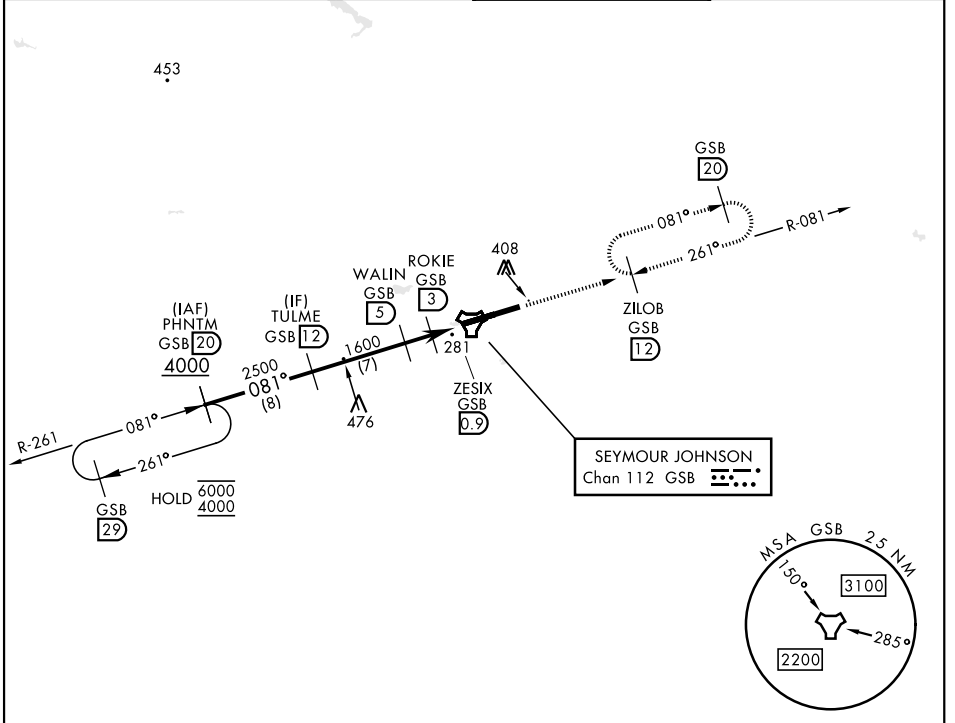

SE-2, 11 JUN 2026 to 09 JUL 2026

SE-2, 11 JUN 2026 to 09 JUL 2026

| | |
|----------|---------|
| ELEV 109 | TDZE 73 |
|----------|---------|

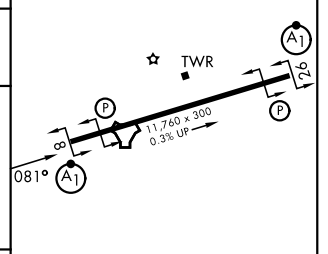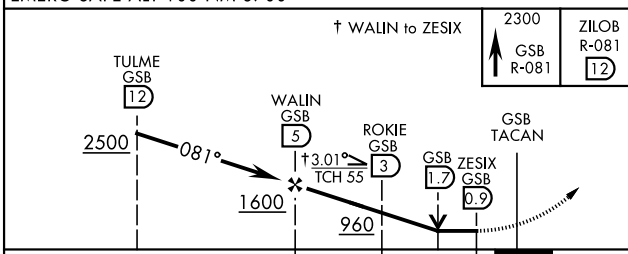

| CATEGORY | A | B | C | D | E |
|------------|----------------------|----------------------|------------------------------|----------------------|------------------------------|
| S-8* | 540/24 467 (500-1/2) | | 540/50 467 (500-1) | | |
| CIRCLING** | 580-1 471 (500-1) | 600-1 491 (500-1) | 680-1 1/2 571 (600-1 1/2) | 740-2 631 (700-2) | 740-2 1/4 631 (700-2 1/4) |

| |
|---------------|
| HIRL Rwy 8-26 |
|---------------|

GOLDSBORO, NORTH CAROLINA

35°20'N-77°58'W

SEYMOUR JOHNSON AFB (KGSB)

Amdt 8 03NOV22

TACAN Y RWY 8