



LOC/DME I-AKN	APP CRS	Rwy Ldg	8501
110.3	301°	TDZE	73
Chan 40		Apt Elev	73

LOC BC RWY 30

KING SALMON (AKN)(PAKN)

DME required.	MISSED APPROACH: Climb to 600 then climbing left turn to 3000 on heading 240° and AKN VORTAC R-210 to OLLER/AKN 15 DME and hold.
When local altimeter setting not received, use WSN/PFWs altimeter setting and increase all MDAs 40 feet.	

ATIS 128.8	ANCHORAGE CENTER 124.8 354.0	KING SALMON TOWER* 118.3 279.5	GND CON 121.9	UNICOM 122.95	CTAF 121.9 352.05
----------------------	--	--	-------------------------	-------------------------	-----------------------------

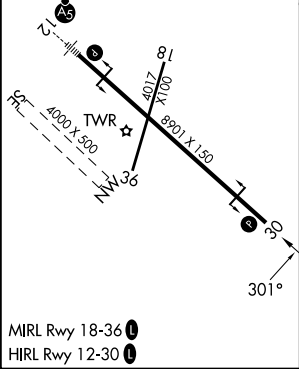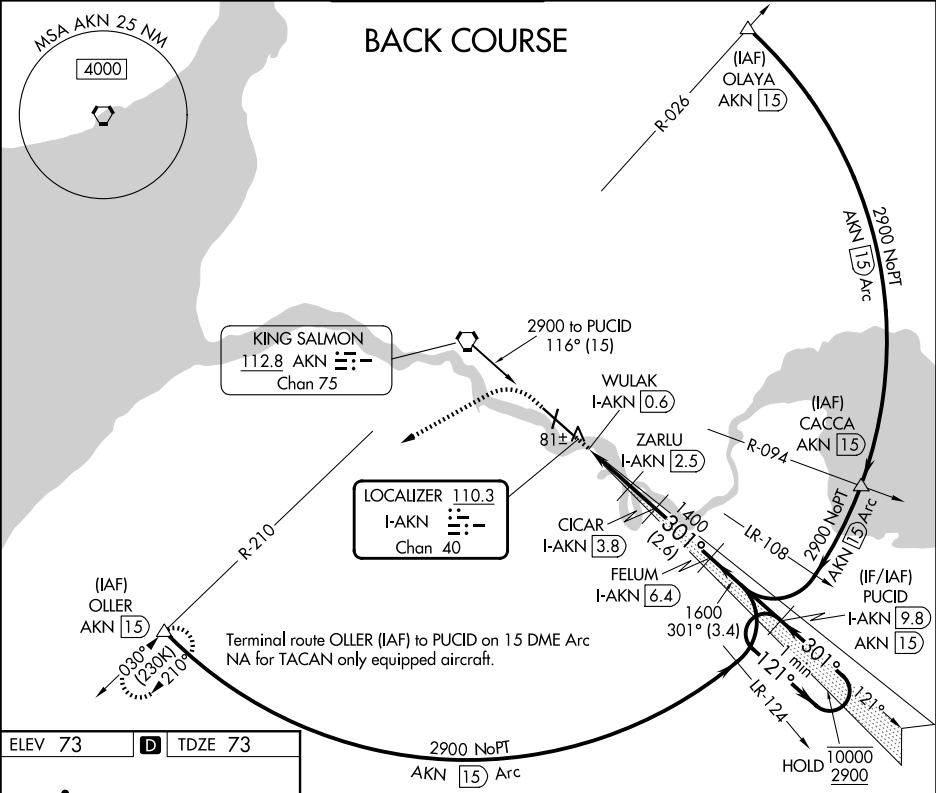

600	3000	AKN R-210	OLLER △	Disregard GS indications.		PUCID I-AKN [9.8]	One Minute Holding Pattern	
↑	hdg 240°			CICAR I-AKN [6.4]	FELUM I-AKN [6.4]			
		ZARLU I-AKN [2.5]		I-AKN [3.8]				
		WULAK I-AKN [0.6]	≤ 3.10° TCH 45		301°	121° → 10000 ← 301° 2900	Use I-AKN DME when on the localizer course.	
		1000	1400		1600			
		0.7	2 NM	1.2 NM	2.6 NM	3.4 NM		
CATEGORY	A		B		C	D	E	
S-30	340-1 267 (300-1)							
CIRCLING	580-1 507 (600-1)		580-1½ 507 (600-1½)		900-2¾ 827 (900-2¾)	960-3 887 (900-3)		