

VOR/DME SYI

113.55

Chan 82 (Y)

APP CRS

016°

Rwy Ldg

5504

TDZE

801

Apt Elev

801

BOMAR FLD/SHELBYVILLE MUNI (SYI)

VOR RWY 36

DME required.

When local altimeter setting not received, use Tullahoma altimeter setting and increase all MDAs 80 feet, and S-36 Cat C/D visibility ¼ SM.

VDP NA when using Tullahoma altimeter setting.

MISSED APPROACH: Climb to 2000 then climbing left turn to 3000 direct SYI VOR/DME and hold.

AWOS-3


119.275

NASHVILLE APP CON

118.4 360.7

UNICOM

122.8 (CTAF) 0

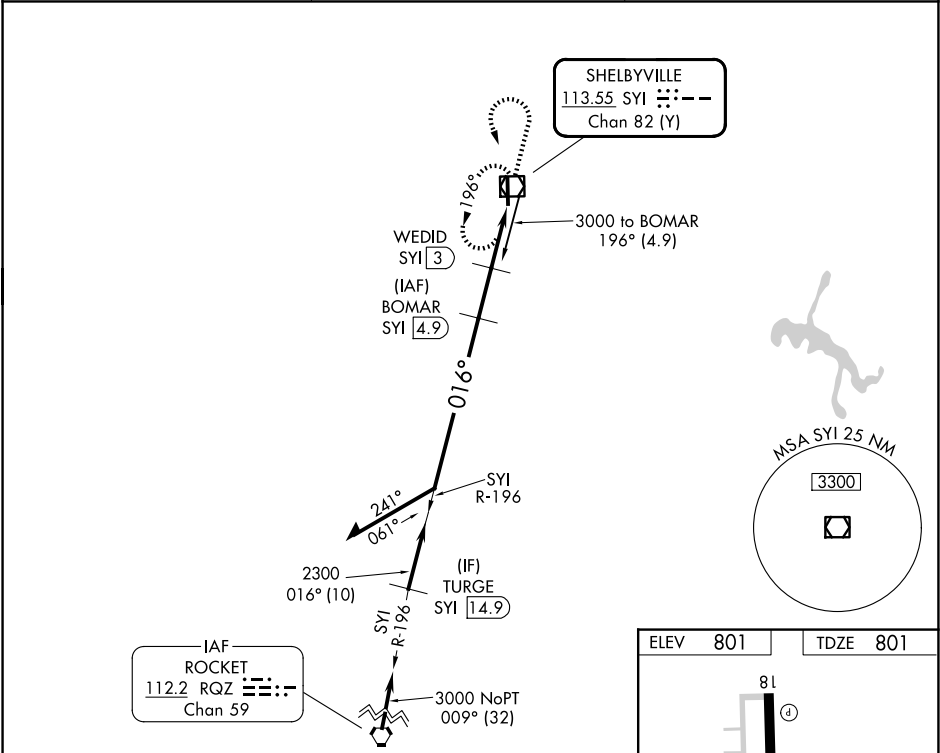

VGSI and descent angles not coincident (VGSI Angle 3.00/TCH 30).

Remain within 10 NM

3000

196°

016°

2300

1600

3.26° TCH 45

1.9 NM

1.1

1.2

WEDID SYI 3

SYI 1.9

SYI 0.6

BOMAR SYI 4.9

3000

196°

016°

2300

1600

3.26° TCH 45

1.9 NM

1.1

1.2

WEDID SYI 3

SYI 1.9

SYI 0.6

BOMAR SYI 4.9

ELEV 801

TDZE 801

81

857

5504 X 100

36

016°

MIRL Rwy 18-36 0

REIL Rwy 18 and 36

CATEGORY	A	B	C	D
S-36	1220-1	419 (500-1)	1220-1½	419 (500-1½)
CIRCLING	1260-1 459 (500-1)	1420-1 619 (700-1)	1780-3	979 (1000-3)

FAF to MAP 4.2 NM

Knots	60	90	120	150	180
Min:Seq	4:12	2:48	2:06	1:41	1:24