

BUFFALO, NEW YORK

AL-65 (FAA)


25331

WAAS CH 70311 W05A	APP CRS 055°	Rwy Ldg 7569 TDZE 708 Apt Elev 727
--	------------------------	---

RNAV (GPS) Y RWY 5
BUFFALO NIAGARA INTL (BUF)

BUFFALO NIAGARA INTL (BUF)

RNP APCH - GPS		MALSR		MISSED APPROACH: Climb to 3000 direct TRAVA and hold.
 For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -17°C or above 54°C.				
D-ATIS 135.35	BUFFALO APP CON 126.15 263.125	BUFFALO TOWER 120.5 257.8		GND CON 133.2 257.8

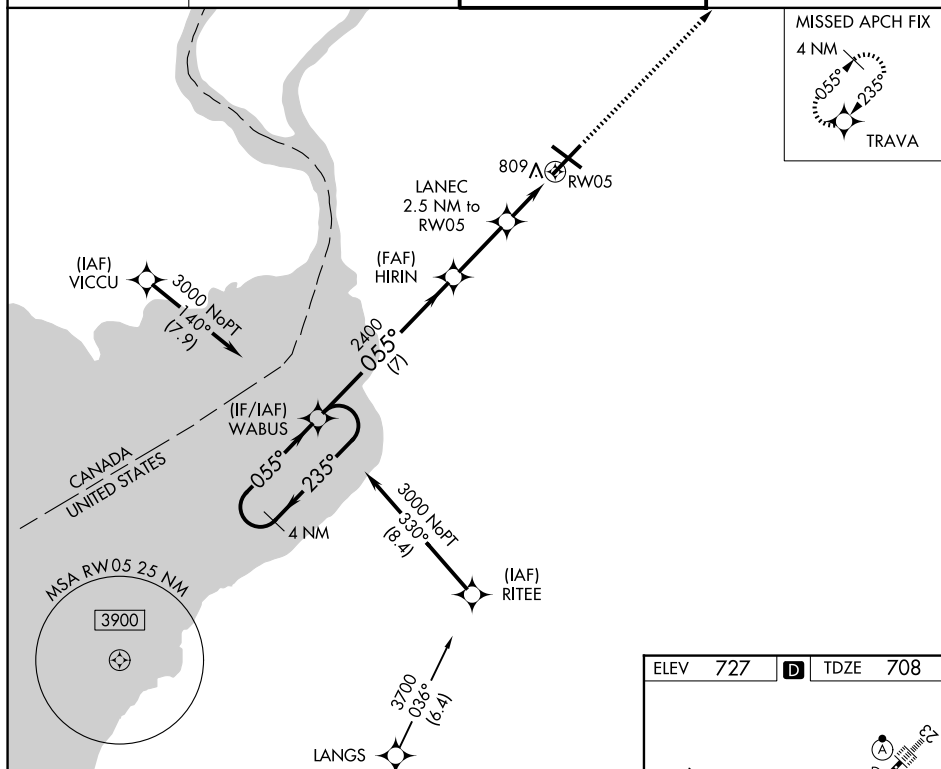

4 NM Holding Pattern

WABUS

HIRIN

LANEC 2.5 NM to RW05

3000

235°

055°

055°

2400

2400

*1520

*1.1 NM to RW05

*LNAV only

RW05

7 NM

2.8 NM

1.4 NM

1.1 NM

CATEGORY	A	B	C	D
LPV DA	908/18	200 (200-1/2)		
LNAV/VNAV DA	997/24	289 (300-1/2)		
LNAV MDA	1060/24	352 (400-1/2)	1060/35	352 (400-3/5)
CIRCLING	1200-1	473 (500-1)	1220-1 1/2 493 (500-1/2)	1340-2 613 (700-2)

REIL Rwy 14

TDZL/RCLS Rwy 5 and 23

HIRL Rwy 5-23 and 14-32

BUFFALO, NEW YORK

Amdt 2E 02DEC21

42°56'N-78°44'W

BUFFALO NIAGARA INTL (BUF)

RNAV (GPS) Y RWY 5

NE-2, 06 AUG 2026 to 03 SEP 2026