


LOC/DME I-ETF	APP CRS	Rwy Ldg	12020
111.5	042°	TDZE	3923
Chan 52		Apt Elev	3962

LOC/DME RWY 4

EL PASO INTL (ELP)

RADAR required for procedure entry.		MISSED APPROACH: Climb to 4500 then climbing right turn to 6900 direct ELP VORTAC and hold, continue climb-in-hold to 6900.	
Circling NA for Cat D north of Rwy 26R and northwest of Rwy 4.			
D-ATIS	EL PASO APP CON	EL PASO TOWER	GND CON
120.0 254.3	124.25 298.85	118.3 239.275	121.9 348.6

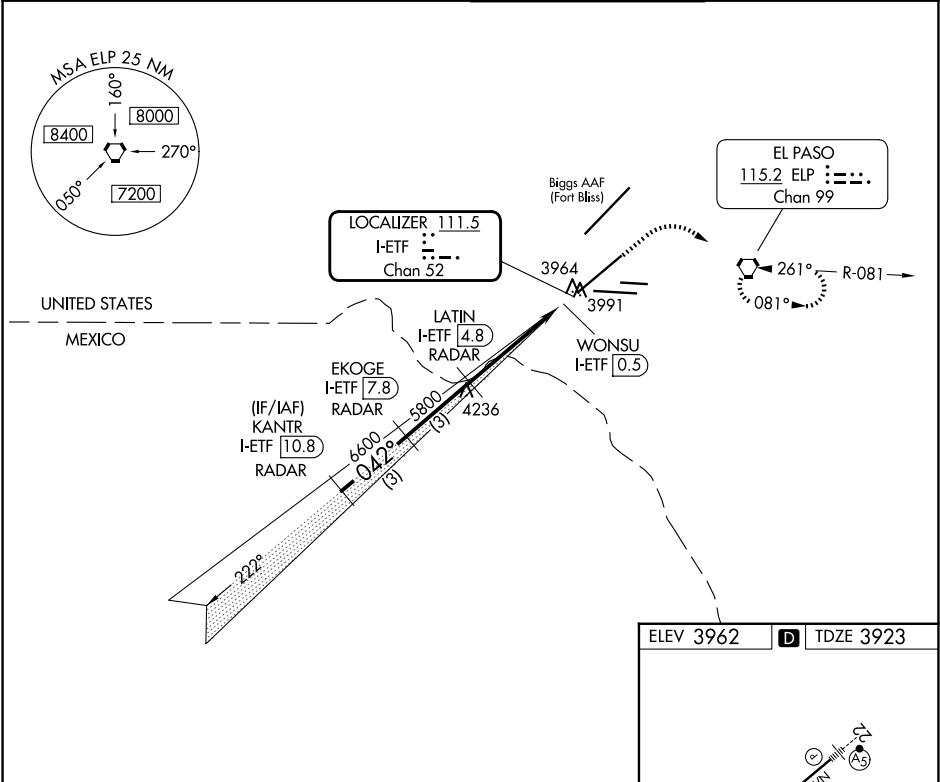

KANTR I-ETF 10.8 RADAR 7500 EKOGE I-ETF 7.8 RADAR 6600 LATIN I-ETF 4.8 RADAR 5800 WONSU I-ETF 0.5 3.42° TCH 55 4500 ↑ 6900 ↷ ELP ⬡				12020 X 150 0.3% DOWN 5499 X 75 0.3% DOWN 9025 X 150 0.5% UP TWR 042° 26L 26R			
VGSI and descent angles not coincident (VGSI Angle 3.00/TCH 55). Disregard GS indications.							
3 NM				3 NM			
4.3 NM				0.7			
CATEGORY				D			
S-4				4300/50 377 (400-1)			
				4300/60 377 (400-1¼)			
CIRCLING				4420-1 458 (500-1)			
				4460-1 498 (500-1)			
				4480-1½ 518 (600-1½)			
				4680-2¼ 718 (800-2¼)			
				MIRL Rwy 8L-26R			
				REIL Rwys 4 and 8R			
				HIRL Rwys 4-22 and 8R-26L			