

GOLDSBORO, NORTH CAROLINA

HI-TACAN Z RWY 8

TACAN GSB Chan 112	APCH CRS 081°	Rwy Idg 11,760 TDZE 73 Arprt Elev 109	[USAF]	SEYMOUR JOHNSON AFB (KGSB)
-----------------------	------------------	---	--------	----------------------------


▼

* When ALS inop, increase vis to 1 3⁄8 miles.
** Circling N of Rwy 8-26 not authorized.

ALSF-1

MISSED APPROACH: Climb to 2300 via GSB TACAN R-081 to ZIOB and hold.

ATIS ★ 317.625	APP CON 123.7 290.9 (258° 110°) 119.7 273.6 (111° 257°)	TOWER ★ 126.25 370.875	GND CON 132.45 275.8
-------------------	---	---------------------------	-------------------------

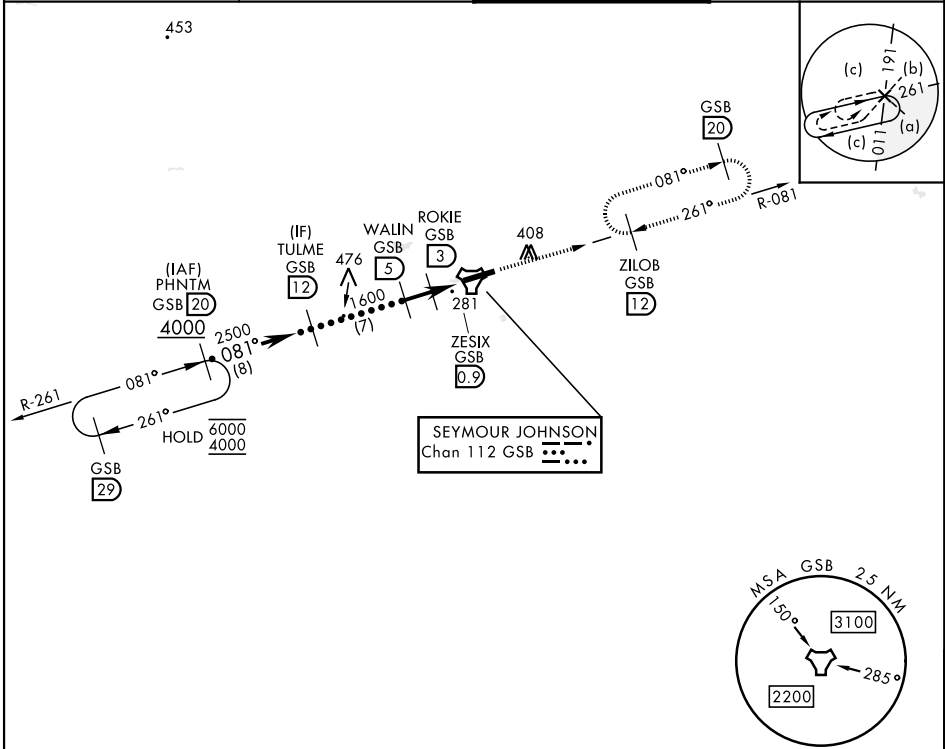

EMERG SAFE ALT 100 NM 3700

† WALIN to ZESIX

2300
GSB
R-081

ZIOB
GSB
12

CATEGORY	C	D	E
S-8 *	540/50	467 (500-1)	
CIRCLING	680-1 1/2 571 (600-1 1/2)	740-2 631 (700-2)	740-2 1/4 631 (700-2 1/4)

HIRL Rwy 8-26