

GOLDSBORO, NORTH CAROLINA

TACAN Y RWY 26

TACAN GSB	APCH CRS	Rwy Idg
Chan 112	261°	11,760
		TDZE 109
		Arpt Elev 109

[USAF]


SEYMOUR JOHNSON AFB (KGSB)

▼ * When ALS inop, increase CAT AB RVR to 55, vis to 1 mile, CAT CDE vis to 1¼ miles.
** Circling N of Rwy 8-26 not authorized.


ALSIF-1

MISSED APPROACH: Climb to 2200 via GSB R-261 to TULME and hold.


ATIS ★	APP CON	TOWER ★	GND CON
317.625	123.7 290.9 (258° 110°) 119.7 273.6 (111° 257°)	126.25 370.875	132.45 275.8

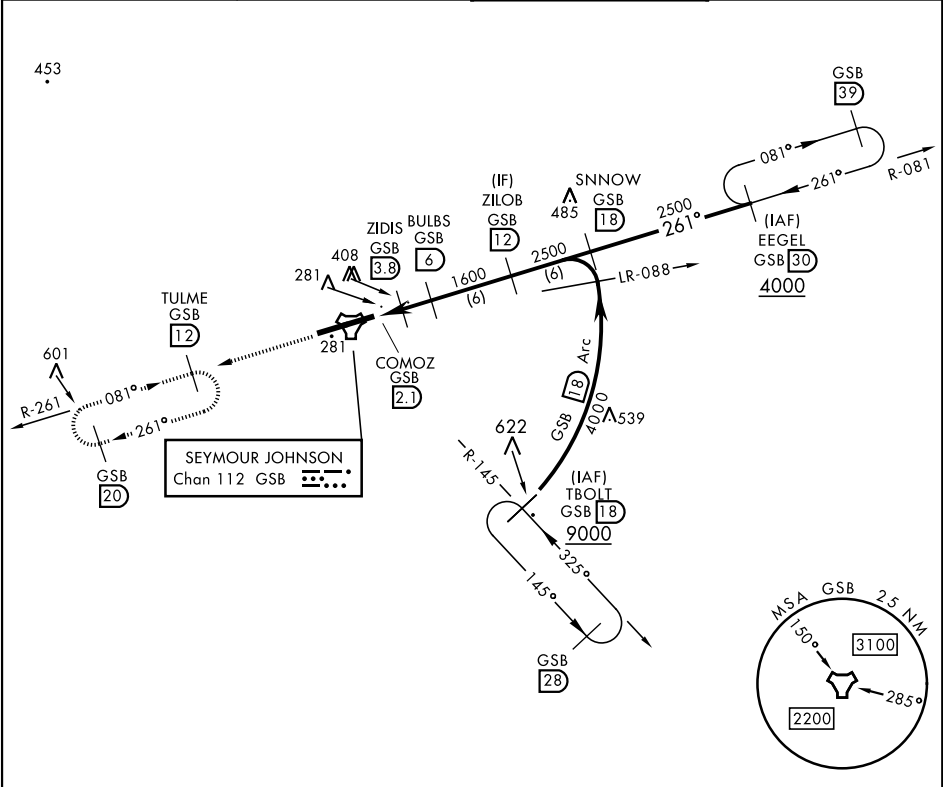

EMERG SAFE ALT 100 NM 3700

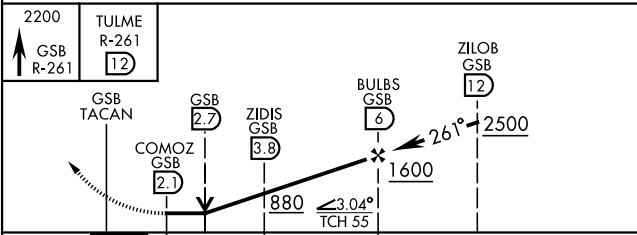

CATEGORY	A	B	C	D	E
S-26 *	540/24	431 (500-½)	540/40	431 (500-¾)	
CIRCLING **	580-1 471 (500-1)	600-1 491 (500-1)	680-1½ 571 (600-1½)	740-2 631 (700-2)	740-2¼ 631 (700-2¼)

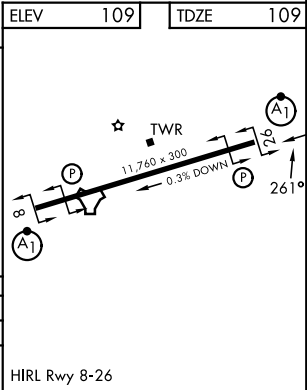

GOLDSBORO, NORTH CAROLINA

35° 20' N-77° 58' W

SEYMOUR JOHNSON AFB (KGSB)

Amtd 8 03NOV22

TACAN Y RWY 26

SE-2, 06 AUG 2026 to 03 SEP 2026

SE-2, 06 AUG 2026 to 03 SEP 2026