


LOC/DME I-PWM 109.9 Chan 36	APP CRS 110°	Rwy Ldg 7200 TDZE 76 Apt Elev 76
---	------------------------	---



ILS RWY 11 (SA CAT I)
PORTLAND INTL JETPORT (PWM)

 Procedure NA when control tower closed. Requires specific OPSPEC, MSPEC, or LOA approval and use of HUD to DH.		MISSED APPROACH: Climb to 600 then climbing right turn to 3000 direct ENE VOR/DME and hold.
---	--	---

ATIS 119.05	PORTLAND APP CON ★ 119.75 269.35	PORTLAND TOWER ★ 120.9 0 (CTAF) 257.8	GND CON 121.9	UNICOM 122.95
-----------------------	--	---	-------------------------	-------------------------

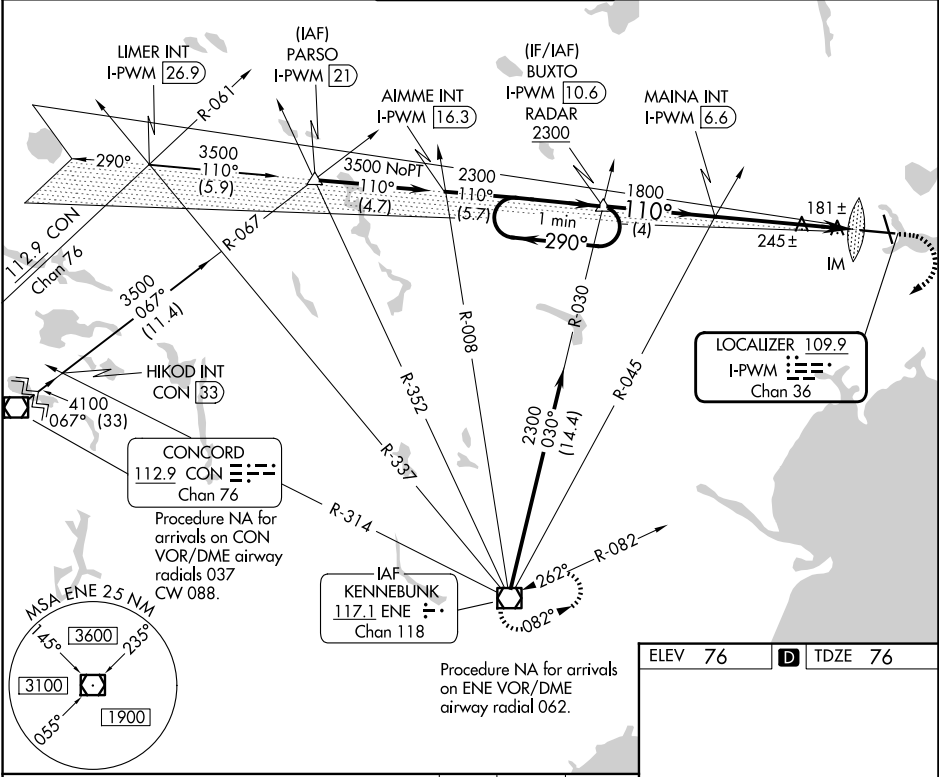

ELEV 76	TDZE 76
---------	---------

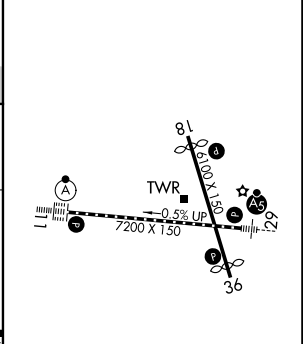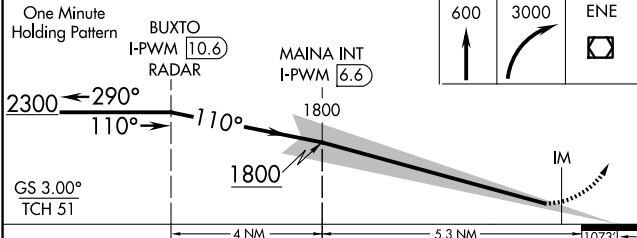

CATEGORY	A	B	C	D
S-ILS 11	RA 166/14 150 DA 226			

SA CATEGORY I ILS - SPECIAL AIRCREW
& AIRCRAFT CERTIFICATION REQUIRED

- TDZL/RCLS Rwy 11
- MIRL Rwy 18-36
- HIRL Rwy 11-29
- REIL Rwy 18 and 36