

VORTAC RIC 114.1 Chan 88	APP CRS 323°	Rwy Ldg 9003 TDZE 161 Apt Elev 167
--	------------------------	---

VOR RWY 34
RICHMOND INTL (RIC)


DME or RADAR required. RADAR required for procedure entry.

T For inop ALS, increase S-34 Cat C/D visibility to RVR 5500.


ALSF-2

MISSED APPROACH: Climbing right turn to 2000 via RIC R-018 to EPICS INT and hold.

ATIS	POTOMAC APP CON		RICHMOND TOWER	GND CON
119.15 263.025	126.4 282.375	(001°-185°)	121.1 257.8	121.9 348.6
	126.75 307.2	(186°-360°)		

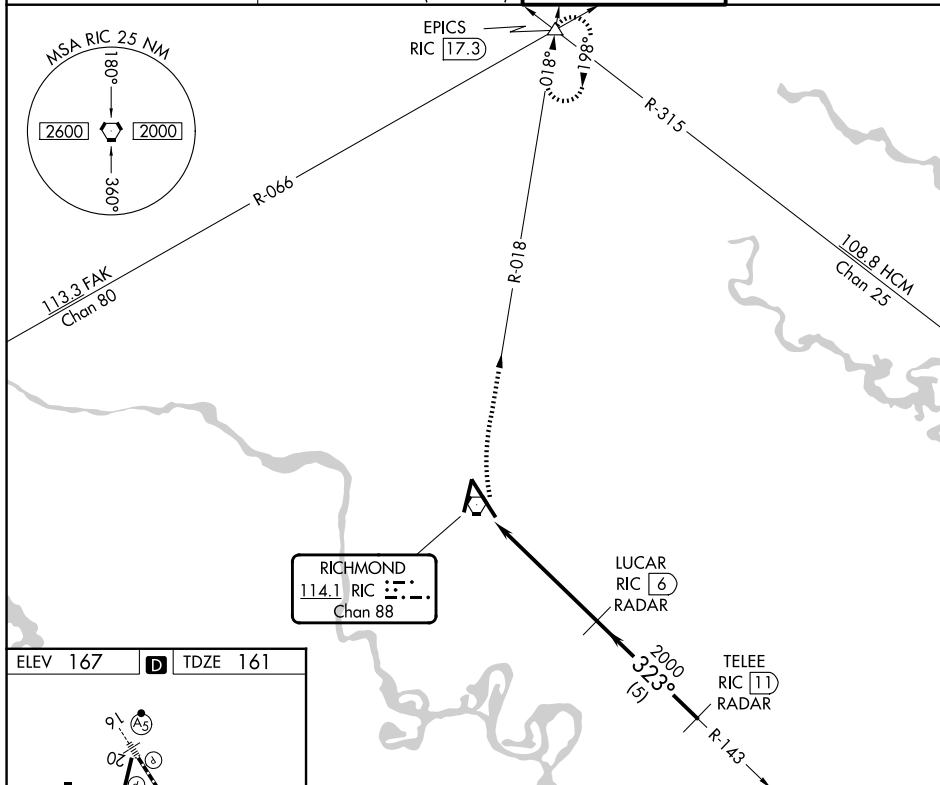

FILEV 167		TDZFE 161
-----------	---	-----------

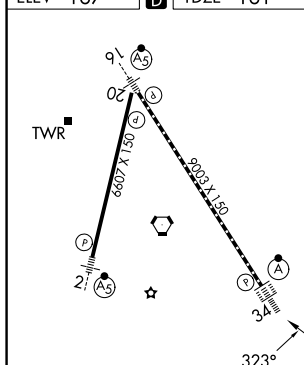

2000 RIC R-018	EPICS △	VGSI and descent angles not coincident (VGSI Angle 3/00/TCH 79).				LUCAR RIC <u>6</u> RADAR	TELEE RIC <u>11</u> RADAR
CATEGORY	A		B		C	D	
S-34	540/24 379 (400-½)				540/40 379 (400-¾)	540/50 379 (400-1)	
CIRCLING	660-1 493 (500-1)				700-1½ 533 (600-1½)	720-2 553 (600-2)	

NE-3, 06 AUG 2026 to 03 SEP 2026

NE-3, 06 AUG 2026 to 03 SEP 2026