

WAAS CH 42632 W35A	APP CRS 352°	Rwy Ldg TDZE Apt Elev	4809 3641 3649
--	------------------------	-----------------------------	---

RNAV (GPS) RWY 35

TRADEWIND (TDW)


RNP APCH-GPS.

NA

Procedure NA at night. Rwy 35 helicopter visibility reduction below 1 SM NA. Baro-VNAV NA. Use Rick Husband Amarillo Intl altimeter setting; when not received, use Hereford altimeter setting; increase LPV DA to 3983 feet, LNAV/VNAV DA to 4108 feet, and all MDAs 80 feet, and increase LNAV/VNAV all Cats and Circling Cat B visibility ¼ SM.

MISSED APPROACH: Climb to 4100 then climbing left turn to 6100 direct ZERAR and hold, continue climb-in-hold to 6100.

AWOS-AV 118.475	AMA ASOS 118.85 350.3	AMARILLO APP CON ★ 119.5 307.0	CLNC DEL 125.4	UNICOM 122.8 (CTAF) 0
---------------------------	---------------------------------	--	--------------------------	---------------------------------

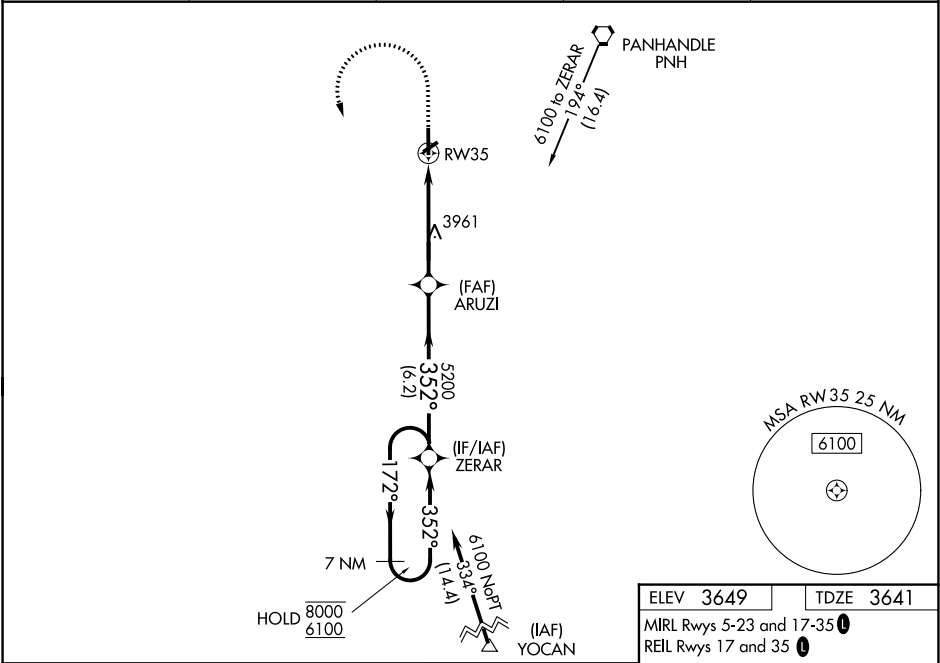

7 NM Holding Pattern			ZERAR		4100 6100 ZERAR	
8000 ← 172° 6100 → 352°			ARUZI 5200		5200 RW35	
GP 3.00° TCH 40			6.2 NM		4.8 NM	
CATEGORY	A	B	C	D		
LPV DA	3913-1	272 (300-1)	NA			
LNAV/VNAV DA	4038-1½	397 (400-1½)	NA			
LNAV MDA	4300-1	659 (700-1)	NA			
CIRCLING	4300-1 651 (700-1)	4420-1 771 (800-1)	NA			

