

MARYSVILLE, CALIFORNIA

HI-TACAN Z RWY 33

TACAN BAB Chan 23	APCH CRS 317°	Rwy ldg TDZE Arpt Elev	12,001 105 113
----------------------	------------------	------------------------------	----------------------

(USAF)


BEALE AFB (KBAB)

⚠ *When ALS inop, increase CAT CDE vis to 1 1/4 miles.
**Circling not authorized NE of Rwy 1-5-33.

ALSF-1
A1

MISSED APPROACH: Climb to 3600, intercept BAB TACAN R-326 to HAPAK and hold.

ATIS★ 124.55 273.5	NORCAL APP CON 125.4 259.1	TOWER★ 119.4 284.75	GND CON 121.6 257.75
-----------------------	-------------------------------	------------------------	-------------------------

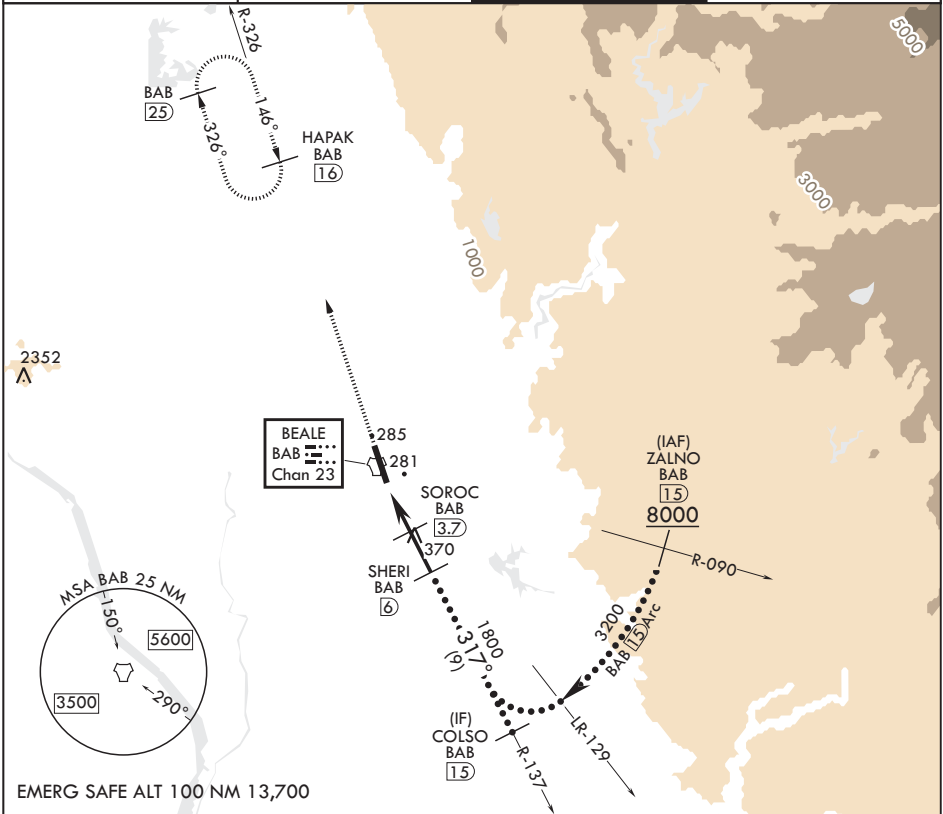

3600 BAB R-326	HAPAK BAB 16	ELEV 113	TDZE 105
----------------------	--------------------	----------	----------

BAB TACAN

EGUYO BAB 1.5

BAB 2.2

SOROC BAB 3.7

SHERI BAB 6

COLSO BAB 15

1800

3200

1000

3.09°

TCH 51

5

2.2 NM

2.3 NM

CATEGORY	C	D	E
S-33*	540/40	435	(500-¾)
CIRCLING**	600-1½ 487 (500-1½)	800-2¼ 687 (700-2¼)	800-2½ 687 (700-2½)

BCN 240

TWR 274

12,001 x 300

33

317°

HIRL all rwys

MARYSVILLE, CALIFORNIA

39°08'N - 121°26'W

BEALE AFB (KBAB)

Amtdt 6 25JAN24

HI-TACAN Z RWY 33

SW-2, 06 AUG 2026 to 03 SEP 2026

SW-2, 06 AUG 2026 to 03 SEP 2026