


VORTAC SJU	APP CRS	Rwy Ldg	9384
114.0	082°	TDZE	9
Chan 87		Apt Elev	10

VOR or TACAN RWY 8

LUIS MUNOZ MARIN INTL (SJU)(TJSJ)

ADF or DME required.	MALSR	MISSED APPROACH: Climb to 2000 then climbing left turn to 3000 via heading 320° and SJU VORTAC R-004 outbound to DEEDY INT/SJU 15 DME and hold.
For inop ALS, increase S-8 Cat E visibility to 2 SM.		
Circling NA for Cat E south of Rwy 10-28.		

D-ATIS	SAN JUAN APP CON	SAN JUAN TOWER	GND CON
125.8	119.4 269.2 (W & SW) 120.9 290.2 (N & E)	132.05 257.8	121.9 348.6

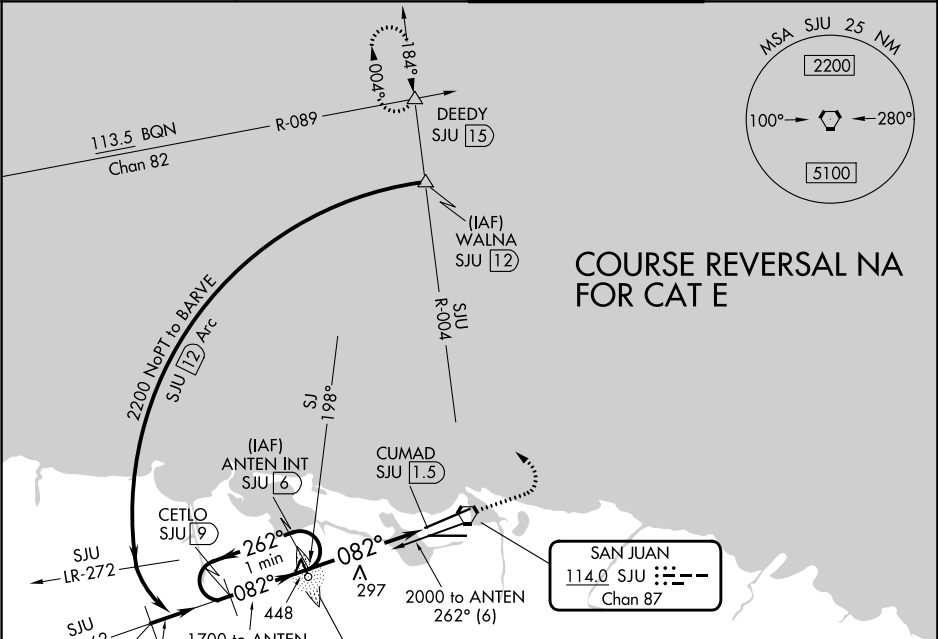

One Minute Holding Pattern		ANTEN INT SJU 6	2000	3000	SJU R-004	DEEDY
2000 ← 262°		1700	082°	hdg 320°		
VGSI and descent angles not coincident (VGSI Angle 3.00/TCH 70).		3.45°	TCH 46	SJU 3	CUMAD SJU 1.5	
		3 NM	1.5			
CATEGORY	A	B	C	D	E	
S-8	560-½	551 (600-½)	560-1 551 (600-1)	560-1¼ 551 (600-1¼)	560-1½ 551 (600-1½)	
CIRCLING	600-1	590 (600-1)	740-2 730 (800-2)	920-3	910 (1000-3)	

ELEV 10	TDZE 9
REIL Rwy 26	
HIRL Rwy 8-26 and 10-28	
FAF to MAP 4.5 NM	
Knots	60 90 120 150 180
Min:Seq	4:30 3:00 2:15 1:48 1:30