


LOC/DME I-AKN	APP CRS	Rwy Ldg
110.3	301°	8501
Chan 40		TDZE 73
		Apt Elev 73

LOC BC RWY 30

KING SALMON (AKN)(PAKN)

DME required.	MISSED APPROACH: Climb to 600 then climbing left turn to 3000 on heading 240° and AKN VORTAC R-210 to OLLER/AKN 15 DME and hold.
▼ When local altimeter setting not received, use WSN/PFWs	
▲ altimeter setting and increase all MDAs 40 feet.	

ATIS 128.8	ANCHORAGE CENTER 124.8 354.0	KING SALMON TOWER★ 118.3 279.5	GND CON 121.9	UNICOM 122.95	CTAF 121.9 352.05
----------------------	--	--	-------------------------	-------------------------	-----------------------------

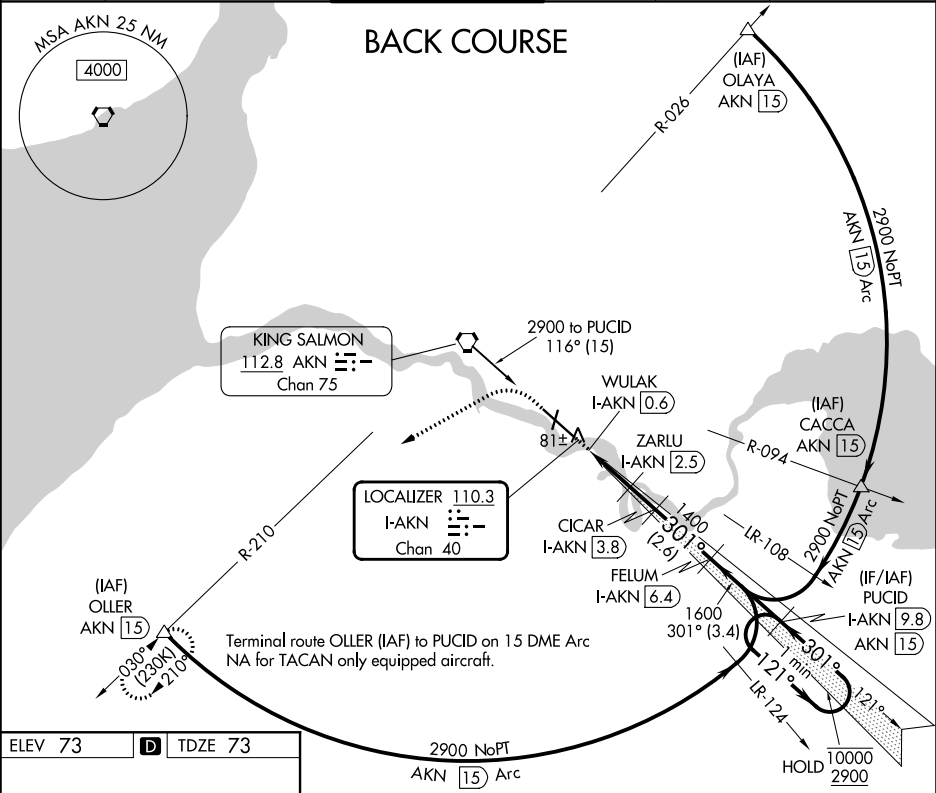

ELEV 73	D	TDZE 73
MIRL Rwy 18-36 1 HIRL Rwy 12-30 1		
KING SALMON, ALASKA Amdt 6A 07AUG25		
58°41'N-156°39'W		
KING SALMON (AKN)(PAKN)		
LOC BC RWY 30		