

VORTAC AKN <u>112.8</u> Chan 75	APP CRS 296°	Rwy Ldg 8501 TDZE 73 Apt Elev 73
---------------------------------------	-----------------	--


VOR Y or TACAN Y RWY 30
KING SALMON (AKN)(PAKN)

DME required.


MISSED APPROACH: Climbing left turn to 3000 on heading 240° and on AKN VORTAC R-210 to OLLER/15 DME and hold.

T When local altimeter setting not received, use WSN/PFWS altimeter setting and increase all MDAs 40 feet and S-30 visibility Cat C/D/E $\frac{1}{4}$ SM.

ATIS 128.8	ANCHORAGE CENTER 124.8 354.0	KING SALMON TOWER* 118.3 279.5	GND CON 121.9	UNICOM 122.95	CTAF 121.9 352.05
---------------	---------------------------------	-----------------------------------	------------------	------------------	----------------------

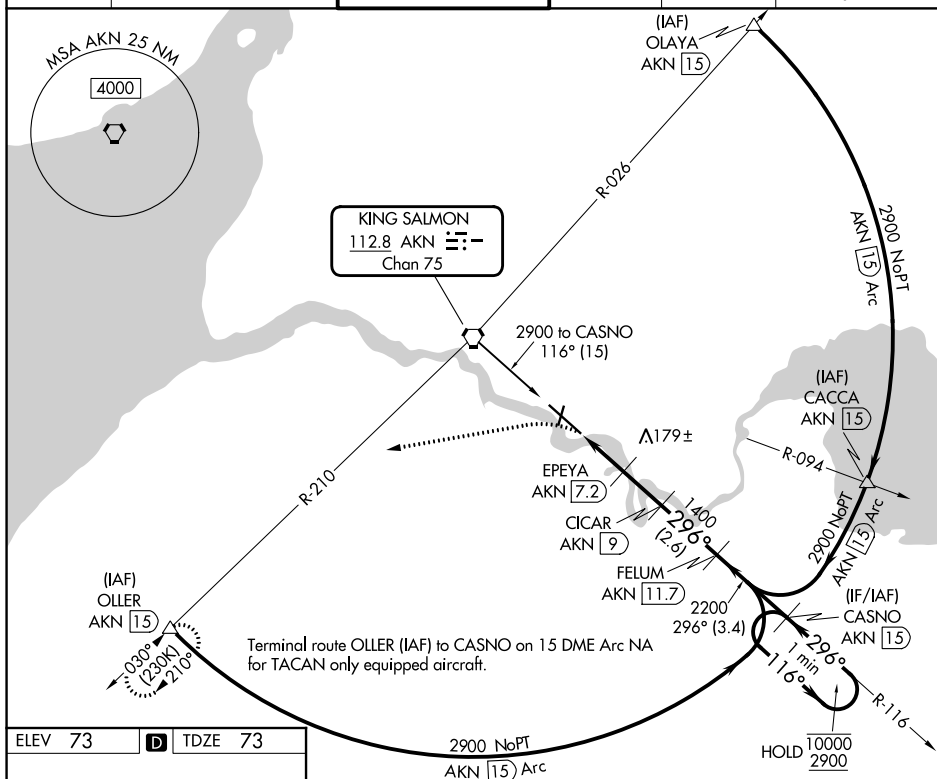

ELEV 73	D	TDZE 73
---------	----------	---------

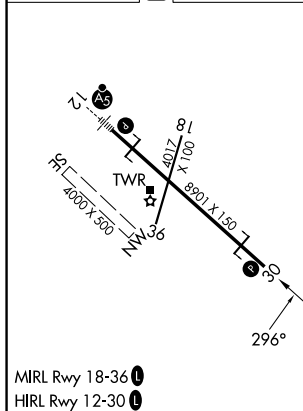

3000 hdg 240°	AKN R-210	OLLER △	One Minute Holding Pattern				
AKN 5.1	AKN 6.3	EPEYA AKN 7.2	CICAR AKN 9	FELUM AKN 11.7	CASNO AKN 15	10000 2900	
1.1 NM			0.9	1.8 NM	2.6 NM	3.4 NM	
CATEGORY	A		B		C	E	
S-30	480-1 407 (500-1)		480-1½ 407 (500-1½)				
CIRCLING	580-1 507 (600-1)		580-1½ 507 (600-1½) 900-2¾ 827 (900-2¾) 960-3 887 (900-3)				