

WAAS CH 53512 W10A	APP CRS 104°	Rwy Ldg TDZE Apt Elev 4001 1057 1074	RNAV (GPS) Z RWY 10 MOUNT WASHINGTON RGNL (HIE')
--	------------------------	--	--

⚠


⚠

❄

DME/DME RNP-0.3 NA. Visibility reduction by helicopters NA.
When local altimeter setting not received, use Lyndonville altimeter setting and increase DA 71 feet and LPV all Cats visibility ½ mile.

MISSED APPROACH: Climb to 7100 direct CRESY and via track 099° to JOBBY and hold, continue climb-in-hold to 7100.

ASOS 118.525	BOSTON CENTER 135.7 282.2	UNICOM 122.8 (CTAF) 0
------------------------	-------------------------------------	---------------------------------

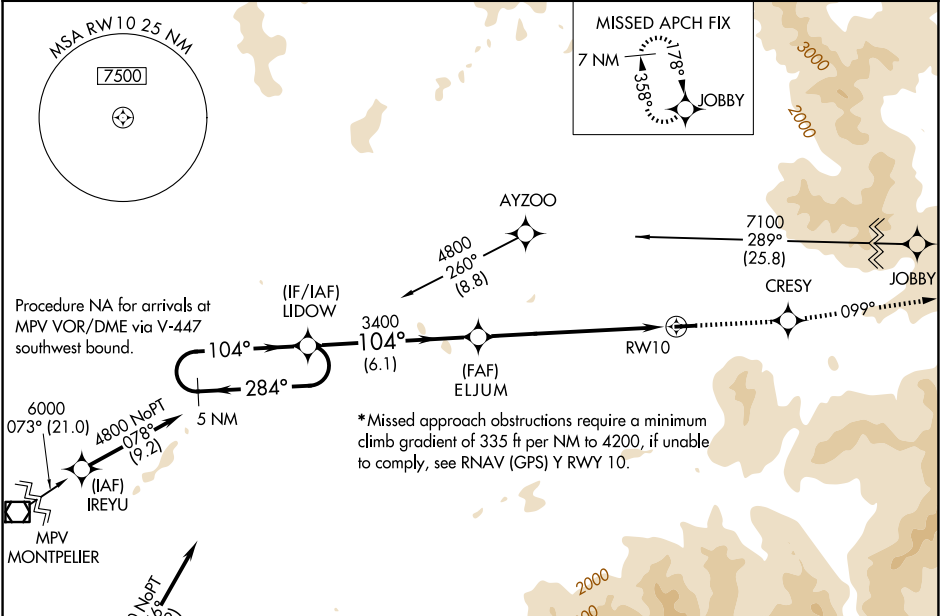

ELEV 1074

TDZE 1057

104°

0.6% UP

4001 X 75

5 NM Holding Pattern

VGSI and RNAV glidepath not coincident (VGSI Angle 3.50/TCH 45).

GP 3.00° TCH 45

4800

284°

104°

104°

3400

6.1 NM

7.1 NM

RW10

7100	CRESY	tr 099°	JOBBY
------	-------	---------	-------

CATEGORY	A	B	C	D
*LPV DA	1507-1½ 450 (500-1½)			
	NA			

REIL Rwy 10 and 28 0

MIRL Rwy 10-28 0