

WAAS CH 78410 W05A	APP CRS 052°	Rwy Ldg 12103 TDZE 736 Apt Elev 744
--	------------------------	--

RNAV (GPS) RWY 5R
RICKENBACKER INTL (LCK)

RNP APCH - GPS


A Circling NA northwest of Rwy 5L-23R. For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -16°C or above 54°C. Baro-VNAV and VDP NA, when using John Glenn Columbus Intl altimeter setting. When local altimeter setting not received, use John Glenn Columbus Intl altimeter setting: increase LPV DA to 971 feet; increase LNAV/VNAV DA to 1138 feet and visibility to RVR 4000 all Cats; increase all MDAs 40 feet and LNAV Cats C/D visibility to RVR 4000 and Circling Cat D visibility to 2 1/4 SM. For inop ALS when using John Glenn Columbus Intl altimeter setting: increase LNAV/VNAV visibility to RVR 6000. all Cats.

ALSF-2



MISSED APPROACH:
Climb to 1500 then
climbing right turn to
3000 direct XUB VOR
and hold.

ATIS 132.75	COLUMBUS APP CON 134.0 279.6	RICK TOWER 120.05 348.4	GND CON 125.275 275.8
----------------	---------------------------------	----------------------------	--------------------------

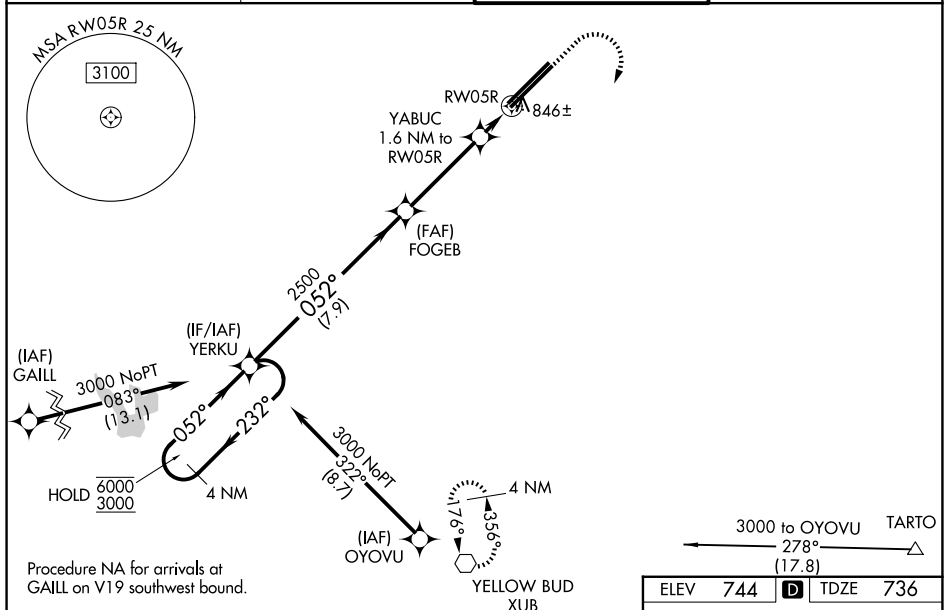

ELEV	744	D	TDZE	736
------	-----	----------	------	-----

