


LOC/DME I-ERP 111.55 Chan 52(Y)	APP CRS 263°	Rwy Ldg TDZE 5355 Apt Elev 5434
---	------------------------	---


ILS or LOC RWY 25
DENVER INTL (DEN)

Simultaneous approach authorized with Rwy 26. For inoperative MALSR, increase S-LOC 25 Cat C and D visibility to RVR 5500. **RVR 1800 authorized with use of FD or AP or HUD to DA.	MALSR 	MISSED APPROACH: Climb to 10000 on heading 263° and on FQF VORTAC R-306 to HYGEN INT/FQF 37.9 DME and hold.
--	------------------	--

D-ATIS 125.6 379.9	DENVER APP CON 119.3 307.3 (N) 120.35 379.3 (S)	DENVER TOWER 128.75 273.55	GND CON 121.35 379.175 (W) 121.85 377.1 (E)
-------------------------------------	--	---	--

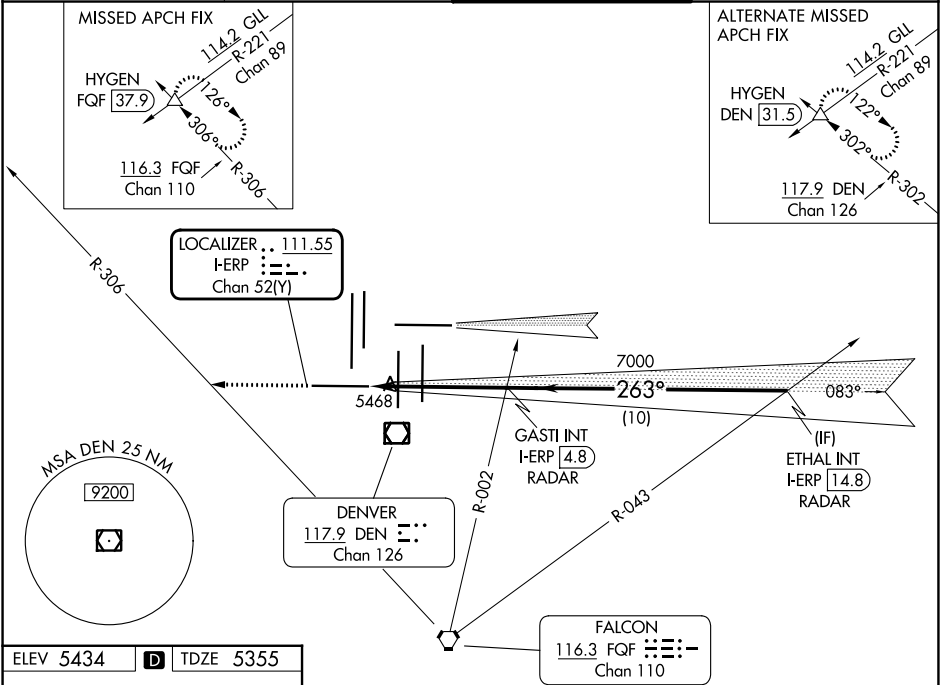

ELEV 5434	D	TDZE 5355
-----------	----------	-----------

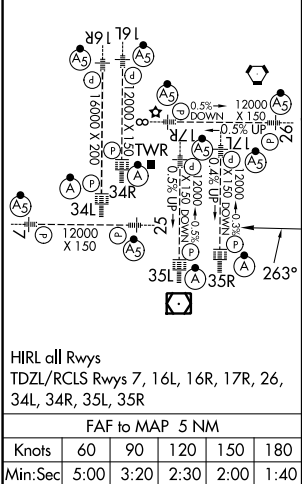

DENVER, COLORADO
Amdt 3A 11DEC14

39°52'N-104°40'W

RADAR REQUIRED

10000 hdg 263° *LOC only	FQF R-306	HYGEN △	VGSI and ILS glidepath not coincident (VGSI Angle 3.00/TCH 71).	ETHAL INT I-ERP [14.8] RADAR
*I-ERP [0.7]	GASTI INT I-ERP [4.8] RADAR	7000	263°	10000
0.9 NM	4.1 NM	10 NM	GS 3.00° TCH 55	
CATEGORY	A	B	C	D
S-ILS 25 **	5555/24 200 (200-½)			
S-LOC 25	5720/24 365 (300-½)		5720/35 365 (300-¾)	

DENVER INTL (DEN)
ILS or LOC RWY 25

SW-1, 06 AUG 2026 to 03 SEP 2026

SW-1, 06 AUG 2026 to 03 SEP 2026