

WAAS CH 93628 W25A	APP CRS 254°	Rwy Idg 5000 TDZE 1122 Apt Elev 1122
--	------------------------	---



RNAV (GPS) RWY 25
BELLEFONTAINE RGNL (EDJ)

RNP APCH - GPS

NA For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -17°C or above 36°C.
Rwy 25 helicopter visibility reduction below ¾ SM NA. When local altimeter setting not received, use James M Cox Dayton Intl altimeter setting and increase LPV DA to 1555 feet and all visibilities ½ SM; increase LNAV/VNAV DA to 1762 feet; increase all MDAs 100 feet and LNAV visibility Cat B ¼ SM, Cat C and D ½ SM, and Circling visibility Cat B ¼ SM, Cat C ½ SM, Cat D ¼ SM. Baro-VNAV and VDP NA when using James M Cox Dayton Intl altimeter setting.

MISSED APPROACH:
Climb to 1900 then
climbing left turn to
3000 direct ROD
VORTAC and hold.

AWOS-3 118.075	COLUMBUS APP CON 134.45 294.5	UNICOM 122.8 (CTAF) 0
--------------------------	---	--

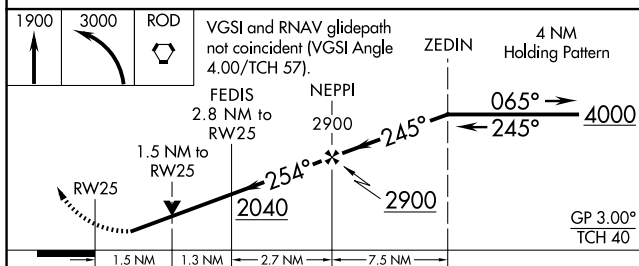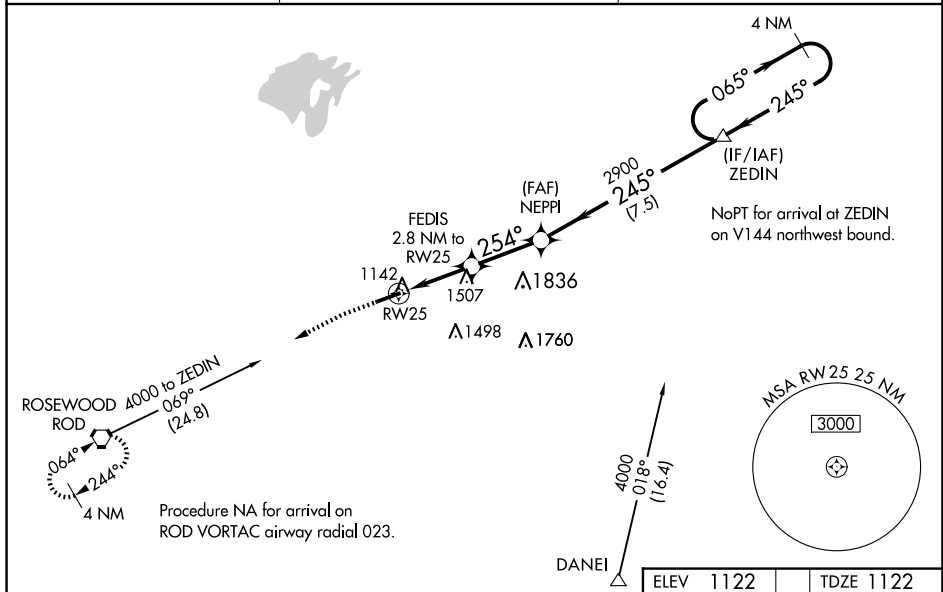

CATEGORY	A	B	C	D
LPV DA	1457-1½ 335 (400-1½)			
LNAV/VNAV DA	1664-1⅞ 542 (600-1⅞)			
LNAV MDA	1820-1 698 (700-1)		1820-2 698 (700-2)	
CIRCLING	1820-1 698 (700-1)		1860-2 738 (800-2)	1980-2¾ 858 (900-2¾)

