

TAMPA, FLORIDA

AL-416 (FAA)

26078

APP CRS
007°

Rwy Ldg	10800
TDZE	11
Apt Elev	26

RNAV (RNP) Z RWY 1L
TAMPA INTL (TPA)

RNP AR APCH - GPS.

T For uncompensated Baro-VNAV systems, procedure NA below 4°C or above 54°C. Simultaneous approach authorized. For inop ALS, increase RNP 0.13 all Cats visibility to 4500 RVR.

ALSF-2




MISSED APPROACH:
Climb to 2000 direct
MERRA and hold.

D-ATIS
126.45

TAMPA APP CON
118.5 307.175

TAMPA TOWER
119.5 269.4

GND CON
121.7 269.4

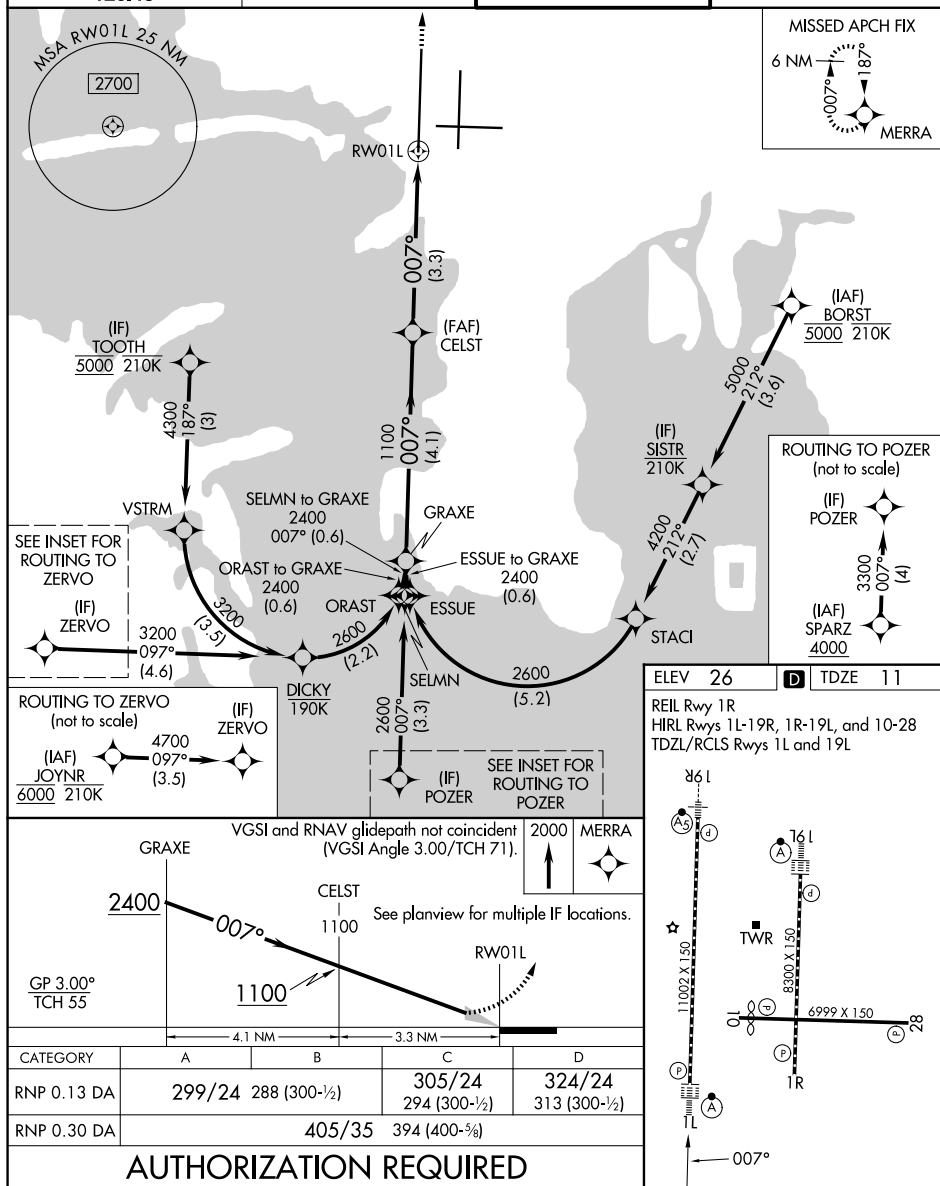

TAMPA, FLORIDA
Orig 17APR25

27°59'N-82°32'W

TAMPA INTL (TPA)
RNAV (RNP) Z RWY 1L

SE-3, 03 SEP 2026 to 01 OCT 2026