

PERU, INDIANA

ILS or LOC RWY 5


LOC I-GUS 109.5	APCH CRS 046°	Rwy Idg 12,501 TDZE 811 Arpt Elev 811
---------------------------	-------------------------	--

[USAF]


GRISSOM ARB (KGUS)

RADAR, TACAN required * When ALS inop, increase RVR to 40 and vis to ¾ mile. ** When ALS inop, increase CAT AB RVR to 55 and vis to 1 mile; CAT CDE vis to 1½ miles.		ALSIF-1 (A1)	MISSED APPROACH: Climb to 3000 on the GUS TACAN R-041 to RICHI and hold. Missed approach requires use of RNAV or ATC RADAR monitoring.
--	--	------------------------	---

ATIS 132.55 270.8	APP CON 121.05 351.8 (E) 123.85 291.675 (W)	TOWER ★ 133.7 290.45	GND CON 128.425 275.8
-----------------------------	---	--------------------------------	---------------------------------

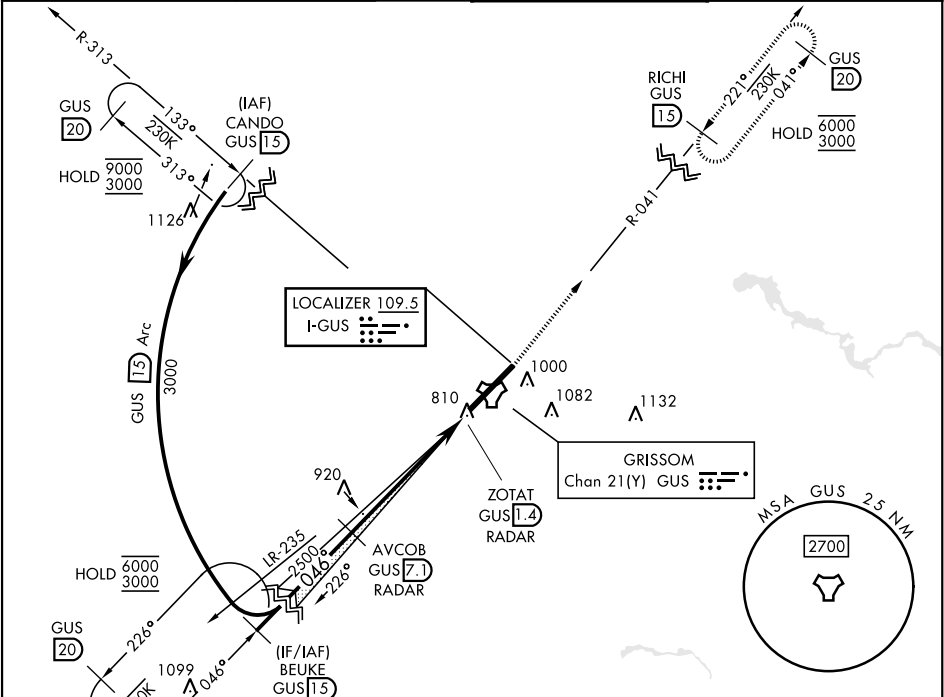

EMERG SAFE ALT 100 NM 3500

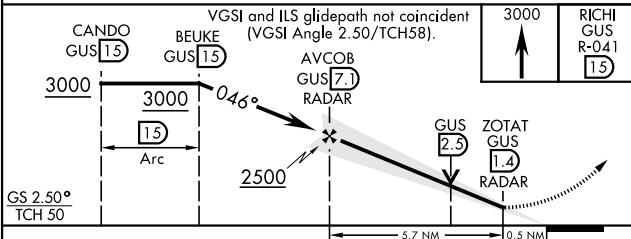

CATEGORY	A	B	C	D	E	046° 917 917 HIRL Rwy 5-23						
S-ILS 5 *	1011/24		200	(200-½)		FAF to MAP 5.7 NM						
S-LOC 5 **	1280/24	469 (500-½)	1280/50		469 (500-1)	Knots	60	90	120	150	180	
CIRCLING	1340-1	529 (600-1)	1400-1½ 589 (600-½)	1400-2 589 (600-2)	1440-2¼ 629 (700-2¼)	Min:Sec	5:42	3:48	2:51	2:17	1:54	

PERU, INDIANA

40°39'N-86°09'W

GRISSOM ARB (KGUS)

Amtd 9 11AUG22

ILS or LOC RWY 5

EC-2, 03 SEP 2026 to 01 OCT 2026

EC-2, 03 SEP 2026 to 01 OCT 2026