


(CAWIN.LIBER6) 26246  
LIBER SIX ARRIVAL (RNAV)

AL-1234 (FAA) FAIRBANKS INTL (FAI) (PAFA)  
FAIRBANKS, ALASKA

FAIRBANKS APP CON  
125.35 363.2  
ATIS  
124.4

RNAV 1 - GPS.  
RADAR required after STARC.

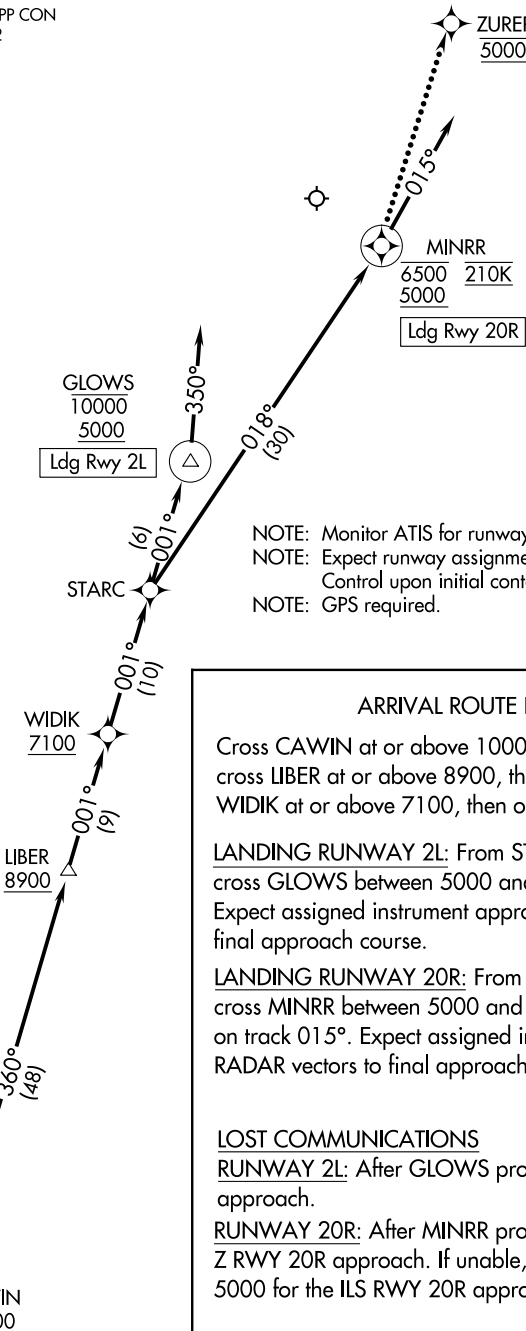

NOTE: Monitor ATIS for runway in use.  
NOTE: Expect runway assignment from Fairbanks Approach Control upon initial contact.  
NOTE: GPS required.

NOTE: Chart not to scale.

ARRIVAL ROUTE DESCRIPTION

Cross CAWIN at or above 10000, then on track 360° to cross LIBER at or above 8900, then on track 001° to cross WIDIK at or above 7100, then on track 001° to STARC.

LANDING RUNWAY 2L: From STARC on track 001° to cross GLOWS between 5000 and 10000, then on track 350°. Expect assigned instrument approach or RADAR vectors to final approach course.

LANDING RUNWAY 20R: From STARC on track 018° to cross MINRR between 5000 and 6500 and at 210K, then on track 015°. Expect assigned instrument approach or RADAR vectors to final approach course.

LOST COMMUNICATIONS

RUNWAY 2L: After GLOWS proceed on the ILS RWY 2L approach.

RUNWAY 20R: After MINRR proceed on the RNAV (RNP) Z RWY 20R approach. If unable, proceed to ZUREP at 5000 for the ILS RWY 20R approach.