

TACAN Y RWY 32

TACAN EIL Chan 98	APCH CRS 325°	Rwy Idg 14,529 TDZE 548 Arpt Elev 548
-----------------------------	-------------------------	--

[USAF]

EIELSON AFB (PAEI)

ATC or RADAR required HRDNG to BOGIE. RNAV or RADAR monitoring required for missed approach.

ALSF-1


MISSED APPROACH: Climbing left turn on EIL R-254 to 4000 to WAKOV and hold. Continue climb-in-hold.

T * When ALS inop, increase CAT AB RVR to 55, vis to 1 mile; CAT CDE vis to 1 $\frac{3}{8}$ miles.

** Circling not authorized E of Rwy 14-32.



ATIS ★	FAIRBANKS APP CON	TOWER ★	GND CON
119.9 273.5	127.1 251.1 (360°- 179°) 125.35 363.2 (180°- 359°)	127.2 352.05	121.8 275.8

CAUTION: Uncontrolled airspace below 700' AGL outside EIL CLASS D.

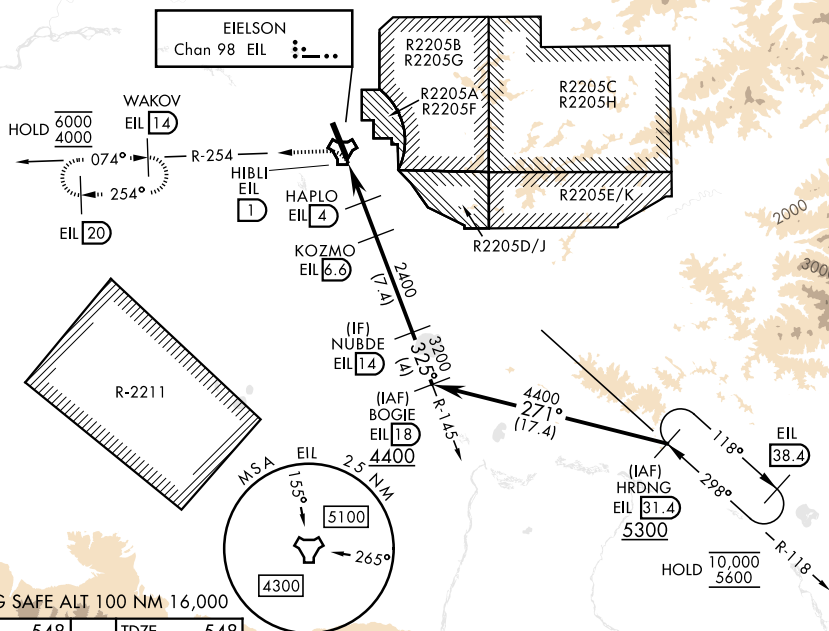

EMERG SAFE ALT 100 NM 16,000

ELEV	548		TDZE	548
------	-----	--	------	-----

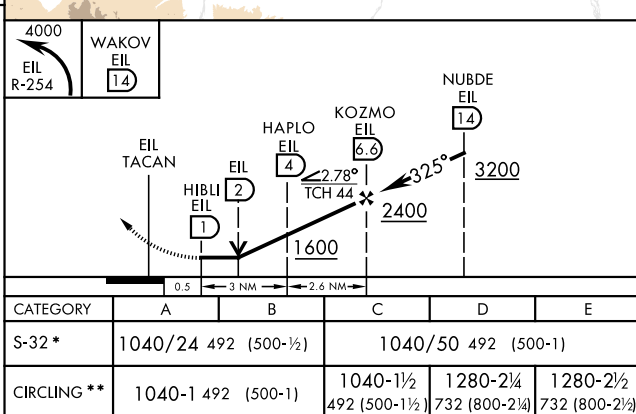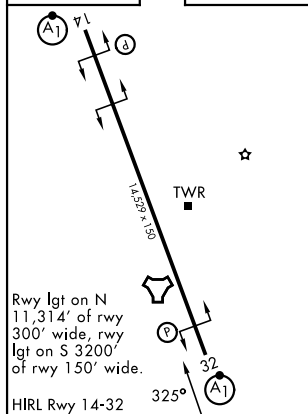

FAIRBANKS, ALASKA

64° 40' N-147° 06' W

EIELSON AFB (PAEI)

Amdt 1 03SEP26

TACAN Y RWY 32

AK, 03 SEP 2026 to 29 OCT 2026

AK, 03 SEP 2026 to 29 OCT 2026