

WAAS CH 82134 W26A	APP CRS 258°	Rwy Ldg TDZE Apt Elev	5000 209 239
--	------------------------	-----------------------------	---

RNAV (GPS) RWY 26

CHERAW MUNI/LYNCH BELLINGER FLD (CQW)


▼

▲

DME/DME RNP-0.3 NA. When local altimeter setting not received, use Darlington altimeter setting and increase all DA 44 feet, all MDA 60 feet, LNAV/VNAV all Cats visibility 1/8 mile, LNAV Cat C/D and Circling Cat C/D visibility 1/4 mile. Helicopter visibility reduction below 1 SM NA. For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -15°C (5°F) or above 54°C (130°F). Procedure NA at night.

MISSED APPROACH:
Climb to 2500 direct YOVL and hold.

AWOS-3 124.825	FLORENCE APP CON ★ 118.6 341.7	UNICOM 122.8 (CTAF) ①
--------------------------	--	---------------------------------

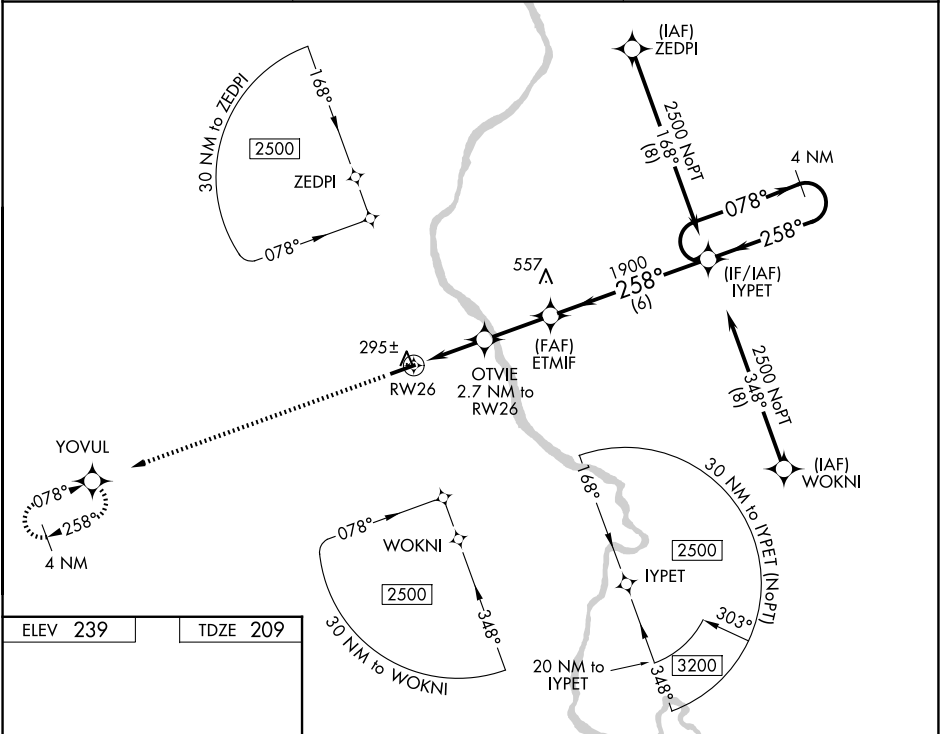

ELEV 239

TDZE 209

258°

5000 X 75

1.0% UP

289

2500

YOVL

VGSI and RNAV glidepath not coincident.

4 NM Holding Pattern

078°

258°

2500

GP 3.00°

TCH 53

*LNAV only.

OTVIE 2.7 NM to RW26

ETMIF 1900

IYPT

258°

1900

*1100

2.7 NM

2.5 NM

6 NM

CATEGORY	A	B	C	D
LPV DA		459-1	250 (300-1)	
LNAV/VNAV DA		578-1 1/4	369 (400-1 1/4)	
LNAV MDA		560-1	351 (400-1)	
CIRCLING	700-1	461 (500-1)	1060-2 1/2 821 (900-2 1/2)	1060-2 3/4 821 (900-2 3/4)

REIL Rwy 8 and 26 ①

MIRL Rwy 8-26 ①