


WAAS CH 90326 W34A	APP CRS 344°	Rwy Ldg TDZE Apt Elev	3502 1279 1279
--	------------------------	-----------------------------	---

RNAV (GPS) RWY 34

FOSSTON MUNI/ANDERSON FLD (F'SE')

RNP APCH	VDP NA when using Thief River Falls altimeter setting. When local altimeter setting not received, use Thief River Falls altimeter setting and increase all MDA 100 feet and increase LP and LNAV Cat C visibility 3/8 SM, and increase Circling Cat C visibility 1/2 SM.	MISSED APPROACH: Climb to 4000 direct ZOBON and hold.
----------	--	--

AWOS-3 118.35	MINNEAPOLIS CENTER 134.75 251.1	GCO 121.725	CTAF 122.9 0
-------------------------	---	-----------------------	------------------------

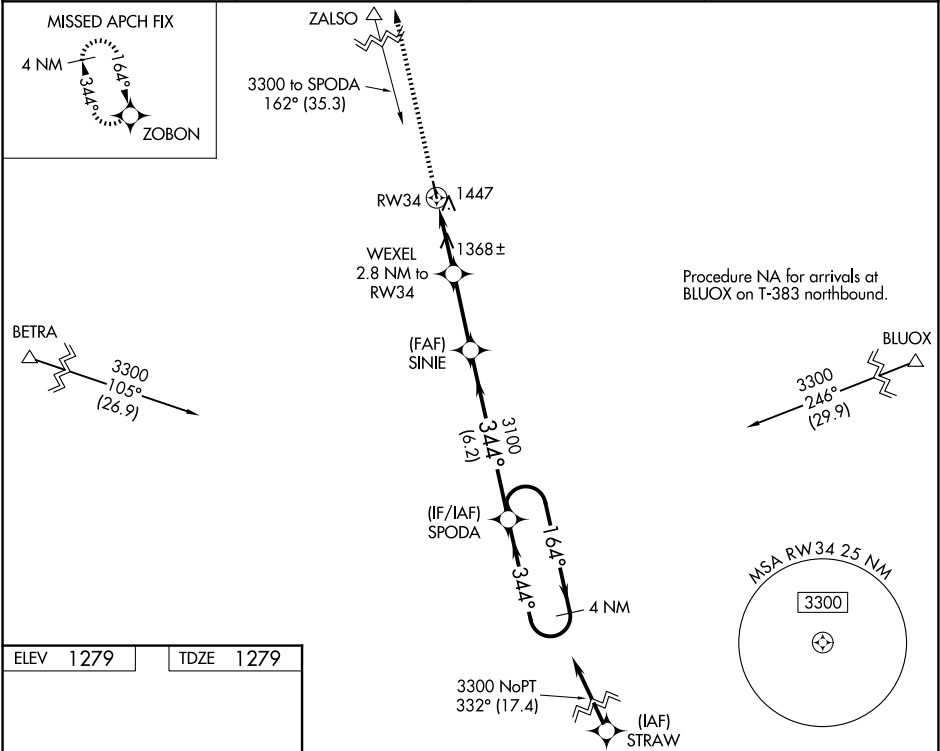

ELEV 1279	TDZE 1279				
MRL Rwy 16-34 0		REIL Rwy 16 and 34 0			
FOSSTON, MINNESOTA		FOSSTON MUNI/ANDERSON FLD (F'SE')			
Orig-D 08NOV18		47°36'N-95°46'W			
		RNAV (GPS) RWY 34			

4000	ZOBON	VGSI and descent angles not coincident (VGSI Angle 2.80/TCH 25).		SPODA	4 NM Holding Pattern
WEXEL 2.8 NM to RW34		SINIE		3300	
1.1 NM to RW34		3.00° TCH 40°		164° 344°	
RW34		2200		3100	
1.1 NM		1.7 NM		2.8 NM	
		B		C	
CATEGORY		A		D	
LP MDA		1620-1 341 (400-1)		NA	
LNAV MDA		1760-1 481 (500-1)		NA	
CIRCLING		1860-1 581 (600-1)		NA	