

Flight Procedures Cover Page	Task Action: FLIGHT CHECK	Task Type: IAP	Estimated Chart Date: 05/16/2024	APWS Task ID: EA032176864A4D5D89A19DED5B7EAE08	APWS Project ID: 962FD14DD9B3424FBE008EE6658635D5
Procedure: RNAV (GPS) RWY 23 AMDT 2		Enroute: NO	Specialist: Dugan, Joshua		Agreement Number:
Airport ID: PASA			Airport City: SAVOONGA		State: AK
Facility ID:	Facility Type:	Flight Inspection Remark Type: New FC Slot			
Procedure Comments: PENDING AIRNAV DATA USED. CONTACT ERIC SUSKI (AJV-A431) 405-954-7331. Digitally signed by ERIC N SUSKI Feb 28, 2024					

QUALITY
10
CHECKED

QUALITY
30
CHECKED


FIPC BASIC FORM						
PROCEDURE: RNAV (GPS) RWY 23 AMDT 2			AIRPORT NAME: SAVOONGA		AIRPORT ID: PASA	SPECIAL CONTROL NO: KG-03-002-24
FAC ID: PASA23.02		CITY: SAVOONGA			ST: AK	ORIG CHART DATE: 07/11/2024
DFL TYPE: PROC/S	THIRD PARTY: ☐ YES	EST. TIME ON SITE: 0.4	REIMB. NUMBER: AC0598	PTS TASK ID: EA032176864A4D5D89A19DED5B7EAE08		
PREFLIGHT NOTES						
REVIEWER: jordan rolih					DATE: 05/29/2024	
COMMENTS:					CHECK ONE:	
					☒ FLT CK REQ ☐ NFCR ☐ REJECT	
						YES
					CPV COMPLETE?	
PROCEDURE RESULTS						
INSPECTION DATE: 05/28/2024	CREW #: VN408	N #: N89	INSTRUMENT PROCEDURE STATUS: ☐ SAT ☒ SAT W/CHANGES ☐ UNSAT		ARINC CODING: ☒ SAT ☐ SAT/GOLD ☐ UNSAT	
FLIGHT INSPECTOR SIGNATURE: jordan rolih @ 05/29/2024 17:15			PRINTED NAME: ROLIH, JORDAN ALEXANDER			NOTAM INITIATED? ☐ YES ☒ NO
FLIGHT INSPECTOR REMARKS: Flew twice. Pictures were unreliable. Many boxes below 95%. Per IAW TFIG #127, Rev 1 LNAV and Circling minima can be approved ONLY. LPV and LNAV/VNAV lines of minima are unsat.						
IN-FLIGHT OBSTACLE REPORT						
OBSTRUCTION ID #:	COORDINATES OR LOCATION:	GNSS ALTITUDE (MSL):	BAROMETRIC ALTITUDE (MSL):	HEIGHT ABOVE GROUND LEVEL:		

APP CRS	Rwy Idg	4400
230°	TDZE	58
	Apt Elev	59


RNAV (GPS) RWY 23
SAVOONGA (SVA) (PASA)

⚠ DME/DME RNP-0.3 NA. When local altimeter setting not received, use Gambell altimeter setting and increase all MDAs 100 feet; increase LNAV Cat C/D visibility ¼ SM and Circling Cat C visibility ½ SM. Circling NA southeast of Rwy 5-23. VDP NA with Gambell altimeter setting.	MISSED APPROACH: Climbing right turn to 2600 direct RUFZA and hold.
--	---

AWOS-3P 121.3	ANCHORAGE CENTER 132.2 281.4	NOME RADIO 122.3	CTAF 122.7 0
------------------	---------------------------------	---------------------	------------------------

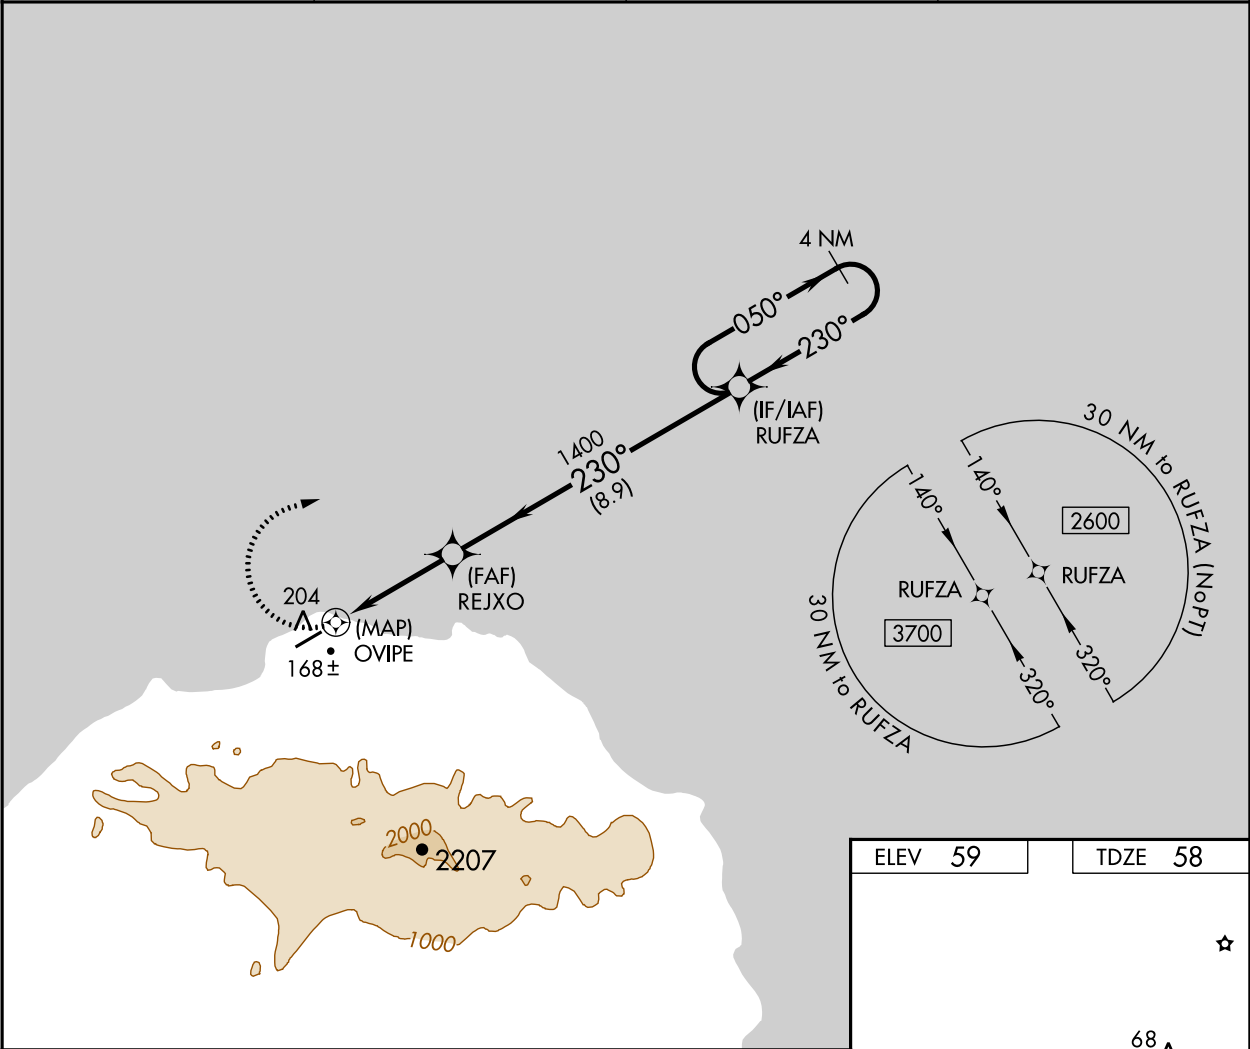

2600	RUFZA	VGSI and descent angles not coincident (VGSI Angle 3.00/TCH 24).				4 NM Holding Pattern
0.5		0.9 NM	2.7 NM	8.9 NM		
CATEGORY	A	B	C	D		
LNAV MDA	520-1	462 (500-1)	520-1 3/8	462 (500-1 3/8)		
CIRCLING	520-1	461 (500-1)	780-2 721 (800-2)	1160-3 1101 (1200-3)		

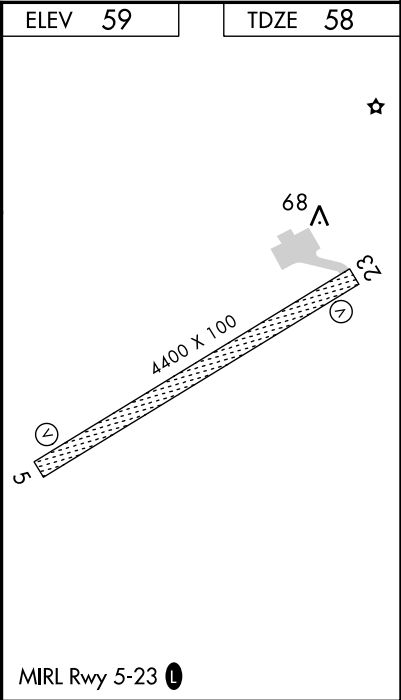

AK, 25 JAN 2024 to 21 MAR 2024


AK, 25 JAN 2024 to 21 MAR 2024

WAAS CH 58245 W23A	APP CRS 235°	Rwy Idg TDZE Apt Elev	4400 58 59
--	------------------------	-----------------------------	---------------------------------------


RNAV (GPS) RWY 23
SAVOONGA (SVA) (PASA)

RNP APCH - GPS.	MISSED APPROACH: Climb to 510 then climbing right turn to 2000 direct NADNY and hold.
▼ ▲ For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -22°C or above 54°C. Circling NA southeast of Rwy 5-23.	


AWOS-3P 121.3	ANCHORAGE CENTER 132.2 281.4	NOME RADIO 122.3	CTAF 122.7 0
-------------------------	--	----------------------------	------------------------

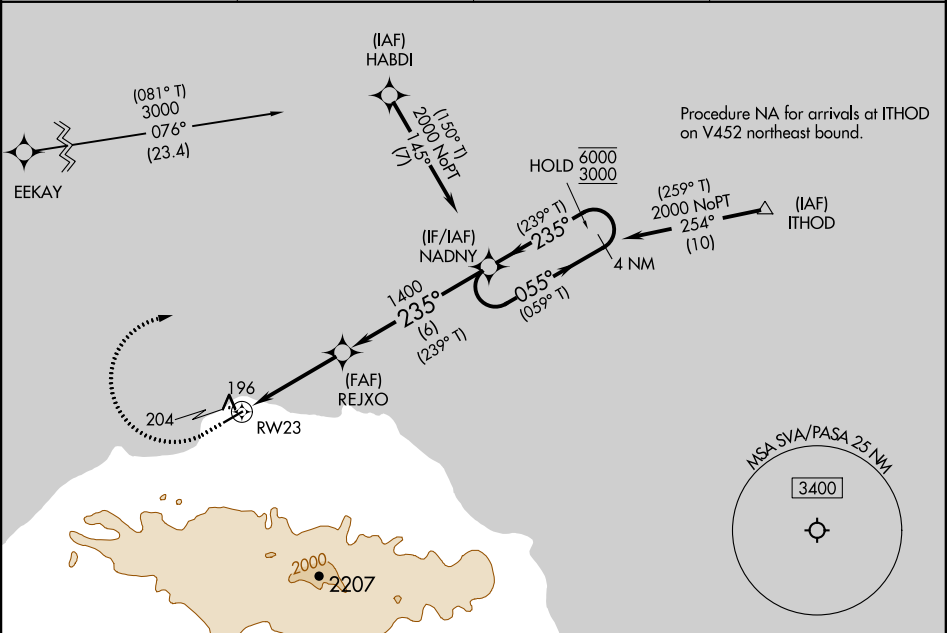


510	2000	NADNY	VGSI and RNAV glidepath not coincident (VGSI Angle 3.00/TCH 24).	4 NM Holding Pattern
↑	↻	✧		
REJXO 1.5 NM to RWY 23 1400 1400 1400 1.5 NM 2.6 NM 6 NM GP 3.00° TCH 30				
CATEGORY	A	B	C	D
LPV DA	308-1		250 (300-1)	
LNAV/VNAV DA	408-1		350 (400-1)	
LNAV MDA	460-1	402 (500-1)	460-1½	402 (500-1½)
CIRCLING	520-1	461 (500-1)	780-2 721 (800-2)	1100-3 1041 (1100-3)

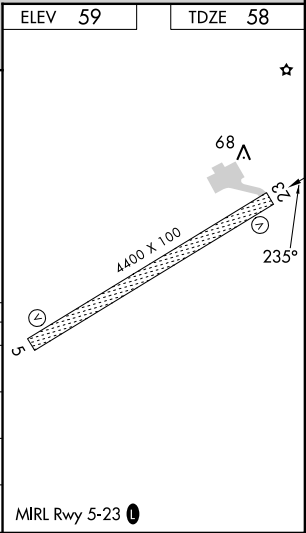

AIRPORT ID: PASA
AIRPORT NAME: SAVOONGA
CITY: SAVOONGA
STATE: AK
PROCEDURE ID: RNAV (GPS) RWY 23 AMDT 2
SCALE: 1:500,000

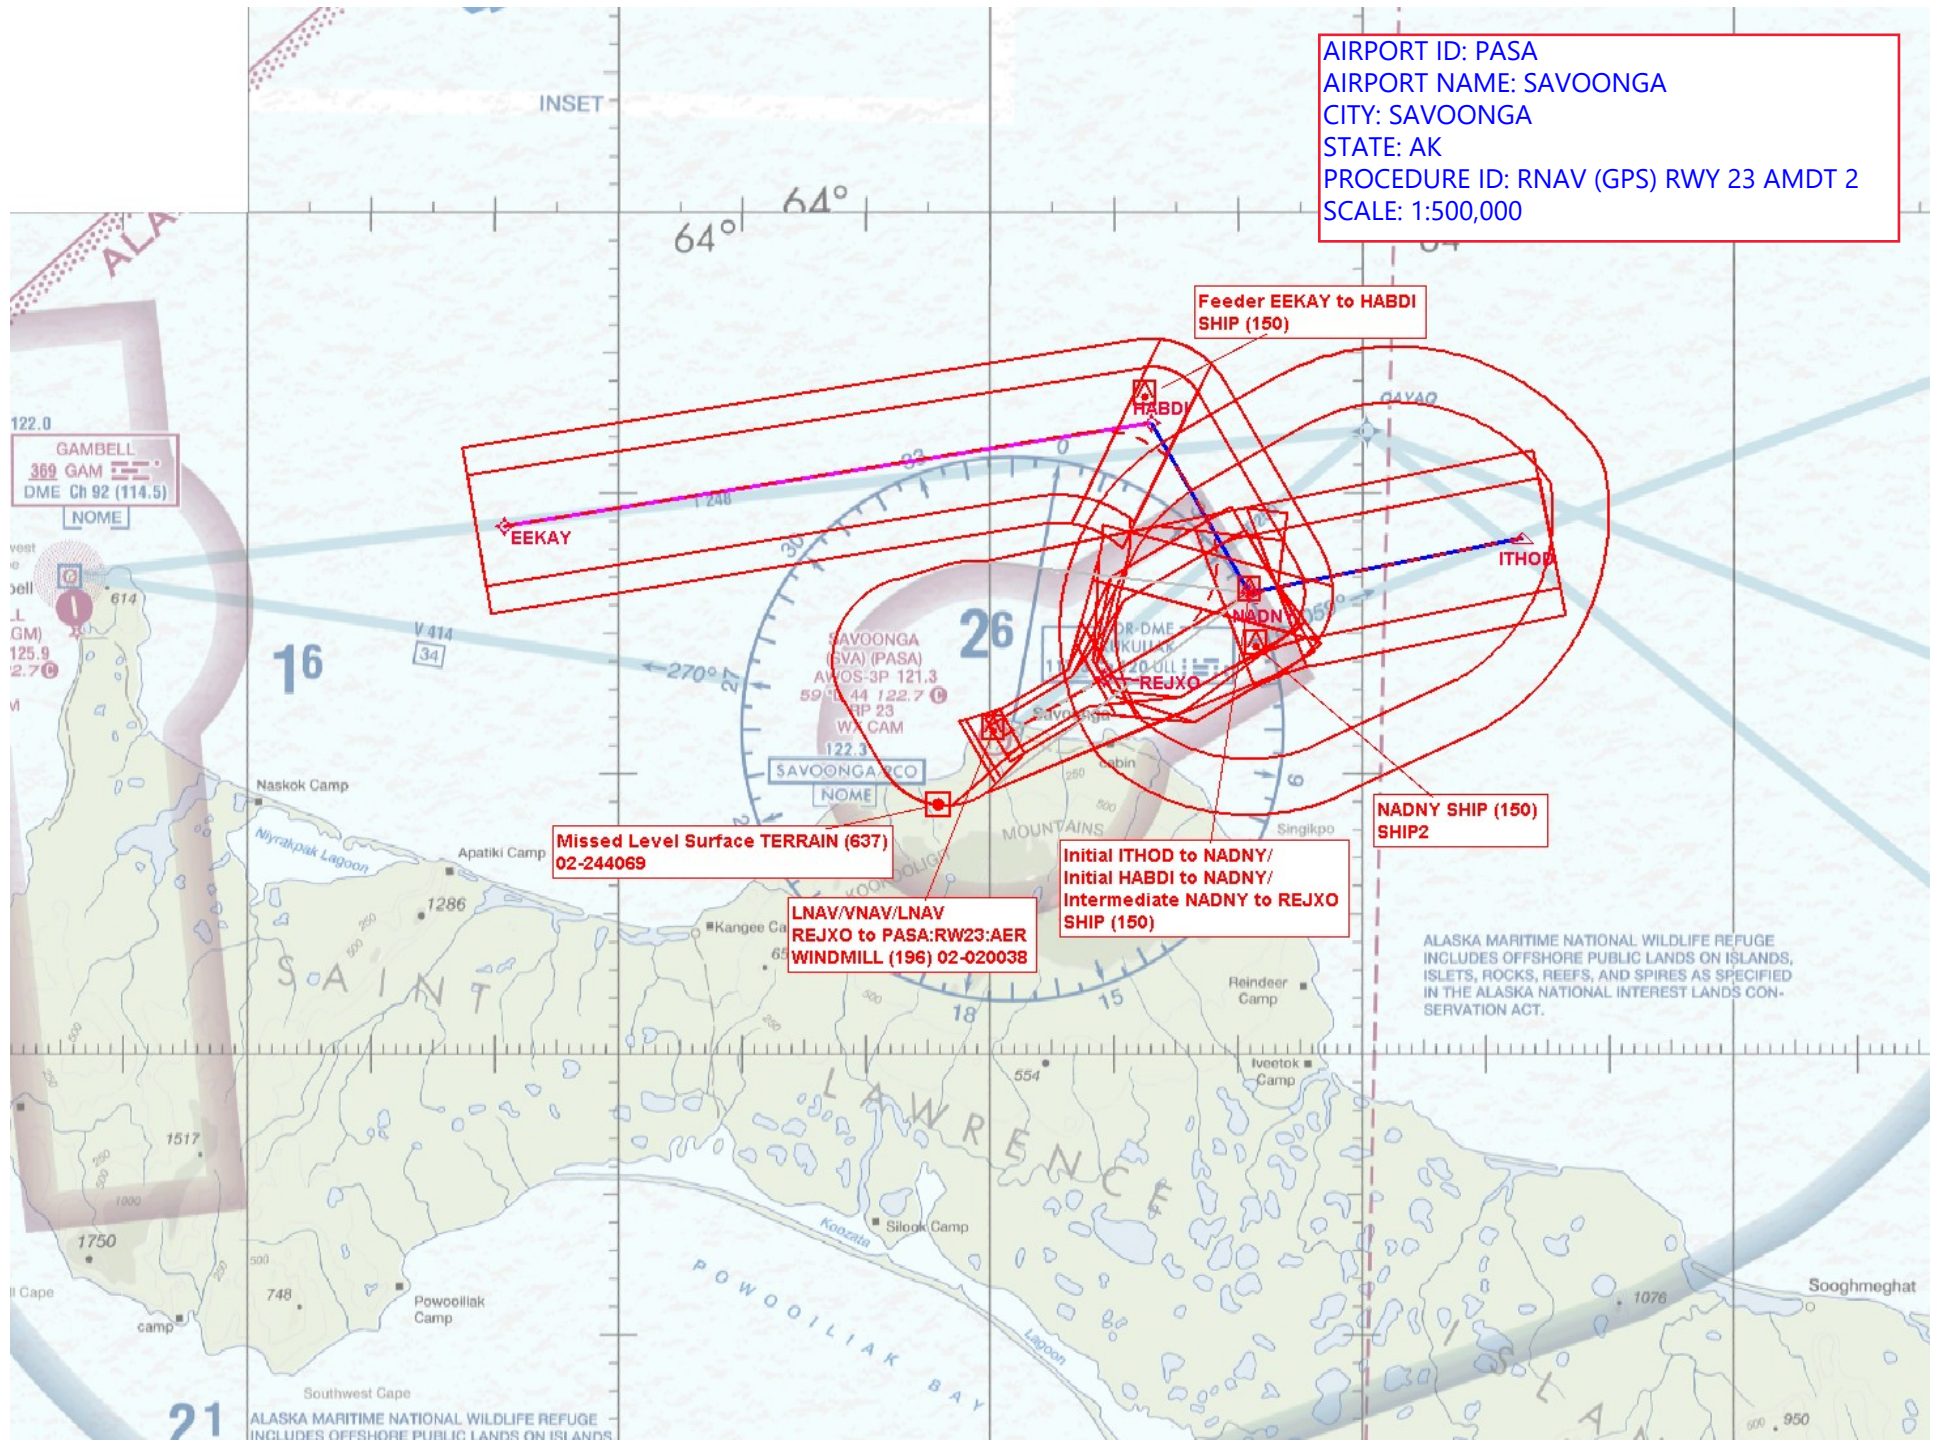

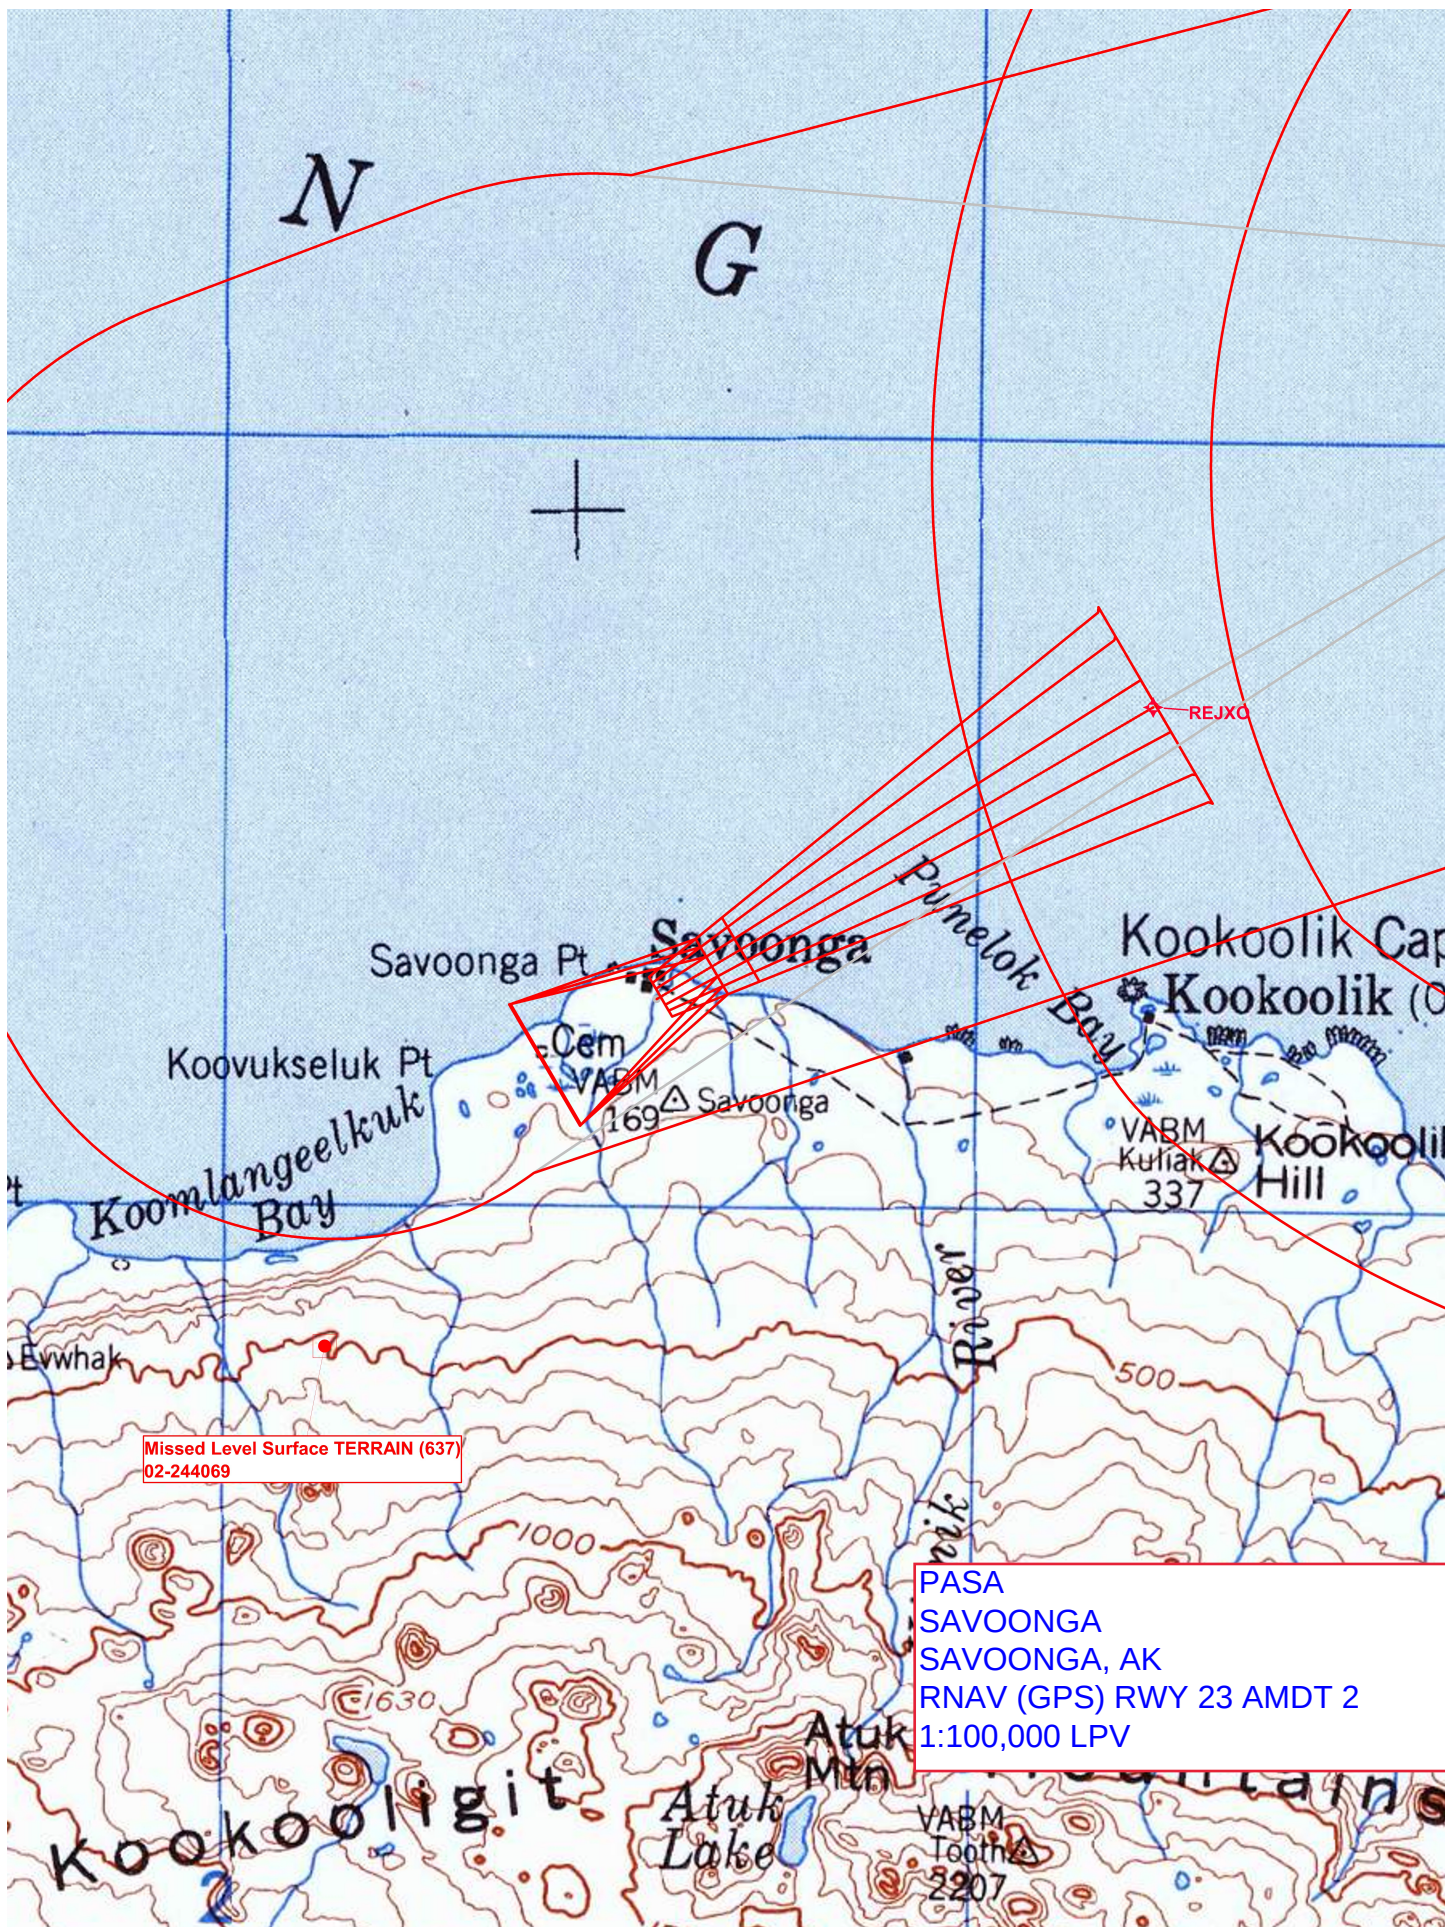

Missed Level Surface TERRAIN (637)
02-244069

PASA
SAVOONGA
SAVOONGA, AK
RNAV (GPS) RWY 23 AMDT 2
1:100,000 LPV

